



IKON  
XL  
Classic  
Explorer  
Verona LE

Verona  
Valencia  
Veracruz  
Vienna  
Villagio

**IMPORTANT SAFETY RECALL**  
**Renegade RV Recall Campaign 25V561**  
**September 19, 2025**  
**THIS NOTICE APPLIES TO YOUR VEHICLE**

Renegade RV  
52216 State Road 15  
Bristol, IN 46507

September 19,2025

Attention: **Renegade Dealer** \_\_\_\_\_  
**This notice pertains to Vin. #** \_\_\_\_\_ **Unit #** \_\_\_\_\_

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Renegade RV has decided that a defect, which relates to motor vehicle safety, exists in certain 2024-2025 Verona and Verona LE vehicles. Upon receipt of this notice the coach with the vin number provided will need to have the inspection and or remedy performed. Renegade RV will execute this remedy (5 hours of labor to inspect and alter the bracket). The service center is to order the part kit (R25V561-007) that Renegade RV will supply at **NO CHARGE** and complete the repair for free.

**What is the issue:** Rear leveling jack mounting brackets were mounted too close to the rear suspension airbags.

**What is the safety risk:** Airbag could come in contact with the jack mounting bracket and deflate the rear airbag allowing the rear suspension to deflate. The rear tires could rub the rear fenders compromising the outer tire of the duals and could result in a crash.

**Identify any warning which can precede or occur:** Low air warning light will come on within the dash cluster

**What is the cause:** The chassis manufacture changed locations of crossmembers altering the identifying bolt locations for the rear leveling jack mounting brackets. When the jack mounting plate was mounted in the fashion that was the prior standard practice the plate could come into contact with the rear airbags when inflated and weighted.

**What is the Remedy:** **At no cost to the customer,** Due to improper placement of the rear leveling jack mounting brackets, the rear suspension air bag may come into contact with the



**IKON  
XL  
Classic  
Explorer  
Verona LE**

**Verona  
Valencia  
Veracruz  
Vienna  
Villagio**

---

mounting bracket. Using the template that will be provided to cut a portion of the mounting bracket back to allow for the appropriate spacing between the air bag and mounting bracket, the possibility of contact will be eliminated. Renegade will compensate for 5 hours of labor to inspect and to alter the leveling jack mounting bracket. If during the inspection there are signs that the air bag did contact the mounting bracket, Renegade will provide a contact email to be used for Renegade to arrange for the rear air bag(s) to be replaced at the closest Freightliner certified service center close to the location of the unit. Renegade will compensate the Freightliner service facility for their required flat rate amounts.

If you have incurred expense to remedy this issue prior to the date of this notice, you may have the opportunity to obtain reimbursement for that expense. For details, contact us at the email address provided.

[renegaderecall@renegaderv.com](mailto:renegaderecall@renegaderv.com)

If you believe that Renegade RV has failed, or is unable to remedy this defect without charge and within a reasonable amount of time, you may submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, S.E. Washington DC 20590; or call the toll free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

Renegade RV is committed to providing the best products that enable our customers to enjoy a mobile lifestyle and we apologize for any inconvenience this may cause.

Best regards,

Kirk Manring  
Customer Service Manager  
Renegade Mfg.



Office: 574-966-0160  
kmanring@renegaderv.com