

OCTOBER 2025**IMPORTANT SAFETY RECALL 25513****NHTSA RECALL NO. 25V534****THIS NOTICE APPLIES TO YOUR VEHICLE IDENTIFIED ON THE ENCLOSED CARD.**

Dear International Customer,

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act.

International Motors, LLC* has decided that a defect which relates to motor vehicle safety exists in certain 2026 International® MV™ Series trucks built 3/3/2025 thru 6/11/2025 with 25" Battery Boxes and/or feature codes listed below:

- MV™ models with 25" Battery Boxes (0008VUX,0008VUY,0008VUG,0008VVH,0008VUW,0008VVG)
- 2 Battery System in All Boxes with Jump Start Stud (0008WBW), which codes an auxiliary 3/8" post on the battery interconnect
- 3 Battery System in Right Side Battery Boxes (0008VUX,0008VUG, or 0008VVH) with Jump Start Stud (0008WBW)
- 3 Battery System in Left Side Battery Boxes (0008VUY,0008VUW, or 0008VVG) with Jump Start Stud (0008WBW) & PDM (0508093)
- 3 Battery System in Left Side Battery Boxes (0008VUY,0008VUW, or 0008VVG) with Disconnect Switch (0008RMH or 0008XHD)

REASON FOR THIS RECALL

Manufacturing variation can allow for contact between battery interconnect cable with auxiliary stud and hold down bracket.

RISK TO MOTOR VEHICLE SAFETY

When contact between these components occurs, a short circuit can develop which may generate excessive heat, which can result in a fire, increasing the risk of property damage or personal injury to the operator.

DEFECT REMEDY

The repair will involve installing 3 wind laces on the battery hold down for insulation, adding a J-bolt between each battery for spacing, and checking for 3 mm terminal clearance after torquing. The repair will be performed free of charge and takes approximately 45 minutes to complete.

ACTIONS YOU SHOULD TAKE

If you own this vehicle, please schedule an appointment with any authorized repair center to have your vehicle repaired at no cost to you. You can find your nearest dealer by using the dealer locator at

<https://www.internationaltrucks.com/dealer-locator> or by calling 1-800-448-7825; or find the nearest Love's centerat <https://www.loves.com>. Love's and Speedco locations in Texas and Louisiana cannot perform warranty services.

If you have already paid for repairs prior to this notice that corrected this defect, you may be eligible for reimbursement of certain repair expenses if they occurred 03/01/2025 thru 10/31/2025. Present your original repair paperwork and proof of payment to any International® dealer and your eligibility will be reviewed. You may also submit a claim using the enclosed Request for Reimbursement card.

If you are the lessor of this vehicle, please forward a copy of this notice to the lessee within ten days to comply with federal regulations.

If you do not own this vehicle, please fill out and return mail the enclosed card so that you will not be contacted again about this recall.

IF YOU NEED FURTHER ASSISTANCE

If you believe that International Motors, LLC has failed to remedy the defect without charge or within a reasonable time, please follow the procedure described in the Owner Assistance Guide section in your Owner's Manual or call toll free 1-800-448-7825.

You may also submit a complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave, SE, Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-888-275-9171); or go to <http://www.safercar.gov>.

International Motors, LLC requests your prompt attention and patience regarding the correction of this defect and apologizes for any inconvenience this may cause you.