

RECALL 25V005 / 2025-008 REMEDY INSTRUCTIONS

 FOREST RIVER	Make(s): SHASTA OASIS & SPIRIT Model(s): MANY, SEE BELOW Model Year(s): 2025	Repair Code: RC-030-01-00-004677 Allotted Time: .50 HRS. Inspection Code: RC-030-05-00-004676 Allotted Time: 10 HRS
	Concern: According to the recall 24E105 filed by InVision: "The center internal aluminum burner tube connecting the gas valve to the cook top burners can be fractured."	Photo(s) Required: N/A Prior Authorization Required: YES Part(s) Kit Number: F100697534 Part(s) Return: NO, FIELD DESTROY

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN 2025 – SHASTA OASIS: SST31QB, SST525BHS, SST526BH, SST526DB, SST526RBS, SST530QB & SST532BEDS
 CERTAIN 2025 – SPIRIT: SBT5260BH, SBT5250BHS, SBT5210CK, SBT5320BEDS, SBT5260RBS & SBT310QB


PLEASE SEE ATTACHED REMEDY INSTRUCTIONS

GAS COOKTOP

GAS LINE REPLACEMENT FOR FRONT BURNER




MODELS:
Three Burner
410-2030

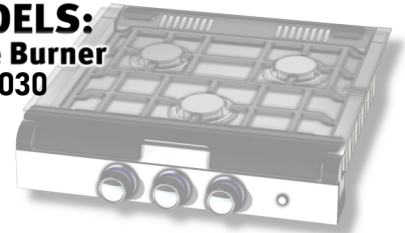

1. Lift glass-lid



2. Lift grate and set to the side

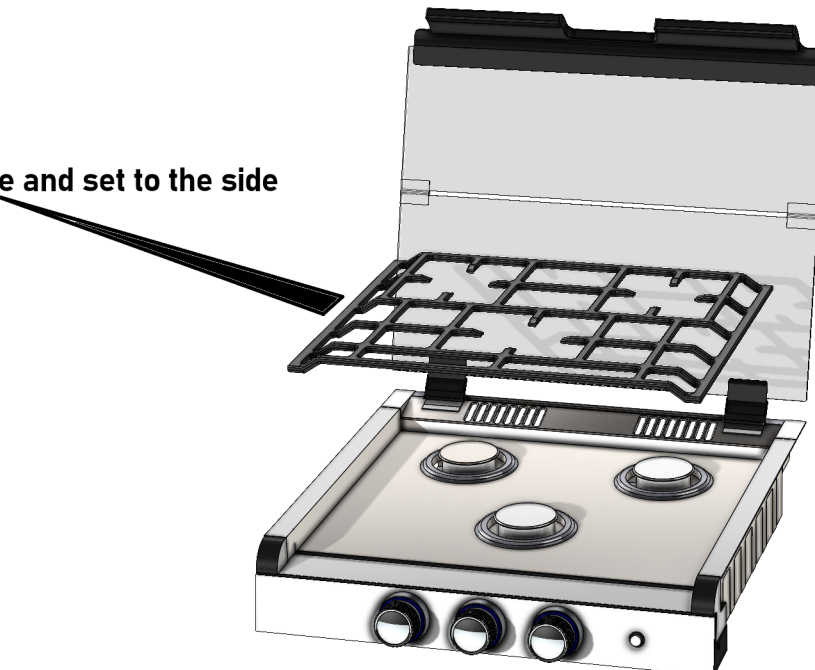


GAS COOKTOP

GAS LINE REPLACEMENT FOR FRONT BURNER




MODELS:
Three Burner
410-2030

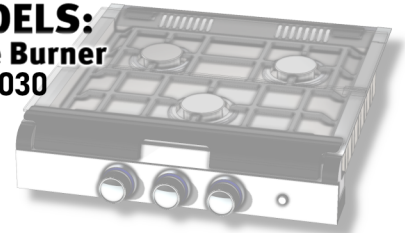

3. Remove 2 screws from rear of pan



4. Lift pan/glass-top away from base and set to the side.


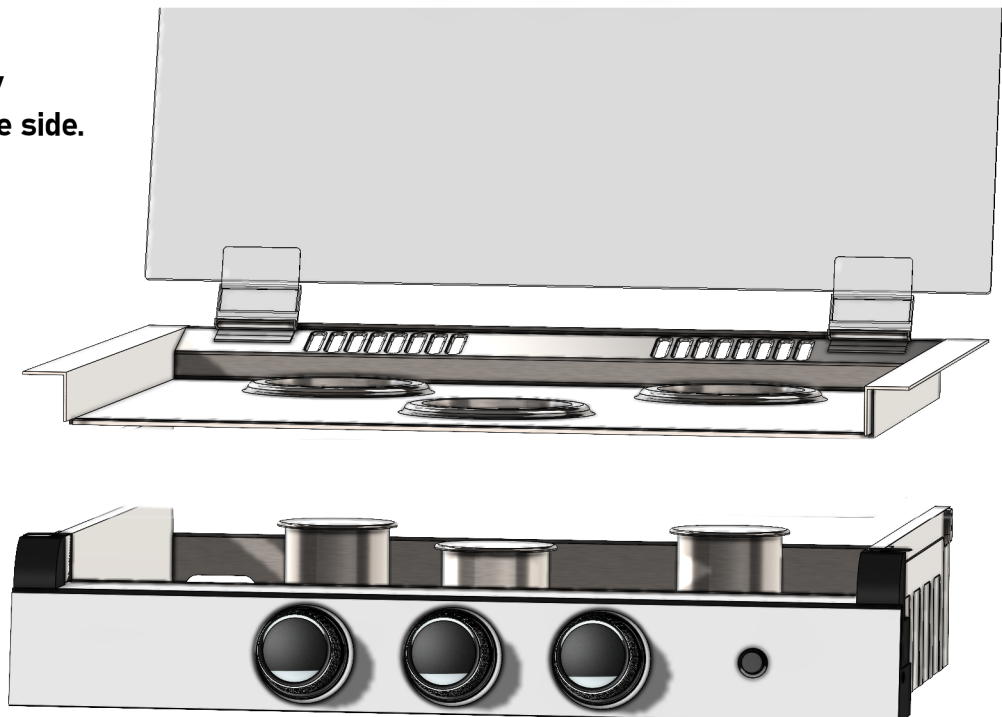


GAS COOKTOP

GAS LINE REPLACEMENT FOR FRONT BURNER



MODELS:
Three Burner
410-2030

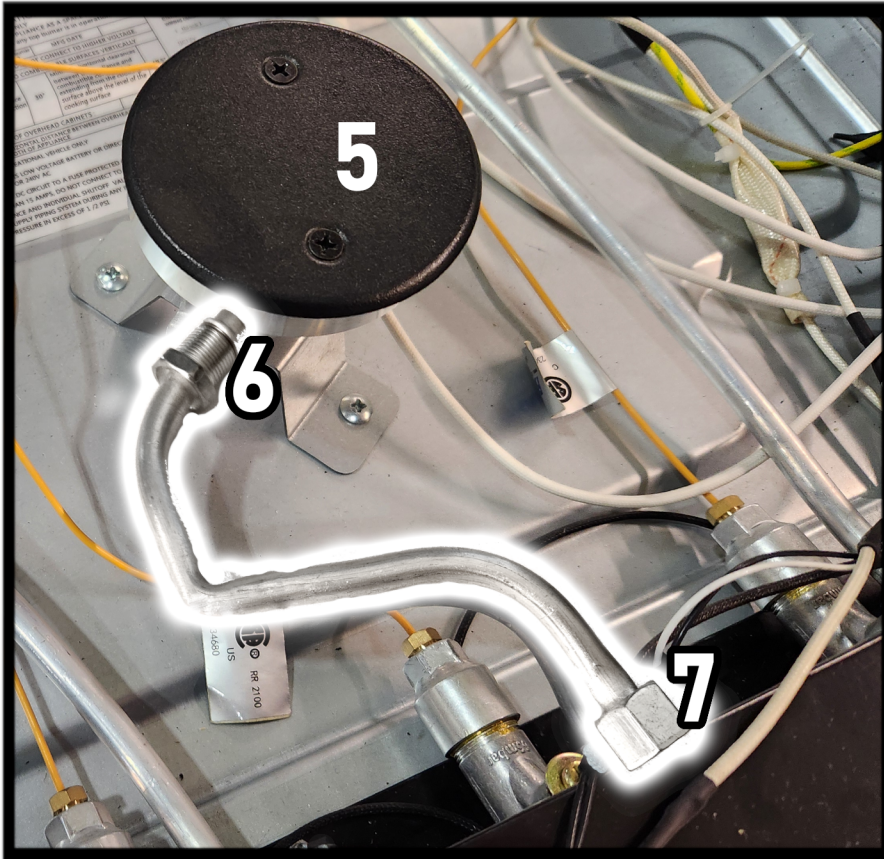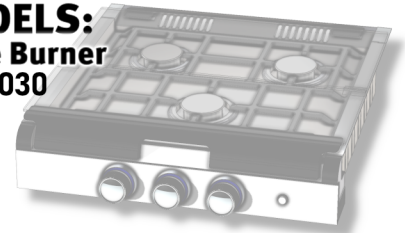

5. Brace burner with one hand so its position isn't altered .

6. With a 14mm wrench carefully turn the connector counter-clockwise.

7. With a 16mm wrench carefully turn the connector counter-clockwise.

8. Follow the procedure in reverse to install new gas line and reassemble cooktop.

