


RECALL 25V069 REMEDY INSTRUCTIONS

 FOREST RIVER	Make(s): ROCKPORT Model(s): MANY, SEE BELOW Model Year(s): 2024 - 2025	Repair Code: RC-065-01-00-004687 Allotted Time: 4.0 HRS. Inspection Code: RC-065-05-00-004686 Allotted Time: .25 HRS.
	Concern: The optional E-Track Cargo Tie Down System may have the incorrect fastener installed.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: SEE BELOW Part(s) Return: NO, DISCARD

Place vehicle in (P) Park and engage the Parking Brake. Block tires/wheels to prevent the vehicle from rolling. Failure to do so may result in personal injury, property damage and/or death.

CERTAIN – 2024 – ROCKPORT: RP5A18102108DH, RP5A2210296DH, RP5A24102108DH, RPAA1066N, RPAA128078, RPAA1470, RPAA148084, RPAA149078, RPAA1570, RPAA158078, RPAA159078, RPAA1670, RPAA1676, RPAA1676DH, RPAA1770, RPAA179696, RPAA1876DH & RPAF149084

***** Rockport Sheet and Post Construction Truck Bodies with E-Track recessed into Plywood liner and attached to Vertical Wall Studs**

CERTAIN – 2025 – ROCKPORT: RPAA128078, RPAA148078, RPAA1570, RPAA159078, RPAA1670, RPAA1676, RPAA169078, RPAA1770, RPAA1776-DH, RPAA179696, RPAF12FX & RPAF149084

***** Rockport Sheet and Post Construction Truck Bodies with E-Track recessed into Plywood liner and attached to Vertical Wall Studs**

INSPECTION:

STEP 1. LOOK AT THE E-TRACK SECUREMENT

- IF ALL OF THE FASTENERS ARE A STEEL RIVET, CLAIM INSPECTION CODE;
- IF THE FASTENERS ARE NOT A STEEL RIVET, MOVE ON TO REMEDY;

FOR REMEDY: ORDER PROPER RIVETS FROM ROCKPORT:

- KIT: 26FTETRACK 104 RIVETS
- KIT: 16FTETRACK 64 RIVETS

REMEDY:

STEP 1. REMOVE WALL PLYWOOD AS NEEDED;

STEP 2. REMOVE #8 - 1/2" SCREWS ATTACHING THE E-TRACK TO THE WALL;

STEP 3. INSTALL 3/16" X .251" - .375" STEEL RIVET IN THE SCREWS PLACE;

STEP 4. REPEAT FOR EACH FASTENER FOR ALL OF THE E-TRACK(S) IN THE VEHICLE;

STEP 5. REINSTALL PLYWOOD AS NEEDED WHERE IT WAS REMOVED.