


RECALL 25V149 REMEDY INSTRUCTIONS

 FOREST RIVER	Make(s): Aurora Model(s): ART26BHS Model Year(s): 2025	Repair Code: RC-003-01-00-004693 Allotted Time: .30 HRS. Inspection Code: RC-003-05-00-004692 Allotted Time: .10 HRS.
	Concern: An incorrect/undersized WAGO electrical connector may have been installed which resulted in strands of wire exposed.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: SOURCE LOCALLY Part(s) Return: FIELD DESTROY

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

INSPECTION

STEP 1: ACCESS THE AIR CONDITIONER 110VAC CONNECTIONS AT THE AIR CONDITIONER;

- IF THE 110VAC WAGO CONNECTOR HAS "20-10" PRINTED ON IT, CLAIM THE INSPECTION CODE;
- IF THE 110VAC WAGO CONNECTOR HAS "24-12" PRINTED ON IT, MOVE ON TO REMEDY;

REMEDY

STEP 1: REMOVE THE HOT (BLK. WIRE), NEU. (WHITE WIRE) AND GRN. (GROUND WIRE) FROM THE WAGO CONNECTOR;

STEP 2: CLEANLY CUT AND STRIP THE WIRE(S)

STEP 3: USING A "20-10, 2 SLOT WAGO" CONNECTOR, MATCH THE WIRES AND SECURELY LATCH THE CONNECTOR(S);

STEP 4: TEST THE AIR CONDITIONER FOR PROPER FUNCTIONALITY;

STEP 5: CLAIM THE REPAIR CODE.