


# RECALL 25V162 / 2025-130 REMEDY INSTRUCTIONS

 <b>FOREST RIVER</b>	Make(s): XLR & Nightfall Model(s): Many Model Year(s): 2025	Repair Code: RC-036-09-00-004697 Allotted Time: .30 HRS. Inspection Code: RC-036-05-00-004696 Allotted Time: .10 HRS.
	Concern: The breakaway switch may not be correctly wired to constant hot. This condition may lead to the failure of the brake-away switch to activate in an emergency.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: N/A Part(s) Return: N/A

**Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.**

## **INSPECTION**

STEP 1: LOCATE AND UNFASTEN THE BATTERY DISCONNECT SWITCH FROM WHERE ITS MOUNTED;

STEP 2: LOCATE THE BATTERY POSITIVE "RED" CABLE;

- NOTATE WHICH STUD IT IS TERMINATED ONTO;

STEP 3: TRACE THE WIRE FROM THE BREAK-AWAY SWITCH INTO THE BATTERY DISCONNECT;

- IF THE BREAK-AWAY WIRE IS TERMINATED ON THE SAME POST AS THE BATTERY POSITIVE CABLE, REASSEMBLE SWITCH AND CLAIM INSPECTION ONLY;
- IF THE BREAK-AWAY WIRE IS TERMINATED ON THE OTHER POST, MOVE ON TO REMEDY;

## **REMEDY**

STEP 1: REMOVE THE NUT AND REMOVE THE BREAK-AWAY SWITCH WIRE;

- REATTACH ANY WIRE(S) YOU MAY HAVE HAD TO REMOVE FROM THIS STUD;
- TIGHTEN NUT BACK DOWN ON THE STUD AND ENSURE IT IS TIGHT;

STEP 2: REMOVE THE NUT FROM THE STUD WHERE THE BATTERY POSITIVE CABLE IS TERMINATED ONTO THE BATTERY DISCONNECT SWITCH;

STEP 3: INSTALL TERMINAL END OF THE BREAK-AWAY SWITCH TO THE POST OF THE BATTERY POSITIVE SIDE OF THE BATTERY DISCONNECT SWITCH;

- TIGHTEN NUT BACK DOWN ON THE STUD AND ENSURE IT IS TIGHT;

STEP 4: REATTACH THE BATTERY DISCONNECT SWITCH BACK TO THE MOUNT;

STEP 5: TEST BREAK-AWAY SWITCH FOR PROPER FUNCTIONALITY;

STEP 6: CLAIM REPAIR CODE.