

Recall Campaign Bulletin



Mercedes-Benz

May 2025

TO: ALL MERCEDES-BENZ CENTERS

CAMPAIGN NO.	2025040012
CAMPAIGN DESC.	25P9192004
NHTSA ID	25V253
SUBJECT	Check Seat Belt Tensioner Cover
MODEL(S)	C-Class (206 platform)
MODEL YEAR(S)	2022 – 2025
CAMPAIGN POPULATION	46

Campaign Technical Instructions

Prior to performing this Campaign:

Check the Vehicle Master Inquiry (VMI) to verify this campaign applies to the specific vehicle.

Always check for other open campaigns and perform them accordingly!

Review the entire campaign bulletin first, and perform the procedures exactly as described.

Order No. P-RC-2025040012

Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin

Recall Campaign Bulletin

Primary Parts Information

Qty.	Part Name	Part Number
As required (1)	Seat belt tensioner cover, left seat	A 213 868 00 39

Primary Repair Information

Operation Step	Document Number
Step 1 – Check/Test	AR91.10-P-1201WT
Step 1 – Work Procedure	AR91.40-P-1030-02LWE

Check/Test procedure

1. Remove the outer seat trim from the driver seat (**Figure 1, A**).

i For basic data, see AR91.10-P-1201WT.

NOTE: Only the trim (**Figure 1, A**) needs to be removed!

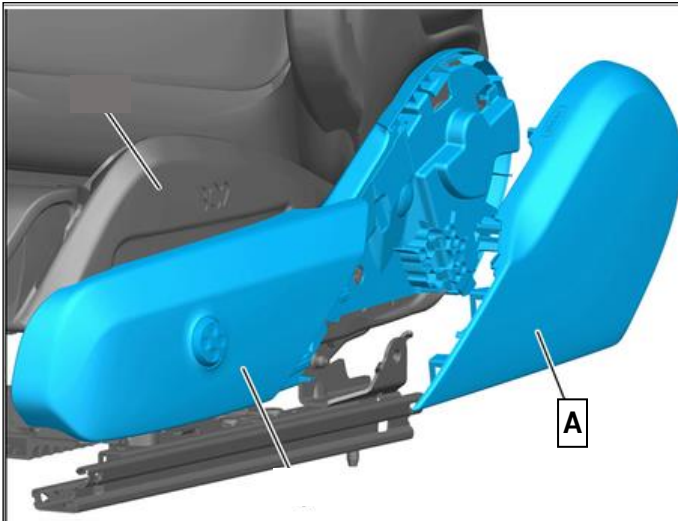


Figure 1

2. Check seat belt end-fitting (**Figure 2, A**) for correct installation.

i It is essential that the seat belt tensioner cover (**Figure 2, B**) is installed.

i The seat belt tensioner cover (**Figure 2, B**) could be missing from the vehicle.

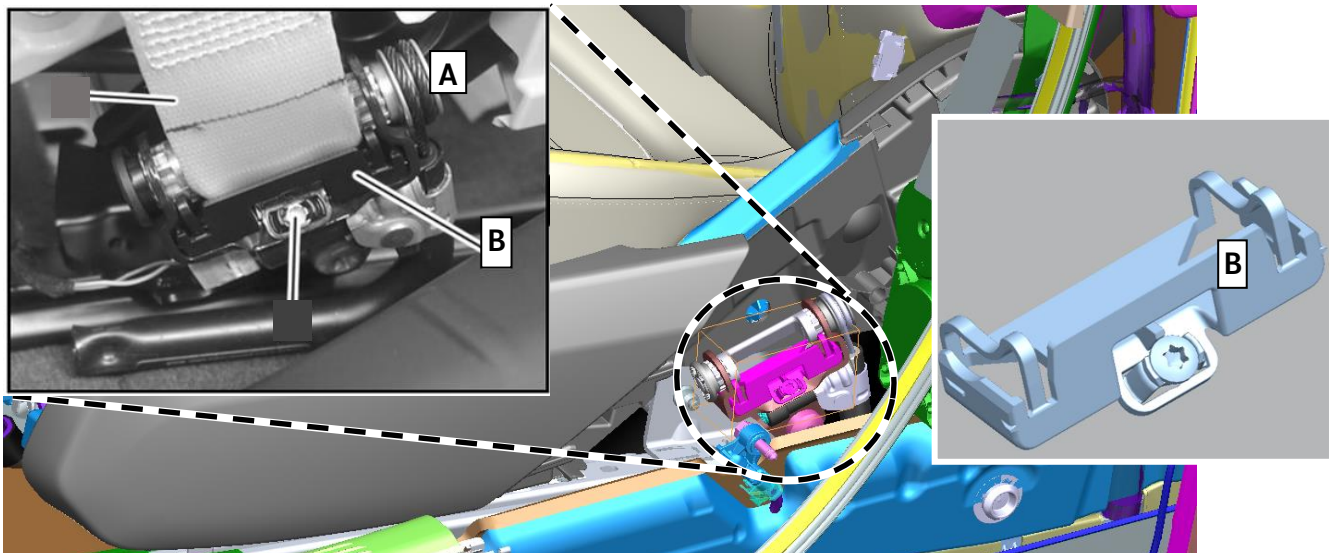


Figure 2

- a. If the seat belt is not connected to the seat belt end-fitting tensioner (**Figure 2, A**) and/or the seat belt tensioner cover (**Figure 2, B**) is **not** installed: Carry out **Work Procedure**.
- b. If the seat belt end-fitting is installed correctly: **End measure**.

Work Procedure

1. Correctly install seat belt end-fitting (**Figure 2, A**) and retrofit seat belt tensioner cover (**Figure 2, B**), if necessary.
i For basic data, see **AR91.40-P-1030-02LWE**.
 2. Assemble in reverse order
-

Warranty Information

i **Note:** *The following allowable labor operation should be used when submitting a warranty claim for this repair:*

Damage Code	Operation Number	Description	Labor Time (hrs.)
91 920 04	12-0001	Check seat belt end-fitting and tensioner cover on driver's seat	0.2
	12-0002	Rework seat belt end-fitting on driver's seat (after check)	0.1

i **Note:** *Always check Xentry Operation Time (XOT) for the current OP-Code times. Labor times are subject to change and updates may not be reflected in this document.*