



Thor Motor Coach Recall Repair Instructions

Recall #	25V-301		
Description/Title:	MoRryde Step Bracket		
Affected Product Line(s):	Certain MY 2025-26 Outlaw		
Service Campaign # :	RC000301		
Repair Code:	Inspect with Repair: TMCRC10199V	Document Date:	6/5/2025
Time Allowed:	Inspect with Repair: 0.25	Document Revision:	A

Issue:

It has been discovered that on certain model year 2025-26 Outlaws, the receiver for the removable step may not have been attached properly. Inspect and replace the step retainer bracket with the replacement kit provided by MorRyde.

Parts:

Kit # 0589317

Instructions:

Follow the attached instructions provided by MoRryde



Thor Motor Coach Recall Repair Instructions



CLIP-ON BRACKET

REPLACEMENT INSTRUCTIONS FOR THP56-143



Thor Motor Coach
1-877-500-1020
NHTSA Recall # 25V-301

CLIP-ON BRACKET

INSTALLATION INSTRUCTIONS

Allowable Labor Time: 15 minutes

Tools Required:

- 3/8" Wrench/Ratchet
- Drill with 3/8" Driver Bit

STEP 1

Remove the 12 mounting screws that secure the THP56-143 mounting bracket. Once removed, discard the original mounting bracket.

Note: It is OK to use a drill for the removal of each of the screws.



STEP 2

Use the replacement kit (THP54-118) to attach the new mounting bracket. To install the new bracket, start by installing 12 mounting screws into the 12 original holes.

Note: The above mentioned holes will line up with the holes from the bracket that was removed.

Note: To avoid over-torquing these screws, it is necessary that final tightening be by hand with a 3/8" wrench.



STEP 3

Use a drill and 3/8" driver to install the four new screws in the mounting brackets.

Note: To avoid over-torquing these screws, it is necessary that final tightening be by hand with a 3/8" wrench.

