


RECALL 25V364 / 2025-302 REMEDY INSTRUCTIONS

 FOREST RIVER	Make(s): Salem & Wildwood Model(s): See Below Model Year(s): 2025	Repair Code: RC-033-09-00-004719 Allotted Time: .25 HRS. Inspection Code: N/A Allotted Time: N/A
	Concern: The entry gates' latch may become unlocked resulting in the strut keeping the entry gate in the open position during travel.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100753875 Part(s) Return: NO – FIELD DESTROY

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN 2025 – SALEM: SMT22VERANDA, SMT32VERANDA, SMT34VERANDA & SMT42VERANDA
CERTAIN 2025 – WILDWOOD: WDT22VERANDA, WDT32VERANDA, WDT34VERANDA & WDT42VERANDA

STEP 1: LOCATE AND REMOVE THE STRUT AND MOUNTING BRACKETS SECURED TO THE GATE AND THE DECK (FIGURE 1);

- RE-INSTALL THE FASTENERS INTO THEIR RESPECTIVE HOLES
- DISCARD THE STRUT AND MOUNTING BRACKETS
- FIGURE 1 SHOWS THE GATE WITH THE STRUT
- FIGURE 2 SHOWS THE GATE WITHOUT THE STRUT

STEP 2: LOCATE THE GATE LATCH

- WIPE THE TOP RAIL WITH ISOPROPYL ALCOHOL AND APPLY THE LABEL AS DEPICETED IN FIGURE 3;

STEP 3: LOCATE THE FASTENER AT THE TOP LEFT OF THE GATE LATCH;

- REMOVE THE SCREW/FASTENER;
- INSERT THE SCREW/FASTENER INTO THE TEATHER/CHAIN THAT HAS THE LATCH PIN ALREADY ATTACHED;
- RE-INSTALL THE SCREW/FASTENER BACK INTO THE HOLE;
- THIS IS ALSO DEPICETED IN FIGURE 3;

STEP 4: TEST FOR PROPER FUNCTIONALITY;

STEP 5: CLAIM REPAIR CODE.

FIGURE 1



FIGURE 2



FIGURE 3

