

- b. Install screw (3) and nut (4). Tighten.
Torque: 32.8–36.3 N·m (24–27 ft-lbs) *Shock Adjuster Mounting Screw*
- c. Install anchored cable strap (2).
- 5. Install seat. See service manual.

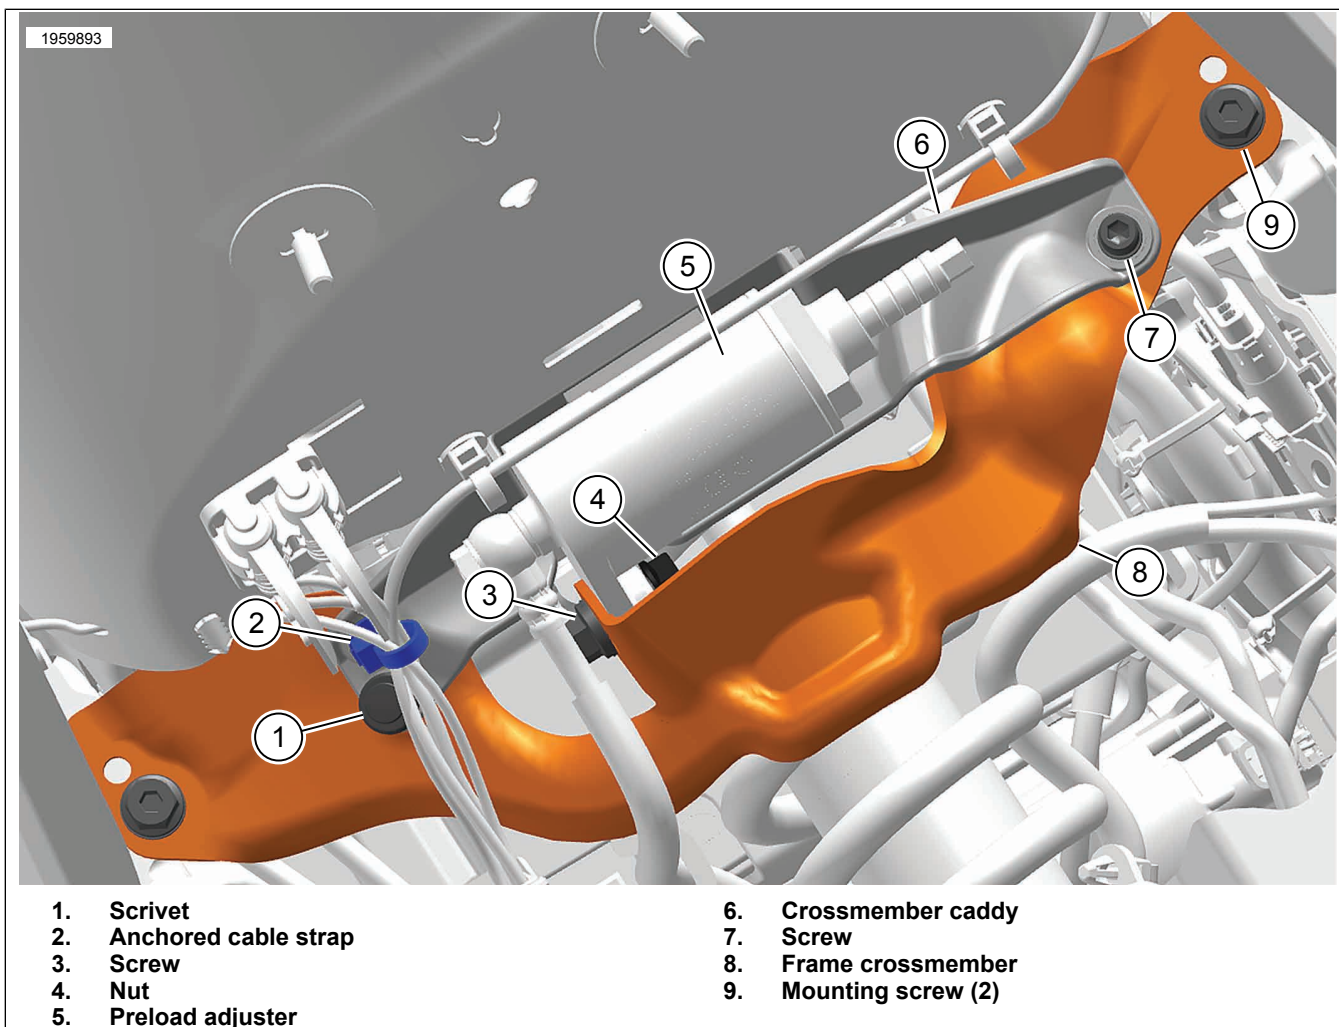


Figure 1. Shock with Preload Adjuster

Credit Procedure

NOTE

Enter bulletin number into comment section of claim.

If vehicle is equipped with a shock other than the Original Equipment (OE) shock, see credit procedure for inspection only.

Confirm that the vehicle is involved in Safety Recall 0188 and has the OE shock installed. If the status includes an open for Safety Recall 0189, perform only this recall (0188). Safety Recall 0189 will be closed automatically by Harley-Davidson once the 0188 claim is issued credit.

For each vehicle involved in this recall (involvement of Vehicle Identification Number (VIN) has been verified on h-dnet.com) and currently does not have the OE shock installed, submit a recall claim per Table Below. INSPECTION ONLY.

Table 4. Credit Procedure: Talon/h-dnet.com Warranty Claim System - INSPECTION ONLY

ITEM	DATA
Claim Type	SRC
Problem Part Number	10200142
Quantity	Leave Blank
Primary Labor Code ⁽¹⁾	2778
Labor Time	0.1 hours
Customer Concern Code	0188
Condition Code	9981
<i>(1) Download may be required</i>	

Table 5. Credit Procedure: GDP/SAP system users - INSPECTION

ITEM	DATA
Claim Type	Recall Claim
Fix ID-Found in Recall Number ⁽¹⁾	I
Problem Part Number	10200142
Customer Concern Code	0188
Condition Code	9981
<i>(1) Download may be required</i>	

Upon submission of the properly completed claim, you will be credited for 0.1 hours of labor time for performing the procedure, plus appropriate administrative time. Submit campaign events on their own warranty claim. Do not mix them with other warranty events.

NOTE

When submitting a claim for Inspection Only, this will close out the recall. Do not make the repair at a later date and file another claim.

For each vehicle involved in this recall and shock is Original Equipment Manufacturer (OEM) (involvement of VIN has been verified on h-dnet.com), submit a recall claim per the table below. REPAIR

Table 6. Credit Procedure: Talon/h-dnet.com Warranty Claim System Users - REPAIR

ITEM	DATA
Claim Type	SRC
Problem Part Number	10200142
Quantity	Leave Blank
Primary Labor Code ⁽¹⁾	2781
Labor Time	0.3 hours
Customer Concern Code	0188
Condition Code	9982
Replacement Part Number	91500124
Quantity	1
<i>(1) Download may be required</i>	

Table 7. Credit Procedure: GDP/SAP system users - REPAIR

ITEM	DATA
Claim Type	Recall Claim
Fix ID-Found in Recall Number ⁽¹⁾	R
Problem Part Number	10200142
Customer Concern Code	0188
Condition Code	9982
<i>(1) Download may be required</i>	

Upon submission of the properly completed claim, you will be credited for 0.3 hours of labor time for performing the procedure, plus appropriate administrative time. Credit will also be issued for the recall kit (United States only). Submit campaign events on their own warranty claim. Do not mix them with other warranty events.

Return Parts

Hold all claimed parts for 60 days from date of credit issued for possible field inspection and/or request to return to factory. After 60 days, destroy and discard the parts.