


RECALL 25V425 / 2025-343 REMEDY INSTRUCTIONS

 FOREST RIVER	Make(s): SALEM & WILDWOOD Model(s): ROOST43 Model Year(s): 2025 - 2026	Repair Code: RC-034-09-00-004727 Allotted Time: .25 Inspection Code: N/A Allotted Time: N/A
	Concern: The entry patio door, which is the main egress, may have an exterior transit latch which may not be operated from inside the vehicle if locked.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100763300 Part(s) Return: NO, FIELD DESTROY

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

STEP 1: LOCATE THE TRANSIT LATCH, RUBBER BUMPER AND REMOVE (FIGURE 1)

- KEEP THE THREE FASTENERS FOR USE LATER;
- SCREWS HAVE RED ARROWS IN FIGURE 1;

STEP 2: CLEAN THE SURFACE AND REMOVE ANY REMAINS OF PUTTY/FOAM/SEALANT;

STEP 3: FILL THE FOUR HOLES WITH SILICONE;

STEP 4: PLACE THE METAL SIGN OVER THE THREE HOLES AND ALIGN WITH THE SCREW HOLES (FIGURE 2);

STEP 5: INSTALL THE METAL SIGN AND TIGHTEN, DO NOT STRIP;

- REUSE THE THREE SCREWS FROM STEP ONE;
- INSTALL TWO ADDITIONAL SCREWS USING SEALANT;
- INSTALL SCREWS IN ALL HOLES OF THE "FR" SIGN;

STEP 6: CLEAN AREA;

STEP 7: CLAIM REPAIR CODE.

FIGURE 1 – REMOVE FASTENERS/BUMPER/BRACET

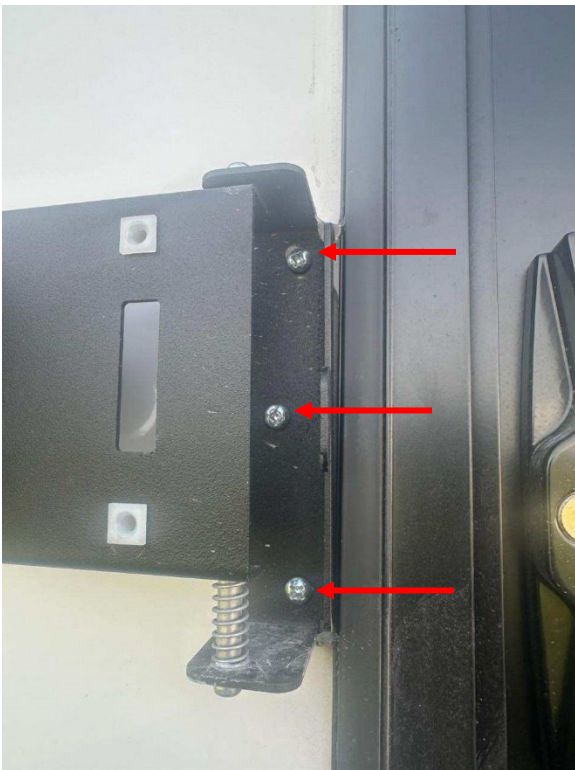


FIGURE 2 – REPLACEMENT PLATE

