

Parts Bulletin

TITLE:

Recall RP1063 - PS3 Cable Harness, Model Year 2025 Polestar 3

GROUP:

37

NO:

RP1063

CAR MARKET:

United States and Canada

REVISIONS:

ISSUE DATE:

2025-07-07

STATUS DATE:

2025-07-07**Page 1 of 3**

Polestar Automotive USA, on behalf of Polestar Performance AB, have decided to launch Recall RP1063 on certain model year 2025 Polestar 3 vehicles.

Polestar has identified that the inline connector located between the engine bay cable harness and the front bumper cable harness may experience water ingress into the connector housing, which has led to corrosion on the connector pins.

As a result, water entering the connector housing may affect the vehicles' electrical systems, increasing the risk of a crash or injury.

A total of 969 U.S. and 1,100 Canadian vehicles are affected by this recall.

To remedy the affected vehicles, Polestar will replace the entire front bumper cable harness

AND

- Replace the two inline front bumper/engine bay connectors (left and right) on the engine bay cable harness.

VIN start: YSREA3YBXXXXXXXXXX**Chassis start: XXXXXXXX****VIN end: YSREE3YBXXXXXXXXXXX****Chassis end: XXXXXXXX****OR**

- Replace the male side of the inline front bumper/engine bay connector on the engine bay cable harness.

VIN start: YSREA3YBXXXXXXXXXX**Chassis start: XXXXXXXX****VIN end: YSREE3YBXXXXXXXXXX****Chassis end: XXXXXXXX**

Parts Bulletin 37-RP1063

Important Note:

- When performing wire splicing, ensure that the wire is free from corrosion. If any oxidation or contamination is present, clean the wire thoroughly before proceeding.
- If oxidation or discoloration is found on the wire, it is not necessary to replace the entire wire. Clean only the section of the wire where the splice will be made.

VIN start: YSREA3YBXXXXXXXXXX
Chassis start: XXXXXXXX

VIN end: YSREE3YBXXXXXXXXXX
Chassis end: XXXXXXXX

Part Number	Qty	Description
32412071	1	Cable harness (N PPS), US & CA

The remaining material is valid for both variants:

Part Number	Qty	Description
31268299	7	Sealing plug
31344077	1	Tab housing 16-pole
31409249	11	Repair terminal
31409361	1	Receptacle housing 20-pole
32473015	29	Solder joint sleeve 1,7*
32473257	18	Repair terminal

VIN start: YSREA3YBXXXXXXXXXX
Chassis start: XXXXXXXX

VIN end: YSREE3YBXXXXXXXXXX
Chassis end: XXXXXXXX

Part Number	Qty	Description
32412078	1	Cable harness (N PPS, N HAD), US & CA

The remaining material is valid for both variants:

Part Number	Qty	Description
31409739	32	Repair terminal (0.75 mm)
31450880	1	Repair terminal (2.5 mm)
31499042	2	Plug (2.8 mm)
32264960	6	Plug (0.64 mm)
32264961	8	Plug (1.5 mm)
32331826	1	Tab housing
32452884	2	Repair terminal (1.5 mm)
32473015	35	Solder joint sleeve 1,7*
32473016	1	Solder joint sleeve 2,7*
32473228	1	Repair terminal

Parts Bulletin 37-RP1063

*If a larger quantity is required for any reason, please purchase the dedicated sleeves from your local Würth store. It is essential to use the correct soldering sleeves when performing the repair.

Würth P/N US	Volvo P/N	Description
055592070	32473015	SOLDER JOINT SLEEVE 1,7
055592071	32473016	SOLDER JOINT SLEEVE 2,7