


RECALL 25V464 / 2025-373 REMEDY INSTRUCTIONS

 FOREST RIVER	Make(s): TRACER & WESTBROOK Model(s): TRT235RK & WBT245RKLC Model Year(s): 2026	Repair Code: RC-026-01-00-004726 Allotted Time: 1.00 HRS. Inspection Code: N/A Allotted Time: N/A
	Concern: The LP gas line may be routed incorrectly to the furnace.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100768720 Part(s) Return: NO – FIELD DESTROY

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

PARTS KIT: F100768720

- 1 – 9' LP GAS HOSE
- 1 – 27" X 36" PRAIRIE BROWN ACCESS PANEL
- 1 – 36" X 10" MALT ACCESS PANEL

STEP 1: REMOVE ACCESS PANEL(S) UNDER THE TUB;

- IF YOUR UNIT HAS A DRAWER, THERE IS NOT AN ACCESS PANEL, REMOVE DRAWER TO GAIN ACCESS;

STEP 2: ROUTE OUT FRAMED HOLE ABOVE COLD AIR RETURN;

STEP 3: DISCONNECT LP GAS HOSE FROM THE FURNACE;

STEP 4: PULL LP GAS HOSE DOWN THROUGH THE FLOOR AND DISCONNECT FROM MANIFOLD;

STEP 5: MEASURE 12" REARWARD AND 9" INBOARD FROM THE CURRENT LP GAS HOSE ENTRY AND CUT A HOLE INTO THE UNDERBELLY SMALL ENOUGH TO FIT THE REPLACEMENT 9' LP GAS HOSE INTO;

STEP 6: RUN THE NEW 9' LP GAS HOSE UP THROUGH THE NEW HOLE AND ROUTE UNDER THE TUB BASE TO THE FURNACE;

STEP 7: ENSURE A GROMMET IS PRESENT IN THE FURNACE LP GAS HOLE OPENING;

- CONNECT THE LP GAS HOSE TO THE FURNACE AND TIGHTEN APPROPRIATELY;
- USE ZIP TIES TO RESTRAIN THE LP GAS HOSE AWAY FROM THE FURNACE BODY;
- USE ZIP TIES TO RESTRAIN THE LP GAS HOSE AWAY FROM ANY SHARP EDGES, SCREWS, NAILS, STAPLES ETC.;

STEP 8: CONNECT THE LP GAS LINE UNDER THE VEHICLE TO THE MANIFOLD;

- RESTRAIN THE LP GAS HOSE TO THE BOTTOM OF THE VEHICLE WITH OFF THE SHELF "P-CLAMPS/R-CLAMPS";

STEP 9: CONDUCT LP GAS DROP TEST TO CHECK FOR ANY LEAKS;

- REPAIR AS NECESSARY
- THIS CAMPAIGN DOES NOT COVER LEAKS OUTSIDE OF THE SCOPE OF THESE REMEDY INSTRUCTIONS; CLAIM THOSE AGAINST THE APPROPRIATE REPAIR CODE(S).


STEP 10: INSTALL PROVIDED ACCESS PANEL AND COLD AIR RETURN WITH SCREWS

- THESE NEED TO BE REMOVABLE;

STEP 11: INSTALL PROVIDED ACCESS PANEL UNDER THE TUB WITH SCREWS;

- NEEDS TO BE REMOVABLE;
- OR – REPLACE DRAWER AS APPLICABLE;

RECALL 25V464 / 2025-373 REMEDY INSTRUCTIONS

	Make(s): TRACER & WESTBROOK Model(s): TRT235RK & WBT245RKLC Model Year(s): 2026	Repair Code: RC-026-01-00-004726 Allotted Time: 1.00 HRS. Inspection Code: N/A Allotted Time: N/A
	Concern: The LP gas line may be routed incorrectly to the furnace.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100768720 Part(s) Return: NO – FIELD DESTROY

STEP 12: RESEAL EXTERIOR HOLE IN THE UNDERBELLY AND FLOOR. ENSURE PROPER SEAL IS APPLIED.

- DAMAGE TO FLOOR RESULTING IN POOR SEAL APPLICATION MAY VOID FLOOR WARRANTY;

STEP 13: CONDUCT LP GAS BURN OFF;

- ENSURE PROPER FUNCTIONALITY OF THE FURNACE;

STEP 14: CLAIM REPAIR CODE.