

L74X-
R.01.25

To: After Sales Official Network
Subject: Door gas spring fixing pin
Date: 22/07/2025
Pages: 4



Campaign code:

L74X-R.01.25

Campaign name:

Door gas spring fixing pin

Model:

Revuelto

Model Year:

2024, 2025

Markets:

Australia, Austria, Azerbaijan, Bahrain, Belgium, Canada, Estonia, Germany, India, Italy, Kuwait, Mexico, Netherlands, New Zealand, Peru, Philippines, Poland, Qatar, Romania, Saudi Arabia, South Africa, Sweden, Switzerland, Taiwan, Turkey, United Arab Emirates, United Kingdom, United States

VIN Involved:

From RLA00151 to SLA03162


Important information: before proceeding with the repair, connect to the Warranty Portal and, using the “VIN Info” function, check that:

- the vehicle is actually affected by the instructions contained in this bulletin.

NOTE: some vehicles may not be affected, despite the fact that their Vehicle Identification Number (VIN) falls within the range;

- only replacement parts that correspond to the specific operation, identified by a letter (such as A, B, C, etc.), are to be used for the chassis being repaired.

Example

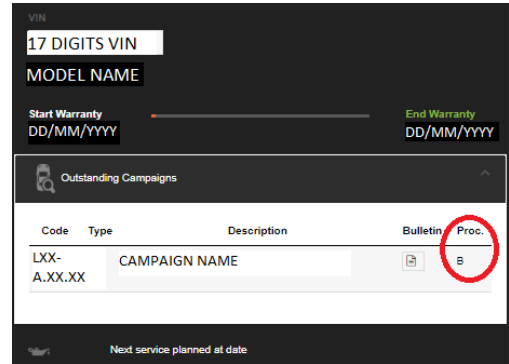

NOTE:

Operation A will be available only when the instructions require a preliminary check to be performed to determine whether or not the vehicle actually needs updating.

Information for the service network:

During ongoing product monitoring, Automobili Lamborghini S.p.A. identified a potential issue on some vehicles and has released a new mandatory update for the potentially affected cars for the verification of the correct tightening torque of the door gas spring spherical pin.

Solution for the field:

Check and, if necessary, tighten door gas spring fastening pin

Spare Parts:

OPERATION B:

Part number	Description	Q.ty
n/a	n/a	n/a

Management of replaced parts:

Store the components that have been removed from the vehicle in an appropriate manner, marking them with their corresponding bar codes so that they can be identified during visits by the competent Area Manager.

Labor time:

Operation B: 0,25 h

Rev.00

CONFIDENTIAL

The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A pursuant to copyright law. The company reserves the right to make updates and modifications as needed. The reprinting, reproduction, distribution to unauthorized persons and/or to third parties, and the partial or complete translation of the material contained herein are prohibited without the express written consent of Automobili Lamborghini S.p.A.

Doc. no.: L/V6_M06 Rev.[07]

1/4




Previous bulletins superseded.

None.

Warranty claim instructions:

To request reimbursement for the repair performed, access the “LIASS” system on the Lamborghini portal and, following the instructions in the system’s “Manuals” section, generate and fill out a Warranty Request.

Select the required campaign and proceed with entry; carefully read the options present in the alert message that displayed by the system (see example) and select the option performed on the vehicle.

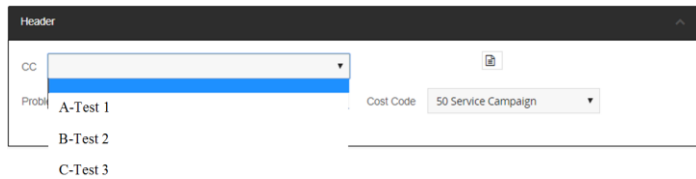

Reimbursement will be structured as follows, on the basis of the operation performed:

- **OPERATION B:**
 - o Steps to be executed: 1 to 6
 - o Labour time: 0,25 h

Important information:

attach all documents generated during the work carried out, evidence of the work itself, for instance work orders and diagnostic protocols with BETA-Reports.

If one or more of these is missing, it may lead to a rejected reimbursement request.

Fill out the page in the warranty booklet (identified in the image below) in the section “Service and Recall Campaigns”:

Recommended Tools

Code	Description.	Q.ty
n/a	n/a	n/a



OPERATION B Repair method:

Follow the instructions:


1. Open the door.



IMPORTANT:

A second operator must hold the door.

2. In the lower area, open the safety catch (1) of the gas spring (2) using a screwdriver and move it slightly backwards.
3. Release the gas spring (2) from the fixing pin (3).
4. Check the tightening of the fastening pin (3), (tightening torque $24\text{Nm} \pm 10\%$ - 5.39lbft). If it is not tightened correctly, tighten it to the prescribed tightening torque of $24\text{Nm} \pm 10\%$ (5.39lbft).
5. Once the tightening has been checked, reposition the gas spring (2) on the fixing pin (3) and then close the safety catch (1).
6. Carry out the same procedure on the other door.

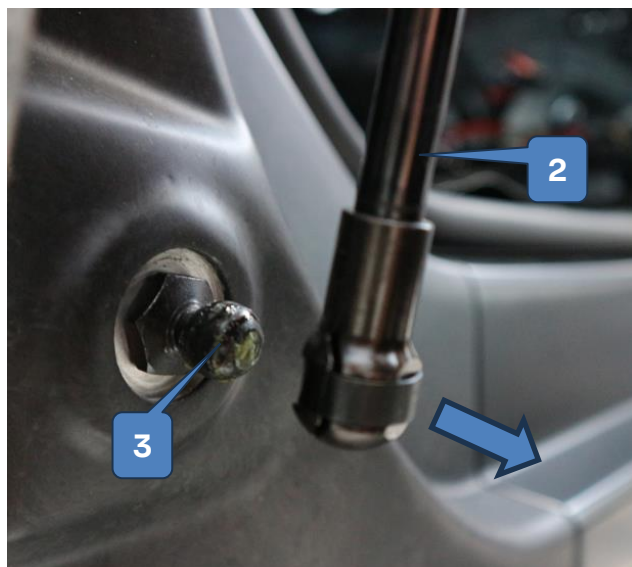



IMPORTANT:

The documents which must be provided together with the operation under warranty request are:

- *Produced Repair Order*
- *Saved Diagnostic Protocol with BETA report*

Failure to follow these procedures could lead to the request being rejected.

For more information, please contact your Area Manager or open a ticket to Technical Support in Lamborghini KEY (Request – General Information – After Sales Services - After Sales Technical Support).

Regards,
Lamborghini Service