



VOLUNTARY RECALL CAMPAIGN

Classification: EC25-010	Reference: NTB25-038	Date: August 7, 2025
-----------------------------	-------------------------	-------------------------

VOLUNTARY RECALL CAMPAIGN 2025 FRONTIER; ECM REPROGRAMMING

CAMPAIGN ID #: R25C3
APPLIED VEHICLES: 2025 Frontier (D41)

**Check Service COMM or Dealer Business Systems (DBS)
National Service History to confirm campaign eligibility.**

INTRODUCTION

Nissan is conducting this voluntary recall campaign, on certain specific model year 2025 Frontier vehicles, to reprogram the ECM to correct a Daytime Running Light condition. This service will be performed at no charge to the customer for parts or labor.

IDENTIFICATION NUMBER

Nissan has assigned identification number R25C3 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer’s responsibility to check Service COMM or Dealer Business Systems (DBS) National Service History for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer’s inventory. **Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration.** While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

- Using CONSULT, confirm the current ECM part number and write it on the repair order.
 - If it matches one of the part numbers in **Table A**, continue to step 2 below.
 - If it does not match one of the part numbers in **Table A**, this bulletin does not apply. Go back to ASIST for further diagnostic and repair information.

Table A

MODEL YEAR	CURRENT ECM PART NUMBER: 23710-
2025	9BZ0C, 9BZ1C, 9BZ4C, 9BZ5C, 9BZ6C, 9BY7C, 9BY8C, 9BY9C 9BY7D, 9BY8D, 9BY9D, 9BZ0D, 9BZ1D, 9BZ4D, 9BZ5D, 9BZ6D

WARNING **CAUTION** **NOTICE**

If you are not familiar with the CONSULT Reprogramming procedure, refer to the CONSULT Operation Manual and the Electronic Service Manual (ESM) for steps to reprogram an Electronic Control Unit (ECU). Follow all precautions in both manuals to prevent possible personal injury or death and/or damage to the ECU.

- Reprogram the ECM.

IMPORTANT:

- When using CONSULT-III plus, select **Re/programming, Configuration** to reprogram the ECU. Perform "ADDITIONAL SERVICE" per the ESM when required.
- After erasing all DTCs, print a copy of the CONSULT screen showing the before and after part numbers of the control unit and attach it to the repair order.

CLAIMS INFORMATION

Submit a "CM" line claim using the following claims coding:

CAMPAIGN ("CM") ID	DESCRIPTION	OP CODE	FRT
R25C3	Reprogram ECM	R25C30	0.8
	Reprogram not needed	R25C32	0.3

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
August 7, 2025	NTB25-038	Original bulletin published

