


## RECALL 25V551 / 2025-439 REMEDY INSTRUCTIONS

 <b>FOREST RIVER</b>	Make(s): CEDAR CREEK Model(s): CRT40CBK Model Year(s): 2026	Repair Code: RC-047-09-00-004739 Allotted Time: .25 HRS Inspection Code: RC-047-05-00-004738 Allotted Time: .10 HRS
	Concern: The vehicle may be missing an egress window on the driver's side.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100783917 Part(s) Return: NO – FIELD DESTROY

**Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.**

STEP 1: LOCATE THE 60" X 40" WINDOW ON THE DRIVERS SIDE (ROADSIDE) OVER THE SOFA IN THE SLIDE-ROOM;

STEP 2: REMOVE THE BLACK OPERATING HANDLE FORM THE WINDOW;

- KEEP THE FASTENER;
- DISCARD THE BLACK PLASTIC HANDLE;

STEP 3: INSTALL THE REPLACEMENT RED HANDLE USING THE FASTENER(S) FROM THE BLACK HANDLE;

STEP 4: INSTALL A "EXIT" STICKER TO THE WINDOW NEXT TO THE RED HANDLE;

STEP 5: INSTALL A "EXIT" STICKER TO THE SHADE SO IT IS VISIBLE WHEN THE SHADE IS PARTIALLY CLOSED AND COMPLETELY CLOSE;

STEP 6: TEST FOR PROPER FUNCTIONALITY;

STEP 7: CLAIM REPAIR CODE.