

**ATTENTION:** Mercedes-Benz Dealer Principals, General Managers, Sales Managers, Service Managers & Parts Managers

## Safety Recall Launch Notification

December, 2025

<b>Campaign #</b>	<b>NHTSA ID</b>	<b>Campaign Codeword</b>	<b>Reinforcement of Longitudinal Frame Member</b>
2025090008	25V609	VS3LAENGST	

### Campaign Details

<b>Total Recall Population</b>	4	<b>Model(s)/ Platform(s)</b>	Sprinter (907)
<b>Vehicles in Dealer Inventory</b>	0		
<b>Model Year(s)</b>	2024		
<b>Issue</b>	Mercedes-Benz AG, the manufacturer of Mercedes-Benz vehicles, has determined that on certain Sprinter (907 platform) vehicles, the longitudinal frame members of the Body in White might not meet specifications. In the event of a frontal collision, the deformation behavior of the Body in White might be impaired. As a result, the risk of injury for the occupants might increase.		
<b>What We're Doing</b>	MBUSA is conducting a voluntary recall. Authorized Mercedes-Benz Sprinter dealers will check the longitudinal frame members on the affected vehicles. Depending on the findings, the necessary measures will be carried out.		
<b>Remedy</b>	The inspection process is available.		
<b>Launch Date</b>	Affected VINs will be flagged in VMI as “ <b>OPEN</b> ” on Tuesday, December 2 <sup>nd</sup> , 2025. The campaign will be visible on the <a href="http://www.NHTSA.gov">www.NHTSA.gov</a> website and may generate questions from customers.		
<b>Approximate Customer Notification Date</b>	Monday, December 15, 2025 Final customer letters can be found at <a href="http://www.mbvans.com/en/recall-information">www.mbvans.com/en/recall-information</a> or <a href="http://www.NHTSA.gov">www.NHTSA.gov</a> at the time of mailing.		
<b>Warranty Claim Notice</b>	Please note the campaign will close after the warranty claim has been submitted. This change can take at least one day to reflect in Netstar VMI.		

**Given this notice, it is a violation of federal law for a dealer to sell or lease any new vehicle in dealer inventory covered by this notification until the vehicle has been repaired. Violations of federal law may result in civil penalties.**

- Loaner and demonstrator vehicles may continue to be driven, but must not be retailed until repaired.
- Once the remedy is available, vehicles will be flagged as “OPEN” and Work Instructions will be available.
- As a matter of normal service process, please check for other repair measures that might be applicable to the vehicle(s).

**Additionally, given this notice, it is a violation of federal law for car rental companies to rent vehicles covered by this notification until the vehicle has been repaired. Violations of federal law may result in civil penalties.**

While we regret any inconvenience this may cause, MBUSA is determined to maintain a high level of vehicle quality and customer satisfaction. Please refer all customer inquiries to the Customer Care Center at 1-800-FOR-MERCEDES.



**Model** 907

**Operation no. of the operation texts or standard texts and flat rates**


Category	Op. no.	Operation text	Time	Damage Code	Codeword
L	11 0016	Operations: Check front longitudinal member	0.2hrs	31 901 05	VS3LAENGST

**Important!**

If reinforcements (2) are missing in the longitudinal members (1), representative pictures of the test must be created and filed in a tamperproof manner with the repair order.

Vehicles in which the reinforcements (2) are missing must be decommissioned.


To do this, please contact the contact persons in the MPC or the general distributor.

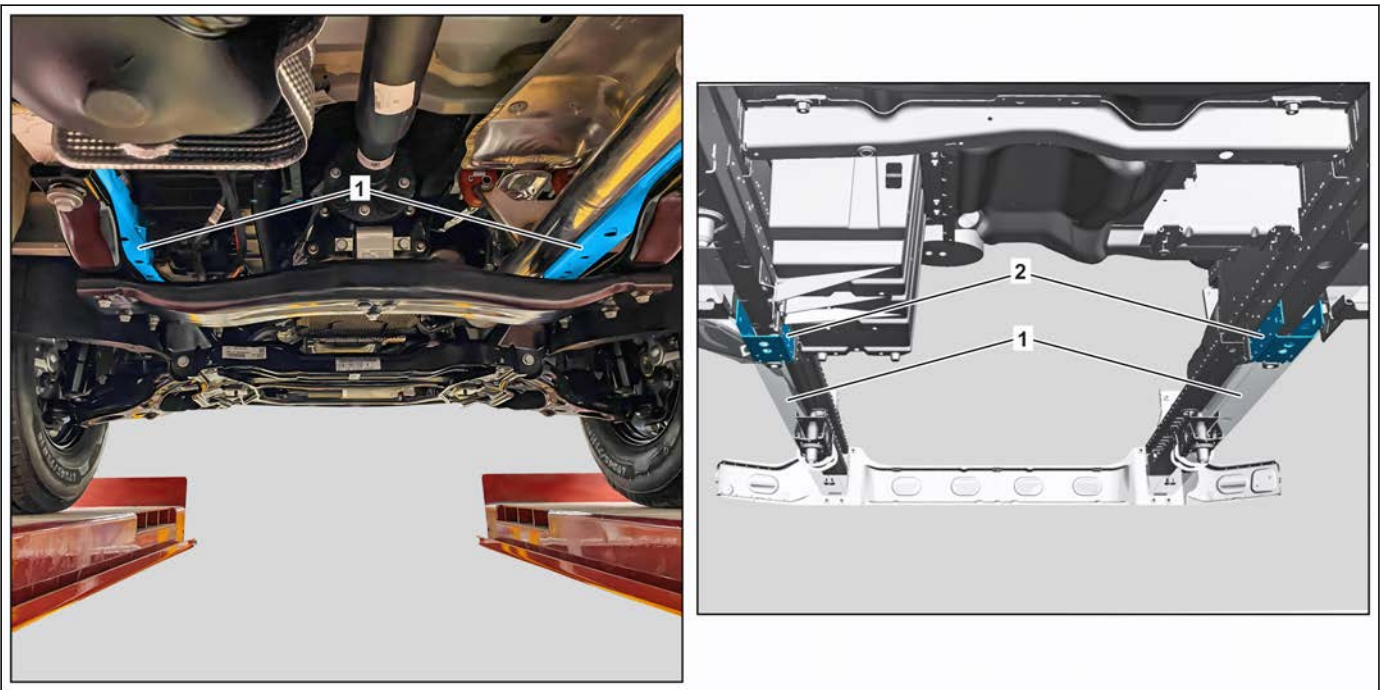

1 Front longitudinal member

2 Reinforcements

D62.20-A040-79

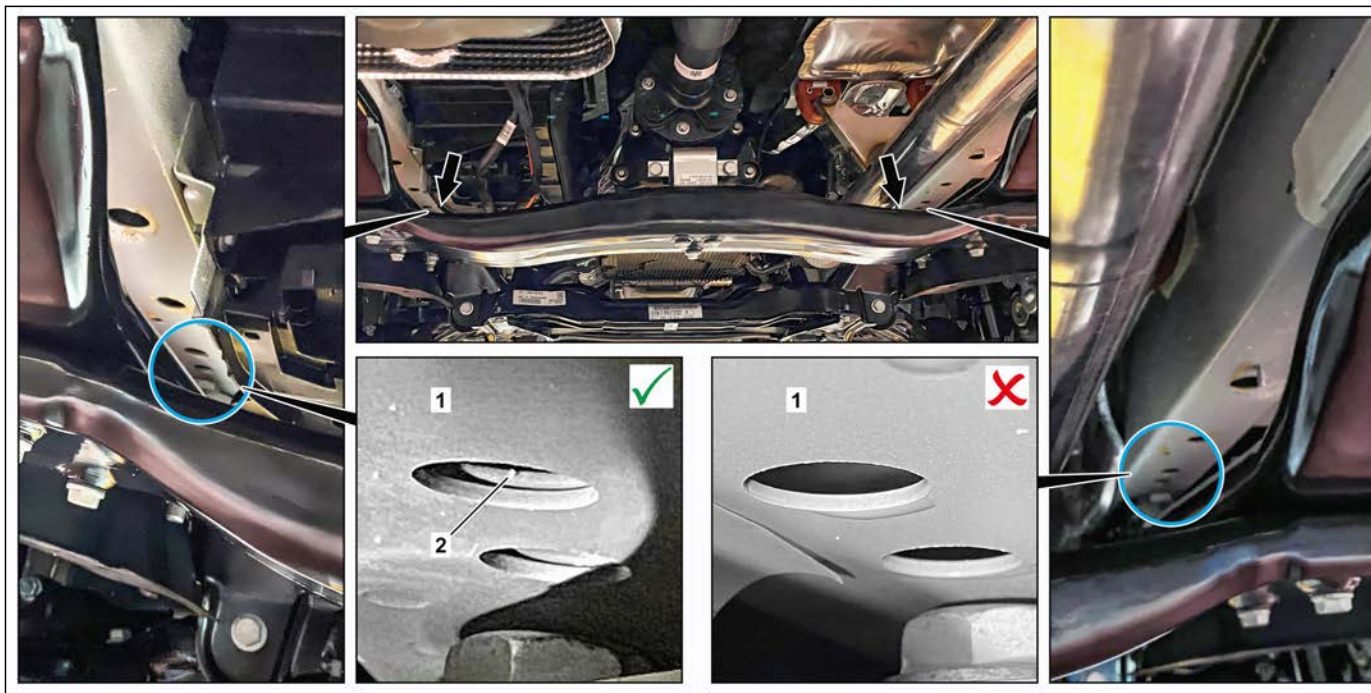

D62.20-A041-79

1 Front longitudinal member

2 Reinforcement

<p><b>⚠ Danger</b></p>	<p><b>Risk of death</b> caused by vehicle slipping or toppling off of the lifting platform.</p>	<p>Align vehicle between vehicle lift columns and position the four support plates at the vehicle lift support points specified by the vehicle manufacturer.</p>	<p>AS00.00-Z-0010-01A</p>
<p><b>🔍</b></p>	<p><b>Check</b></p>		
<p>1</p>	<p>Check whether vehicle is affected by measure.</p>		
<p>2 <b>📢 Notice</b> 🔧 AR 🔧 WS 🔧 WS 🔧 WS</p>	<p>Raise vehicle. Special instructions for lifting and supporting vehicle  000 588 26 80 00 Adapter 000 588 41 80 00 Adapter 000 588 27 80 00 Adapter</p>		<p>AH00.60-P-0100-01TS AR00.60-D-1000-04TS WS00.00-Z-0067KOB WS00.00-P-0321B WS00.00-P-0068B</p>
<p>3</p>	<p>Check that reinforcements (2) are present in front longitudinal members (1).</p>	<p><b>i</b>  If reinforcements (2) are present, ↓ end the measure. If reinforcements (2) are not present, ↓ Please contact CCC to have a case created</p>	