 Tesla, Inc. Service Bulletin		<h2>Replace Rear Fascia Harness and Rear Fascia Taillight Assemblies</h2>	
SB-25-17-011 October 10, 2025			
Classification		Section/Group	Mobile Service
Recall Bulletin		17 - Electrical	Cannot Perform
Configuration			
		All	
Model	Model Year	Country/Region	Build Location
Model Y	2026	North America, Europe, Asia Pacific	Fremont, Giga Berlin, Giga Shanghai, Giga Texas
<small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small>			


Recall Bulletin: Recall Bulletins are mandatory service procedures that, unless they can be completed via a software update that a customer installs through the normal course of ownership, must be carried out by Tesla-certified Service Centers. Recall work performed by uncertified technicians could lead to unsafe conditions or voided warranty provisions.

Condition

On certain Model Y vehicles, one or both reverse lamps may fail to switch on when the driver selects the reverse gear due to loss of continuity in the rear lamp circuit as a result of the connector or terminal pin not being properly seated.

Correction

Replace the rear fascia harness and both rear fascia taillight assemblies.

 **NOTE:** If this bulletin is applicable to the vehicle, perform the correction without any need for inspection.

Correction Description	Correction	Time
Replace Rear Fascia Harness and Rear Fascia Taillight Assemblies (North America)	S012517011	0.48
Replace Rear Fascia Harness and Rear Fascia Taillight Assemblies (Europe)	S022517011	0.48
Replace Rear Fascia Harness and Rear Fascia Taillight Assemblies (Asia Pacific)	S032517011	0.48

Part Number	Description	Quantity
Parts Required		
For North America Vehicles		
1933900-00-D	ASSEMBLY - HARNESS - REAR FASCIA	1
1979444-10-D	LAMP ASSEMBLY - REAR FASCIA LAMP - SAE - LH	1
1979445-10-D	LAMP ASSEMBLY - REAR FASCIA LAMP - SAE - RH	1
For Europe Vehicles		
1933900-00-D	ASSEMBLY - HARNESS - REAR FASCIA	1
1979444-00-C	LAMP ASSEMBLY - REAR FASCIA LAMP - SAE - LH	1
1979445-00-C	LAMP ASSEMBLY - REAR FASCIA LAMP - SAE - RH	1
For Asia Pacific Vehicles		
1933900-00-D	ASSEMBLY - HARNESS - REAR FASCIA	1
1906107-00-C	LAMP ASSEMBLY - REAR FASCIA LAMP - SAE - LH	1
1906108-00-C	LAMP ASSEMBLY - REAR FASCIA LAMP - SAE - RH	1

These part numbers were current at the time of publication. Use the revisions listed or later, unless otherwise specified in the [Parts Catalog](#).

Shop Supplies Masking tape

Procedure

1. Remove the rear fascia and diffuser assembly (refer to Service Manual procedure [10010501601](#)).
2. Replace the rear fascia harness (Figure 1) (refer to Service Manual procedure [1710070102](#)). Do not reinstall the rear fascia assembly yet.



Figure 1

3. Replace the LH and RH rear fascia taillights (Figure 2) (refer to Service Manual procedure [1740030702](#)).



Figure 2 – LH shown; RH similar

4. Install the rear fascia and diffuser assembly (refer to Service Manual procedure [10010501601](#)).
5. Use the Correction Description table found in this document to apply the correct region-specific correction code.