

REFERENCE:	Nova Bus Manuals
SECTION:	12: Driver door panel
RS N°:	MQR 7621-3042
EFFECTIVE IN PROD.:	LF76
NHTSA RECALL N°:	25V-696

APPLICATION DEADLINES: N/A CLAIM
REFERENCE NUMBER: SR5805

SUBJECT:	Hygiaphone glass panel marking
JUSTIFICATION:	The subject vehicles have been manufactured with a glass panel lacking the glass marking required by the FMVSS205 compliance requirements. A missing FMVSS 205 marking may result in the window being replaced with an incorrect type of glass, reducing visibility and increasing the risk of a crash.

LEVEL	DESCRIPTION	DIRECT CHARGES		TIME
		LABOUR	MATERIAL	
1	Replace the hygiaphone.	Nova Bus	Nova Bus	10 min
2	–	–	–	–

MATERIAL REQUIRED PER VEHICLE

QTY	PART N°	REV.	DESCRIPTION
LEVEL 1			
1	N110576	B	Barrier hygiaphone (speaker)
1	N110577	A	Barrier hygiaphone (ring)
LEVEL 2			
–	–	–	–

Materials will be available within 33 days once your order has been placed.

To order, please contact novabus.parts@volvo.com

Or by phone for CANADA 1-800-771-6682, for USA 1-877-999-8808

Specify document number, quantity of parts required and shipping address.

DISPOSAL OF PARTS

REMOVED PARTS ARE:	DISCARDED	RETAINED	* Dispose of the unused parts and the defective parts in accordance with local environmental standards in effect.
	Yes	–	

REVISION HISTORY

REV.	DATE	CHANGE DESCRIPTION	WRITTEN BY
NR	2026JA20	Initial release	André Pelletier

CLIENT	ORDER	ROAD NUMBER		VIN (2NVY/4RKY...)		QTY
		FROM	TO	FROM	TO	
New York City Transit, New York - NYCT	LC32	[REDACTED]				1
New York City Transit, New York - NYCT	LD23	[REDACTED]				1



WARNING

FOLLOW YOUR INTERNAL SAFETY PROCEDURES.

PROCEDURE

- 1.1. Park the vehicle on an even surface with the transmission on neutral.
- 1.2. Apply the parking brake and set the master control switch to the **stop** position.
- 1.3. Remove the screws holding the hygiaphone of the driver's barrier.
- 1.4. Replace the hygiaphone, ring and speaker plate, using the original hardware and a drop of Loctite 243 or the equivalent per screw.
- 1.5. Discard the original hygiaphone ring and speaker.
- 1.6. The vehicle can return to service.

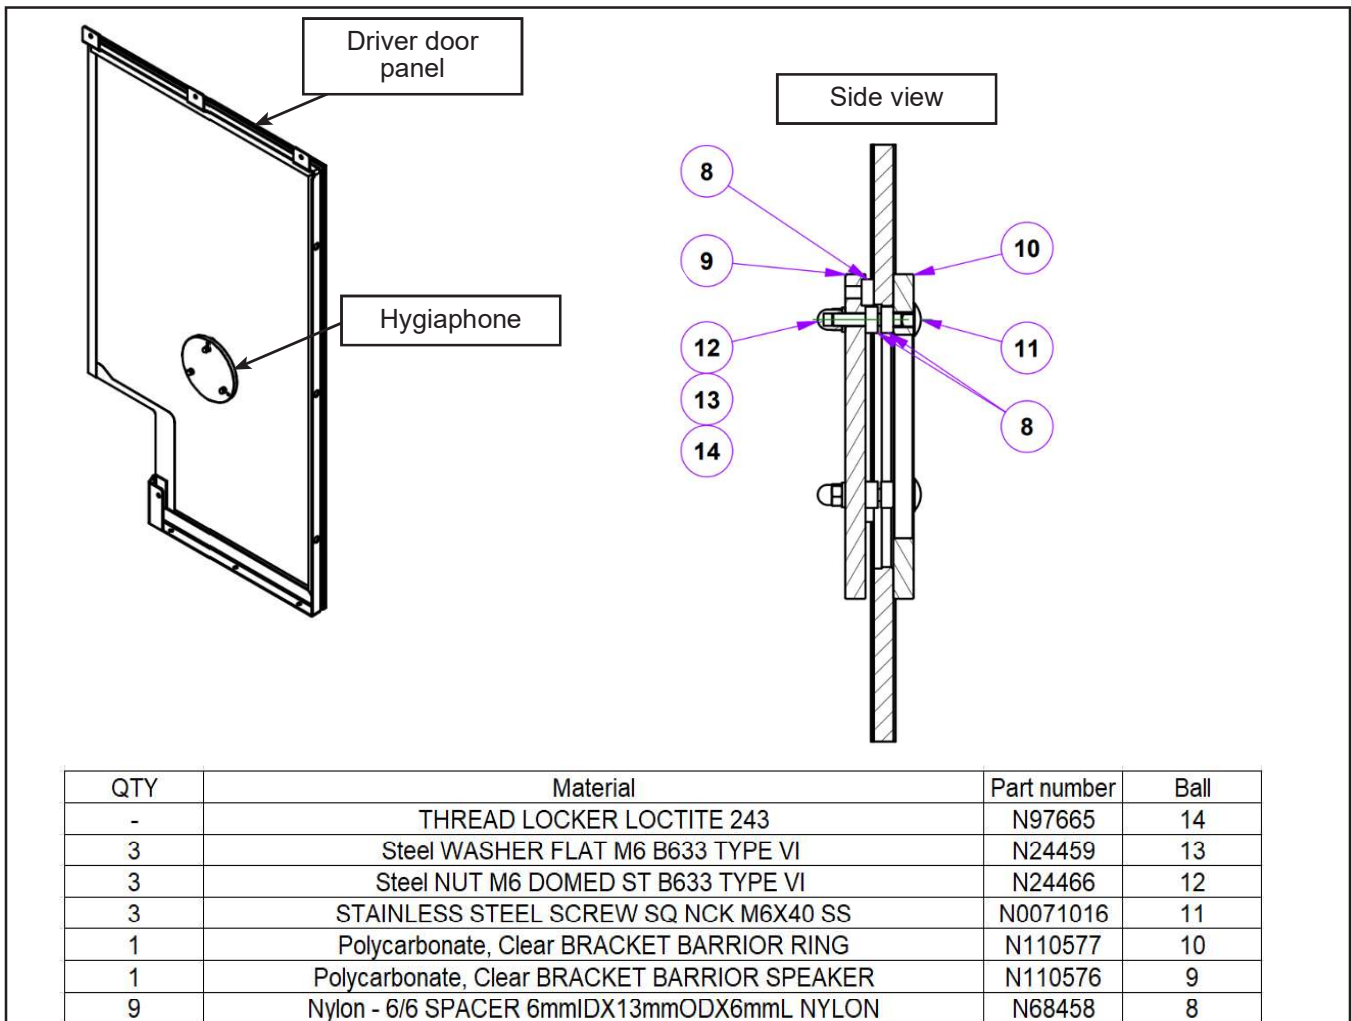


Figure 1 - Hygiaphone Parts