


RECALL 25V708 / 2025-568 REMEDY INSTRUCTIONS

 FOREST RIVER	Make(s): SALEM & WIDLWOOD Model(s): SBT301FAM & WBT301FAM Model Year(s): 2026	Repair Code: RC-096-09-00-004763 Allotted Time: .25 HRS. Inspection Code: RC-096-05-00-004762 Allotted Time: .10 HRS.
	Concern: The exterior griddle may be stowed while still connected to LP Gas.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100799572 Part(s) Return: NO, FIELD DESTROY

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

INSPECTION:

STEP 1: DEPLOY THE GRILL/GRIDDLE INTO THE OPEN POSITION;

- IF THE RED LOCKING MECHANISM LOOKS LIKE FIGURE 1, CLAIM THE INSPECTION CODE;
- IF THE RED LOCKING MECHANISM LOOKS LIKE FIGURE 2, MOVE ON TO THE REMEDY;

REMEDY:

STEP 1: DRILL OUT THE RIVET(S) OUT WITH A 3/16" DRILL BIT;

- DISCARD THE RED MECHANISM;


STEP 2: INSTALL THE REPLACEMENT RED LOCKING MECHANISM AS SHOWN IN FIGURE 1;

- USE THE INCLUDED BOLT(S) AND NUT(S);

STEP 3: ENSURE THE LOCKING MECHANISM PERFORMS AS INTENDED, NOT ALLOWING THE GRILL/GRIDDLE BE STOWED;

STEP 4: CLAIM REPAIR CODE.

FIGURE 1:

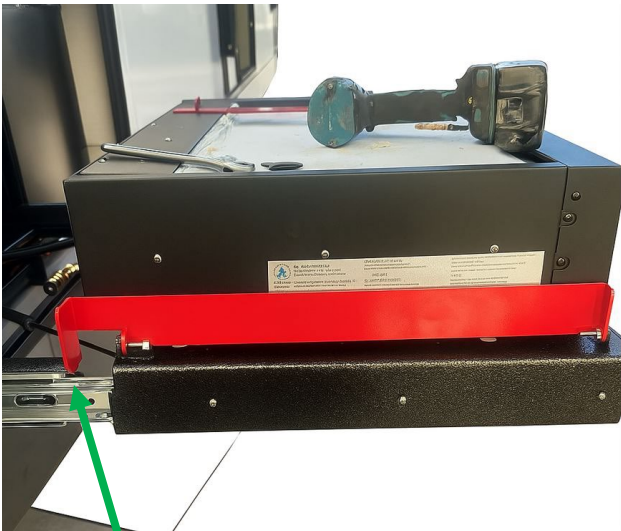

CORRECT LOCKING BRACKET
NOTICE THE END - HAS LOCK

FIGURE 2:



INCORRECT LOCKING BRACKET
NOTICE THE END - NO LOCK