

TECHNICAL INSTRUCTIONS
FOR
SAFETY RECALL 25LA06
REPROGRAMMING FOR
CIRCUMFERENCE MONITORING CAMERA CONTROL MODULE

CERTAIN
ES, GX, LC, LS, LX, RX, RZ & TX350


The repair quality of covered vehicles is extremely important to Lexus. All dealership technicians performing this recall are required to successfully complete the most current version of the E-Learning course “Safety Recall and Service Campaign Essentials”. To ensure that all vehicles have the repair performed correctly; technicians performing this repair are required to currently have completed all of the following courses:

- LIC206A – Electrical Repair 1

It is the dealership’s responsibility to select technicians that have completed the above courses to perform this repair. Carefully review your resources, the technician skill level, and ability before assigning technicians to this repair. It is important to consider technician days off and vacation schedules to ensure there are properly trained technicians available to perform this repair at all times.

I. OPERATION FLOW CHART

The flow chart is for reference only. **DO NOT** use it in place of the full technical instructions. Follow **ALL** steps as outlined in the full technical instructions to confirm the campaign is completed correctly.

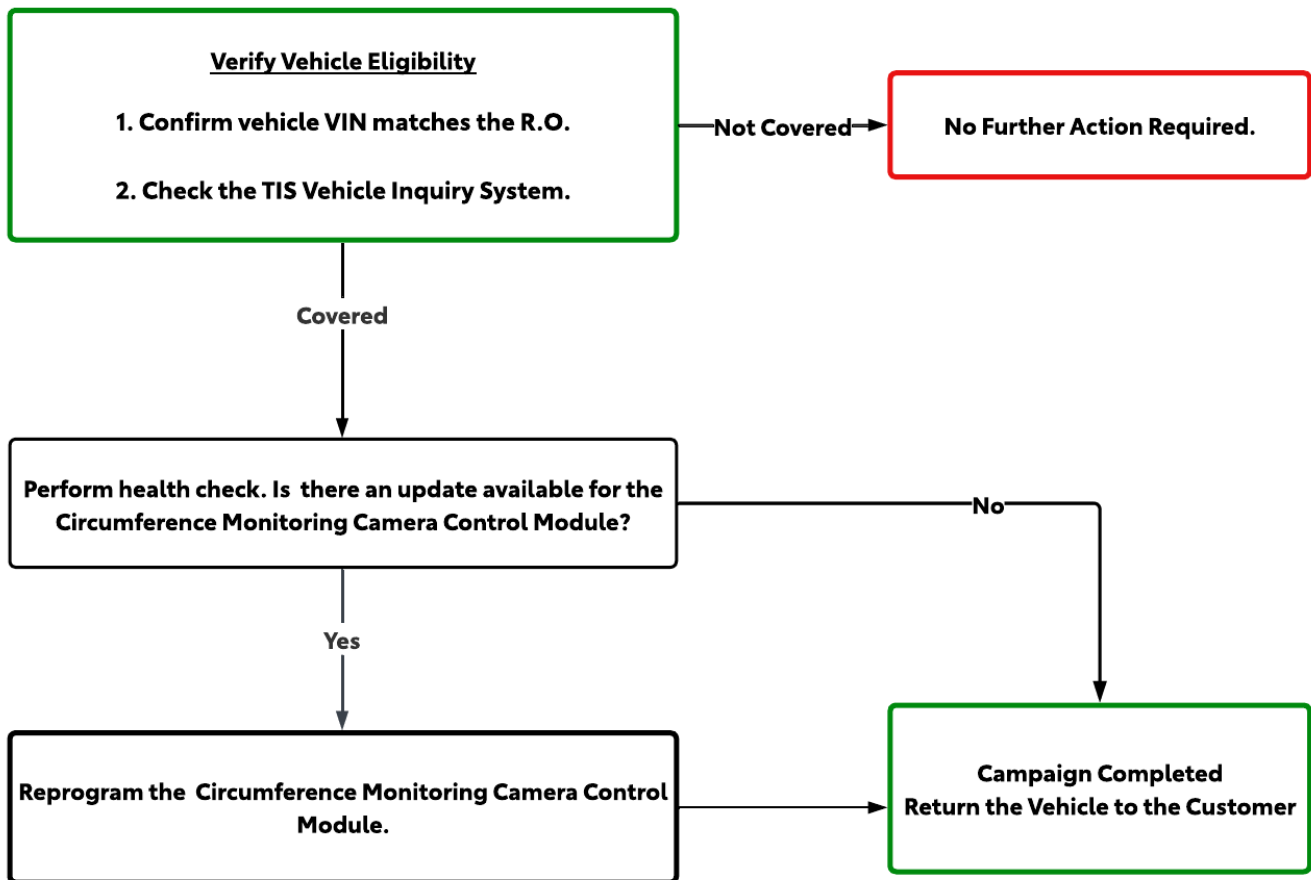

II. IDENTIFICATION OF AFFECTED VEHICLES

1. CHECK VEHICLE FOR CAMPAIGN ELIGIBILITY

- Compare the vehicles VIN to the VIN listed on the Repair Order to ensure they match.
- Check the TIS Vehicle Inquiry System to confirm the VIN is involved in this Campaign, and that it has not already been completed.

HINT:


TMNA warranty will not reimburse dealers for repairs completed on vehicles that are not affected or were previously completed, even by another dealer.

III. PREPARATION

A. TOOLS & EQUIPMENT

- L-SB-0001-18 Rev. 2
- DCA-8000 Battery Diagnostic Station
- GTS+

IV. BACKGROUND

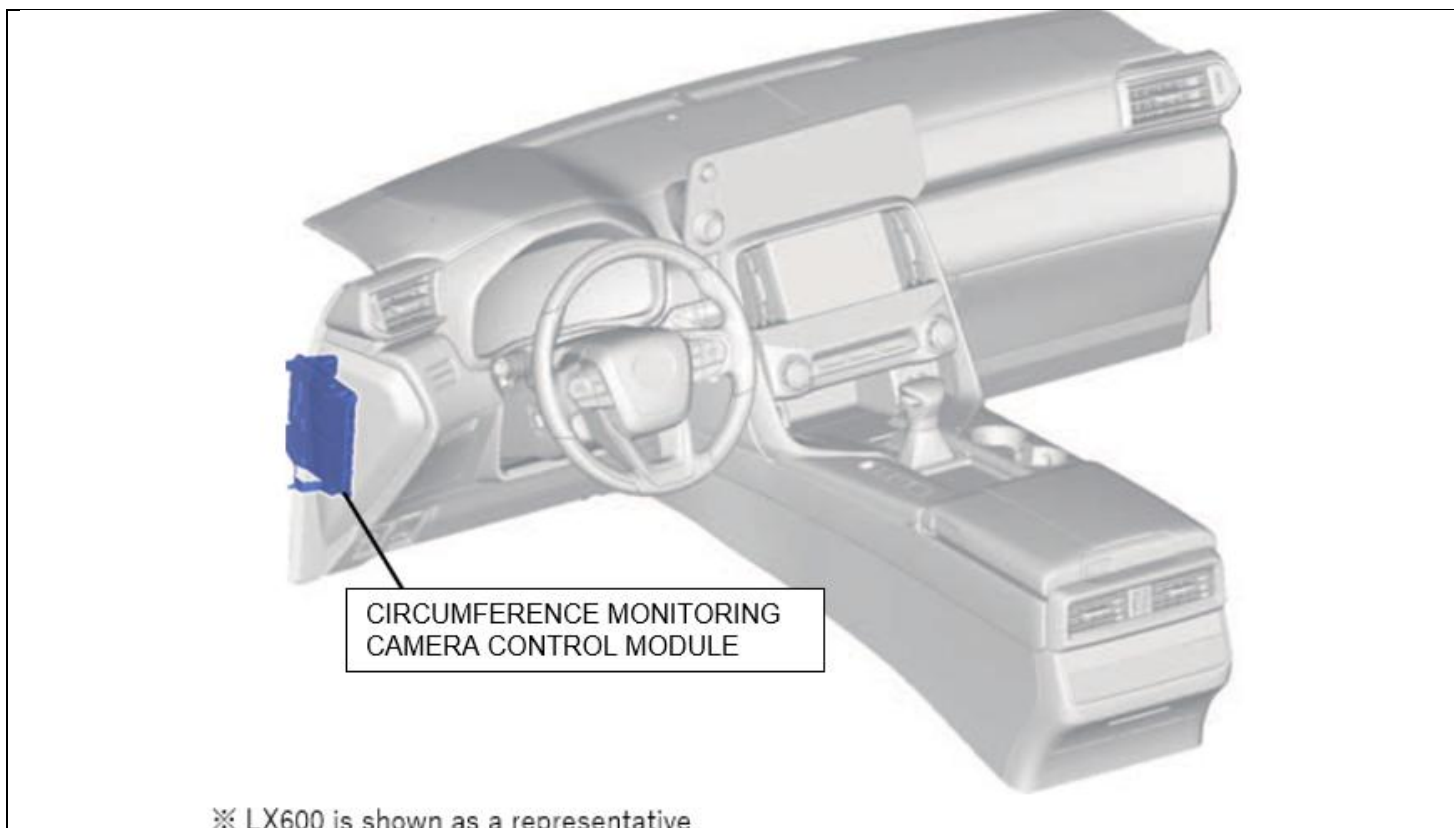


V. SEAFETY PRECAUTIONS

Critical CRITICAL INFORMATION - READ THOROUGHLY

An ECU could be damaged if an error occurs in the communication while reprogramming the ECU. Confirm all work is performed as described in these instructions.

Be sure to connect the personal computer to an external AC power supply.

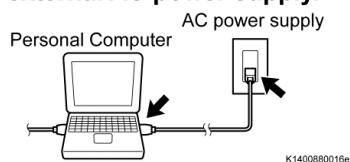

Turn off the screen saver and power saving mode.



1. STABILIZE THE POWER TO THE PERSONAL COMPUTER SIDE

- Be sure to connect the personal computer to an external AC power supply.

NOTICE:

The ECU could be damaged if the battery voltage of the personal computer drops while reprogramming.

- Turn off the screen saver and power saving mode of the personal computer so that the power to the hard disk is kept supplied.

NOTICE:

If the screen saver or power saving mode launches while reprogramming, the communication may be disconnected, resulting in the damage of the ECU.




- c) **DO NOT** block the ventilation opening for the cooling fan of the personal computer.

NOTICE:

If the ventilation opening for the cooling fan is blocked with a sheet cover or the like, the personal computer may be heated excessively, causing the operation of the personal computer to stop.

Due to the stop of the operation, the communication for reprogramming signals could be stopped, resulting in the damage of the ECU.

VI. CIRCUMFERENCE MONITORING CAMERA CONTROL MODULE SYSTEM CALIBRATION ID VERIFICATION

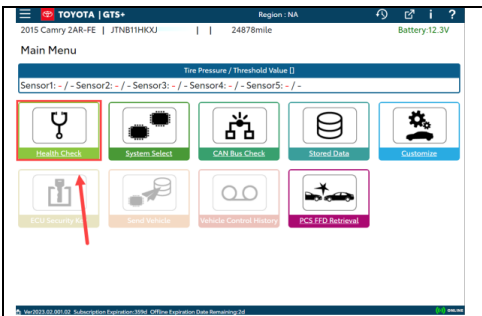

1. CHECK FOR DTC'S

- a) Using a GTS+, click the "Health Check" button on the Main Menu.

HINT:

This Campaign covers only the software update to the circumference monitoring camera control module System, as detailed in these instructions. It does not cover the diagnosis or replacement of any other systems on the vehicle.


2. CHECK CURRENT CALIBRATION

- a) Locate the "Update" column of the "Calibration Information" for the circumference monitoring camera control module system on the "Health Check Result" screen.
- b) Determine the status of an available update; indicated by a YES or NO.

HINT:

If the CIDs indicate 'Yes', proceed with the update procedure.

System	Calibration	Configure	RoB	DTC
Home Control	-	-	●	0
Circumference Monitoring Camera Control Module	8679F4802000 8679G4807000	Yes	●	0
Pre-Collision System	-	No	●	0
D-Door Motor	-	No	-	0
P-Door Motor	-	No	-	0
RL-Door Motor	-	No	-	0
RR-Door Motor	-	No	-	0
Driver Seat	-	No	-	0
Master Switch	-	No	-	0
Sliding Roof	-	No	-	0
Combination Meter	8381G0E30000 8381F0E12000	No	-	0

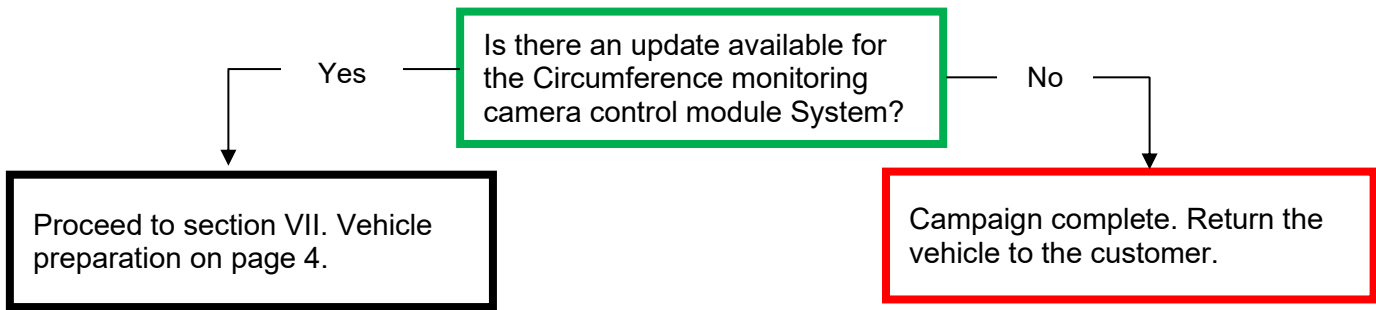

◀ CRITICAL MESSAGE ▶


It is critical that L-SB-0001-18 Rev. 2 in addition to the Technical Instructions for this Recall [or LSC/CSC] are followed. This TSB outlines all steps necessary to prevent reprogramming failure. Toyota will not provide reimbursement coverage for reprogramming failures if this TSB is not followed. If you have a reprogramming failure that requires PARKING ASSIST COMPUTER replacement and the Technical Instructions and TSB were followed correctly, please create a case with the Technical Assistance Hotline documenting all information related to the failure. If sufficient reporting is received related to re-flash failure, there will be consideration for reimbursement.

VII. VEHICLE PREPERATION

1. VEHICLE PREPERATION

a) Confirm the following conditions:

- Vehicle in the IG position (READY OFF).
- Transaxle in Park.
- Parking brake engaged.
- Turn off all electrical accessories (i.e. climate control, audio system, etc.)
- Headlight switch in the DRL OFF position. (w/ DRL OFF position)
- Windshield wiper switch in the OFF position.

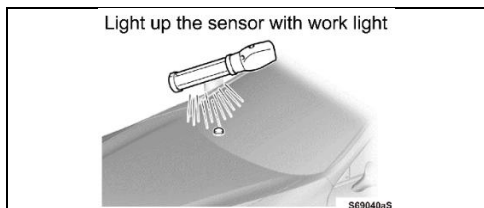

b) When the vehicle has no "OFF position" in the light control switch:

- 1) Turn the IG ON.
- 2) Set the light control switch to the AUTO position and make sure that the exterior lights are turned on.
- 3) Light up the automatic light control sensor with work light to keep the exterior lights turned off.

2. FOR HYBRID VEHICLES DISABLE THE ELECTRIC RADIATOR FAN BY UNPLUGGING THE CONNECTOR.



3. CONNECT THE 12V BATTERY TO A POWER SUPPLY

- a) Connect the DCA-8000 or other type of a power supply (not a battery charger) to the 12V battery.
- b) Tap the Reflash icon from the Main Menu screen of the DCA-8000.

Critical

A power supply MUST be used during reprogramming. ECU damage will occur if the battery voltage is not properly maintained during this re-flash procedure.

NOTICE:

A power supply must be connected directly to the 12V battery terminals and NOT the remote jump posts under the hood (if equipped).

4. VERIFY GTS+ SETUP

- a) Verify that the GTS+ meets the following conditions:
 - The latest version of software is loaded.
 - The GTS+ battery is fully charged. If not, connect the GTS+ to a 120V source.
 - The DLC III cable is in good condition.

Critical

The GTS+'s battery voltage must also be maintained during the re-flash procedure. If necessary, plug the GTS+ into a 120V outlet during this procedure.

NOTICE:

If the GTS+ communication with the vehicle fails during the re-flash procedure, the Circumference monitoring camera control module will be damaged.

VIII. UPDATE CALIBRATION

1. CONFIRM THE CALIBRATION ID

- a) Confirm the current calibration ID in the Circumference monitoring camera control module System.

System	Calibration	Configure	RoB	DTC
Lane Control				
Circumference Monitoring Camera Control Module	8679F4802000 8679G4807000	Yes	●	0
Pre-Collision System	-	No	●	0
D-Door Motor	-	No	-	0
P-Door Motor	-	No	-	0
RL-Door Motor	-	No	-	0
RR-Door Motor	-	No	-	0
Driver Seat	-	No	-	0
Master Switch	-	No	-	0
Sliding Roof	-	No	-	0
Combination Meter	8381G0E30000 8381F0E12000	No	-	0

Please note that some vehicles might show up to 3 current calibration IDs but not all will get updated. The calibration IDs to re-flash in this campaign are as shown in the table below. Match as many Current CAL IDs from the vehicle to select the correct **NEW** CAL file from the table below. Some vehicles might have more than one calibration ID that must match the center column in order to select the correct **New** calibration file on the left column.

Circumference Monitoring Camera Control Module System		
Model	Current Calibration IDs	<u>New</u> Calibration ID
ES	8679F3344001	8679F3344201
	8679F3344012	8679F3344311
	8679F3344101	8679F3344201
	8679F3344211	8679F3344311
	8679F3344101	8679F3344201
	8679F3344111	8679F3344311
	8679F3344001	8679F3344201
	8679F3346012	8679F3346311
	8679F3344101	8679F3344201
	8679F3346211	8679F3346311
	8679F3344101	8679F3344201
	8679F3346111	8679F3346311
	8679F3344001	8679F3344201
	8679F3350012	8679F3350311
8679F3344101	8679F3344201	
8679F3350211	8679F3350311	
8679F3344101	8679F3344201	
8679F3350111	8679F3350311	
8679F3344001	8679F3344201	
8679F3352012	8679F3352311	
8679F3344101	8679F3344201	
8679F3352211	8679F3352311	
8679F3344101	8679F3344201	
8679F3352111	8679F3352311	
GX	8679G6015100	8679G6054000
	8679G6019100	8679G6058000
	8679G6017100	8679G6056000
	8679G6020100	8679G6059000
LC	8679F1102011	8679F1102211
	8679F1102111	8679F1102211
LS	8679F5042111	8679F5042211
	8679F5042011	8679F5042211
	8679F5044111	8679F5044211
	8679F5044011	8679F5044211
	8679F5046211	8679F5046311
	8679F5046111	8679F5046311
	8679F5046011	8679F5046311
	8679G5006100	8679G5020000
	8679G5008100	8679G5023000
	8679G5014000	8679G5027000
	8679G5010100	8679G5021000
8679G5012000	8679G5025000	

LX	8679F6079002	8679F6079003
	8679F6082011	8679F6082311
	8679F6082012	8679F6082311
	8679F6082111	8679F6082211
	8679G6022000	8679G6075000
	8679F60B0011	8679F60B0111
	8679G6023000	8679G6076000
RZ	8679G6028000	8679G6081000
	8679G4603100	8679G4603200
	8679G46030A0	8679G4603200
RX	8679G4607000	8679G4618000
	8679G4810000	8679G4821000
	8679F4805000	8679F4808000
	8679G4816000	8679G4828000
	8679G4802100	8679G4835000
	8679G48020A0	8679G4835000
	8679G4803100	8679G4834000
	8679G48030A0	8679G4834000
	8679G4811000	8679G4822000
TX	8679F4805000	8679F4808000
	8679G4817000	8679G4829000
	8679F4888001	8679F4888101
	8679F4888011	8679F4888111

NOTICE:

If the Circumference Monitoring Camera Control Module has the **New CIDs**, no update is necessary.

2. REFLASH THE CIRCUMFERENCE MONITORING CAMERA CONTROL MODULE.


- a) Click “Yes” on the “Health Check Results” screen or follow the links on the table above the begin the reflash process.

NOTICE:

Reflash failure should be extremely rare and can be avoided by following all instructions and reprogramming best practices.

IX. COMPLETE REPAIR

1. DISCONNECT THE DCA-8000
2. RECONNECT THE ELECTRIC RADIATOR FAN (HYBRID VEHICLES)

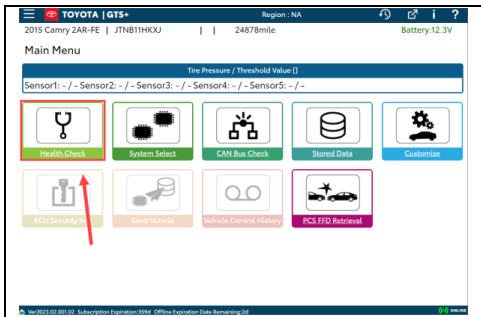

3. PERFORM VERIFICATION HEALTH CHECK

- Using a GTS+, click the "Health Check" button on the Main Menu.
- Clear DTC's that may have set during the re-flash procedure.
- Re-run the Health Check to confirm that no DTC's reappear.

Critical THIS VERIFICATION HEALTH CHECK IS **NECESSARY** to update the results and CIDs to the National database.

4. CONFIRM CID UPDATE

- On the Stored Data tab, confirm the following for the Circumference monitoring camera control module System:
 - The Calibration number has the "New CID" number.
 - The Update column says "No".

Health Check Result

STATUS

2025/09/25 10:51:14
ECU Security Key: -

Compensation Pressure [kPa(gauge)]

Front:
Rear:

Caution

Enhanced Completed: 2025/09/25 10:54:10

System	Calibration	Configure	RoB	DTC
Circumference Monitoring Camera Control Module	8679F4802000 8679G4807000	No	●	0
Pre-Collision System	-	No	●	0
D-Door Motor	-	No	-	0
P-Door Motor	-	No	-	0
RL-Door Motor	-	No	-	0
RR-Door Motor	-	No	-	0
Driver Seat	-	No	-	0
Master Switch	-	No	-	0
Sliding Roof	-	No	-	0
Combination Meter	8381G0E30000 8381F0E12000	No	-	0

NEW CIDs MUST be displayed

Update must say "No"

Critical

Confirm the CIDs has been updated successfully to the **NEW CIDs** by someone other than the individual who performed the repair. Refer to page 5.



Customer
Health Check
Report Button

5. PRINT CUSTOMER HEALTH CHECK REPORT

- a) From the Stored Data tab, select the Customer Health Check Report button (TIS will launch when button is pressed).
- b) Log in to TIS.
- c) Input Vehicle Mileage and Repair Order number.
- d) Check the “Performed” campaign button for the applicable campaigns.
- e) Select the Report button.



Diagnostic Report

Vehicle Information

Mileage: 7787

Repair Order: 77888

Our systems show the following campaigns are outstanding. Have any of these campaigns been completed? (Check for SSC door label if unsure.)

XXX: Performed Not Performed

Report

- f) Confirm Customer Health Check Report information is correct.
- g) Print Customer Health Check Report from TIS.
- h) Sign and provide to the customer.

◀ VERIFY REPAIR QUALITY ▶

- Confirm the reflash completes successfully.
- Confirm back up camera functions as designed
- Confirm there are no DTCs after the Calibration update.
- If you have any questions regarding this update, please contact your area representative.