



GROUP	MODEL
<b>Noncompliance Safety Recall Campaign</b>	<b>2026MY Sorento (MQ4a)</b> <b>2025MY Telluride (ON)</b>
NUMBER	DATE
<b>SC355</b>	<b>October 2025</b>

## NONCOMPLIANCE SAFETY RECALL CAMPAIGN

SUBJECT:

### SPARE WHEEL AND TIRE ASSEMBLY REPLACEMENT (SC355)

This bulletin provides information to replace the spare wheel and tire assembly on certain 2026MY Sorento (MQ4a) vehicles produced from August 28, 2025 through September 2, 2025 and certain 2025MY Telluride (ON) vehicles produced from August 28, 2025 through September 10, 2025. The subject vehicles were equipped with a spare tire of the incorrect size which does not match the size on the placard. As a result, the subject vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard 110, "Tire Selection and Rims." An incorrect-size spare tire can adversely affect the anti-lock braking system (ABS) and/or traction control system (TCS), thereby increasing the risk of a crash. Follow the procedure outlined in this publication to replace the spare tire assembly with the correct size. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs. The correct spare tire sizes are as follows:

**Sorento (MQ4a):**  
**17" in. Spare Tire**  
Size: T135/90D17



**Telluride (ON):**  
**18" in. Spare Tire**  
Size: T155/90R18



#### NOTICE

**There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.**


Repair status for a VIN is provided on KDealer+ (Service → Warranty Coverage → Warranty Coverage Inquiry → Campaign Information). Not completed Recall / Service Action reports are available on KDealer+ (Consumer Affairs → Not Completed Recall → Recall VIN → Select Report), which includes a list of affected vehicles.

**Repair Procedure:**

1. Using a ratchet and 3/8" socket, loosen the spare wheel and tire assembly retaining bracket bolt (A) to remove the incorrect spare tire and wheel assembly.

**CAUTION**

Use a hand tool to remove the bolt (A). Do not use an impact gun.

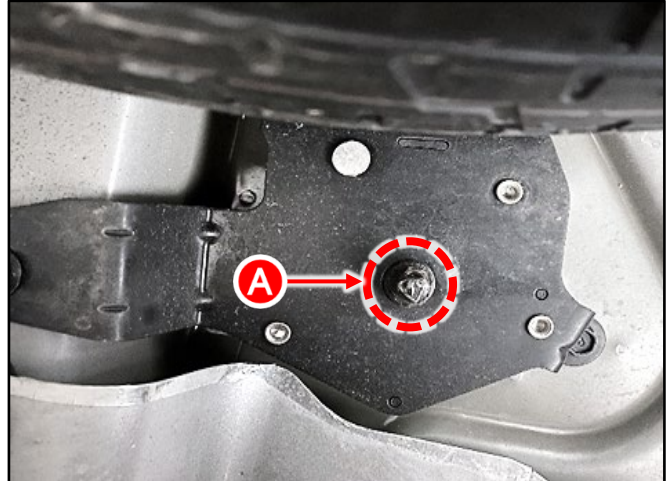

2. Install the correct spare tire for the applicable model.

**Note:** Balancing tire is **not** required



Tightening torque for bolt:  
21.7 - 25.3 lb.ft (28.5 - 34.32 N.m)

SUBJECT:

**SPARE WHEEL AND TIRE ASSEMBLY REPLACEMENT (SC355)****AFFECTED VEHICLE RANGE:**

Model	Production Date Range
Sorento (MQ4a)	August 28, 2025 to September 2, 2025
Telluride (ON)	August 28, 2025 to September 10, 2025

**REQUIRED PART:**

Part Name	Part Number	Figure	Qty.	Comments
Temporary Wheel Assembly	52919 R5100	N/A	1	Sorento (MQ4a)
	52919 L0950		1	Telluride (ON)

**Dealer to order from PDC.**

Part Name	Part Number	Figure	Qty.	Comments
Continental Tire	T135/90D17	N/A	1	Sorento (MQ4a)
Kumho Tire	T155/90R18		1	Telluride (ON)
Valve Stem	N/A		1	All models

**Dealer to order tire from Dealer Tire at: (866) 542-8473. Valve stem can be sourced locally.****WARRANTY INFORMATION:****N Code: N99 C Code: C99**

Model	Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
MQ4a	R	52950 14140	0	(SC355) Spare Wheel & Tire Assembly Replacement	251A55RO	0.5 M/H	52919 R5100	1
ON							52919 L0950	

**Note:** Refer to Warranty Bulletin 2025-29 for claim submission procedures. **When substitute transportation is provided, manually enter sublet code 'X2' for rental expense reimbursement or one roundtrip rideshare expense.** Make sure to submit any substitute transportation claim at the time of the warranty expense.

**NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference **SC355** when accessing the KDealer+ system.

