



RRC-72-25-002-1: Replace 1st Row Driver Seat Belt Pretensioner

Rivian is issuing a recall for certain model year 2022-2025 EDV vehicles which were delivered solely to Amazon. On these vehicles, the 1st row driver seat belt pretensioner may have been damaged from repeated misuse, such as from the driver sitting on top of a buckled seat belt. Any pretensioner that has been damaged by repeated misuse may not provide adequate driver protection in the event of a crash. Rivian is not aware of any crashes, injuries, or fatalities related to this condition. Pursuant to its recall determination, Rivian will replace the pretensioner on the affected vehicles, as well as update the vehicle software to alert when the seat belt is being misused.

| | |
|--|---------------------------------|
| Document Type | Safety Recall Bulletin |
| Date | December 03, 2025 |
| Affected Region(s) | USA |
| Affected Model(s) | EDV |
| Model Year(s) | 2022-2025 |
| Approximate Build Dates NOTE: Refer to Open Containments in ServiceOS to determine if this document applies to a specific vehicle. | December 2021- November 2025 |
| Vehicle System | 72 - Occupant Protection |

Table 1: Required Parts

| Part Number | Quantity | Engineering Name | Service Name/Notes |
|--------------|----------|--|--|
| PT00049165-D | 1 | ANCHOR - SEAT BELT_PTP 1.5 PRE-TENSION POINT | Pretensioner, Seat Belt, 1st Row, Driver |

ATTENTION: The parts listed in this table are only for unique steps that are called out in this bulletin. Some sections of this bulletin might refer to Service Manual procedures which require additional parts. Always review the bulletin and all potentially related Service Manual procedures before ordering parts and beginning work.

Procedure

1. Check the vehicle's software version.
 - If the software level is earlier than 2025.34.20: Update the vehicle software to the latest available version. Continue to the next step.
NOTE: If unsuccessful, escalate for diagnostic assistance.
 - If the software level is 2025.34.20 or later: Continue to the next step.
2. Replace: Pretensioner, Seat Belt, 1st Row, Driver (refer to service manual procedure 721011010).

Labor Codes

| Labor Code | Description |
|--------------|------------------------------|
| RRC722500200 | RRC-72-25-002 not applicable |



| Labor Code | Description |
|---|---|
| RRC722500201 | Replace 1st row driver seat belt pretensioner |
| <i>Contact ServiceDocumentFeedback@rivian.com regarding labor codes and document content.</i> | |

Download a PDF copy of this document.