

Recall Notice Service Bulletin 090180 Rev. A



631 West 11th Street • P.O. Box 310 • Winamac, IN 46996

(574) 946-4139 • 1-800-THE-LIFT • www.braunability.com

June 2025

Applicable for All BraunAbility Rear Entry
Conversions Manufactured 1-6-2025 through
5-29-2025

NHTSA Recall No.: 25V381

Labor Time: 1 Hour

Warranty Topics: Recall - 25V381 - Repair

Read Instructions Before Beginning

Tools Required

Pick • 14mm Socket and Ratchet • Torque Wrench

1. Using pick, remove plastic cover from tie
down. See Photo A.

2. Remove mounting bolt from tie down.
See Photo B.



3. Inspect bolt threads for damage:

- If bolt threads are damaged, contact BraunAbility Customer Care and Aftersales.
- If bolts threads are not damaged proceed to Step 4.


4. Install tie down mounting bolt. Torque to 35
ft•lbs.

Note: Do not apply threadlocker.

5. Repeat procedure on remaining tie downs.

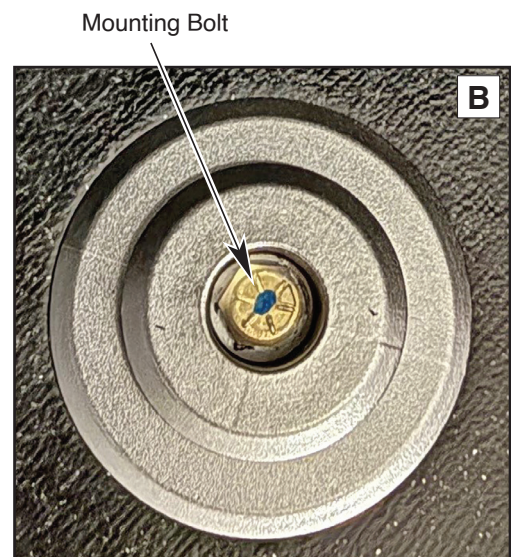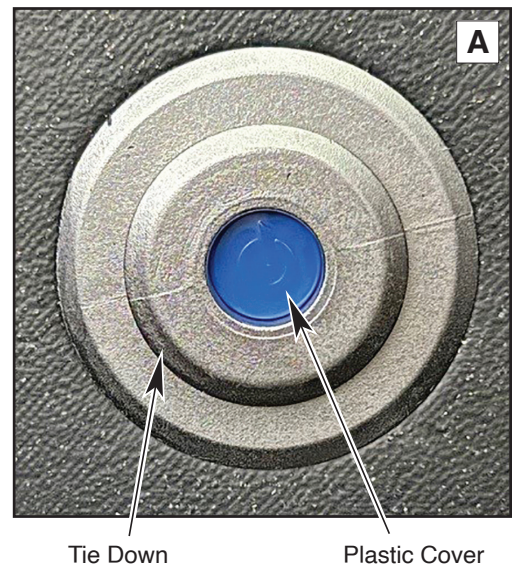

Electric Retractors - If Equipped

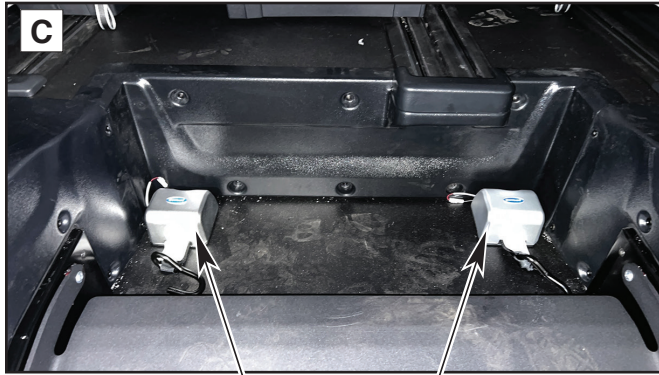

Electric Retractors



Electric Retractor Mounting Bolts

6. Remove electric retractor mounting bolt.

7. Inspect bolt threads for damage:

- If bolt threads are damaged, contact BraunAbility Customer Care and Aftersales.
- If bolts threads are not damaged install bolt. Torque to 35 ft•lbs.

Note: Do not apply threadlocker.

8. Repeat procedure on remaining electric retractor.