

RECALL ACTION

Reference number:	RA-06-2074	Issue Number: 1	Issued: August, 2025
Subject:	Vanquish Software Update		
Model(s):	Vanquish		
VIN range:	Please refer to the separately published list of Vehicle Information Numbers (VINs)		
Applicable to:	All US Dealers		
Distribute to:	Head of Business After Sales Manager Service Manager Sales Manager	Warranty Staff Technician(s) Parts Staff	

Attached Documents

- Copy of the Owner Notification letters
- Copy of the Change of Keeper or Address form

Reason for this Recall Action

Aston Martin has determined that a defect which relates to motor vehicle safety may exist on the below vehicles.

Vehicle	Build Date Range
25MY Vanquish	14 August 2024 and 26 June 2025

Under specific conditions, the vacuum pump may not generate vacuum. This can reduce brake assistance and cause the brake pedal to feel very hard. Reduced pedal travel may result in increased stopping distances. When the brakes engage, the pedal may pulse – this is the ABS providing pressure to compensate for reduced vacuum and is normal operation by design.

On affected vehicles, loss of power braking assist and reduced braking performance can increase the risk of a crash.

Aston Martin has not received any report of an accident or injury caused by this defect.

On the affected vehicles it is necessary to update the ESP software for all affected vehicles.

PLEASE DO A CHECK OF ALL VEHICLES THAT ARE IN THE AFFECTED VIN LIST

Communications

The customer letters and the “Change of Keeper or Address” form are uploaded to Technical Hub.

When the customer calls to make an appointment, briefly describe the repair which will be done to the customer’s vehicle and explain the reason for this work. Tell the customer that the repair will be done at no cost to them.

Workshop Procedure

For update instructions, please refer to SPD-30-2031 - Software Update Process Manual.

Vanquish Software Update Platform

Modules to be updated:

Module	Action
CPC23	Flash / Code
DM_FL23	Flash / Code
DM_FR23	Flash / Code
ECM1	Flash
ECM2	Flash
ESP	Flash
FSCM	Code
HOSWD24	Code
HU24	Flash / Code
HVAC	Flash / Code
SOUND23	Flash / Code
TCU	Flash
TGW24	Flash

Vanquish Software Update (completed alongside QN/SA-30-2031)

Note: QN-30-2031 must be completed before the these modules are updated.

Modules to be updated:

Module	Action
ESP	Flash

Warranty Data

Procedure and Labour Time

Tier	Description	Labour Time
A	Vanquish Software Platform Update	2.9 Hours
B	Vanquish Software Update (completed alongside QN/SA-30-2031)	0.1 Hours

To contact Aston Martin for further information about this document, please refer to the “Contact Us” page in Technical Hub.

Copy of the Owner Notification Letter

[Date DD Month, YYYY]

[Customer Name]

[Customer Address 1]

[Customer Address 2]

[Customer City/County]

[Customer Country]

IMPORTANT SAFETY RECALL NOTICE

NHTSA Recall []

This notice applies to your vehicle: [INSERT VIN]

Dear [Customer]

This notice is sent to you in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act.

Safety Recall Actions RA-06-2074 – Vanquish Software Updates

REASON FOR THIS RECALL ACTION

Aston Martin has determined that a defect which relates to motor vehicle safety may exist for certain Vanquish vehicles that were manufactured from 27 December 2023 and 26 June 2025

Under specific conditions, the vacuum pump may not generate vacuum. This can reduce brake assistance and cause the brake pedal to feel very hard. Reduced pedal travel may result in increased stopping distances. When the brakes engage, the pedal may pulse – this is the ABS providing pressure to compensate for reduced vacuum and is normal operation by design.

On affected vehicles, loss of power braking assist and reduced braking performance can increase the risk of a crash.

Aston Martin has not received any report of an accident or injury caused by this defect.

On the affected vehicles it is necessary to update the ESP software for all affected vehicles.

The models affected are:

- 25MY Vanquish

Copy of the Owner Notification Letter

WHAT WE WILL DO

Aston Martin will update the software for your vehicle to the latest levels.

This action will be done at no cost to yourself.

WHAT YOU SHOULD DO

Please contact your dealer or your Aston Martin Dealer as soon as possible to arrange a date for the repair. They will be able to explain why this Recall Action is necessary. Instructions for making this correction have been sent to your dealer.

The process to update the software for your vehicle and will take around 3.5 hours to complete.

If, for any reason, you are not able to have this safety defect remedied without charge or within a reasonable time, you can contact:

- Aston Martin Customer Service by calling 1-886-276-6661
- The Administrator, by letter to National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE, Washington, DC 20590 or call 1-888-327-4236 (TTY: 1-800-275-9171) or go to <http://www.nhtsa.gov>.

IF YOU NO LONGER OWN THE VEHICLE

If you have sold or traded your vehicle, please tell us by completing the enclosed Change of Keeper form and returning it to us.

We are sorry to cause inconvenience with this Recall Action. However, this action has been taken in the interest of your safety and continued satisfaction with our products.

Yours sincerely

[Dealer's Representative]
[Representative's Job Title]
[Dealer Name]

