

November 14, 2025

Version 1

Safety Recall: 2023–25 Accord Hybrid ICM Software Update

APPLIES TO

Year	Model	Trim Level	VIN Range
2023–25	Accord Hybrid	Sport, EX-L, Touring	Check iN VIN status inquiry for eligibility.

BACKGROUND

While driving, the vehicle may experience a sudden loss of power and all warning lights may illuminate, increasing the risk of a crash or injury. The vehicle will enter “Ready Off” mode before stalling and may have the following DTCs stored:

Code	Failure	Code	Failure
U0123-00	F-CAN communication error Yaw rate / G Sensor	U1483-68	LKAS failure check
U0126-00	F-CAN communication error steering angle sensor	C0062-F0	Longitudinal G sensor failure
U0416-68	VSA failure	C0063-F0	Yaw rate sensor failure
U0447-68	Failure information received from CAN Gateway	C0061-F0	Lateral G sensor failure
U0131-00	EPS communication error (RADAR)	U0101-00	MISS communication error (RADAR)
U0151-00	SRS communication error (RADAR)	U0129-00	ESB communication error (RADAR)
U0151-00	SRS unit communication error	U0100-F1	FI communication error

CUSTOMER NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible. Some vehicles affected by this campaign may be in your new or used vehicle inventory.

Failure to repair a vehicle subject to a recall or campaign may subject your dealership to claims or lawsuits from the customer or anyone else harmed as a result of such failure. Before selling a vehicle in inventory, always check if it is affected by a safety recall by conducting a VIN status inquiry.

CORRECTIVE ACTION

Update the Integrated Control Module (ICM) software.

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by “do-it-yourselfers,” and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
7465A7	Update the ICM software	0.2hr	6PE00	TN200	A25090A	5K801-30B-A06

SOFTWARE INFORMATION

Before beginning the repair, make sure all diagnostic and reprogramming software are updated as listed.

i-HDS Software Version	1.012.019 or later
HDS Software Version	3.105.036 or later
Honda ECU Reprogramming	4.7.0.0 or later

Update only the system(s) and software listed in this service bulletin.

Year/Model	Trim	Vehicle System	Program ID (or later)
2023–25 Accord Hybrid	Sport, EX-L	Integrated Control Module (ICM)	5K801-30B-A070
	Touring		5K801-30B-A170

NOTE:

- Make sure the 12-volt battery is fully charged before starting an update.
- **Do not** use the GR8-110P because the vehicle requires a steady electrical current.
- **Do not** use the **MongoosePRO VCI** for this service bulletin as it is not an American Honda-approved device.
- Warranty reimbursement for technician labor is not allowed for routine checking/installation of any available software update.
- This update will not require entering a service bulletin number.

