



 
Cemen Tech Inc.
1700 N. 14th Street
Indianola, Iowa 50125
1-800-247-2464

IMPORTANT SAFETY RECALL

January 9, 2026



This notice applies to your vehicle(s) with VINS:



Ref: Safety Recall - (NHTSA Recall No. 25V805)

Cemen Tech C60 Volumetric Mixer-2020-2025; Cemen Tech C60E Volumetric Mixer 2020-2025; Cemen Tech C60T Volumetric Mixer 2023-2024; Cemen Tech Custom M60 Volumetric Mixer 2018-2025

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Cemen Tech, Inc. has decided that a defect which relates to motor vehicle safety exists in certain Volumetric mixers, listed above.

Our records show you as the owner of the vehicles(s) identified by VIN at the top of this notice. If you are the lessor of the vehicle, please forward a copy of this notice to the lessee within ten days to comply with federal regulations. If you are not the current owner of the vehicle, we ask you to send details of the new owner to Cemen Tech Inc. by email mb@cementech.com or by fax at 515-961-7409.

Reason for Recall

The mount plate and gusset of the mixer swivel hopper ring may crack or separate from the unit due to fatigue. This can cause the mixer hopper assembly (with the attached mixer) to separate from the conveyor frame of the vehicle.

A separated mixer can create a road hazard for others and increase the risk of a crash or injury. A separated mixer on a stationary vehicle can create a risk of injury to a person standing or working near the rear of the vehicle.

What We Will Do

Cemen Tech is working to have repair kits manufactured. Once the parts are available, we will remedy the defect without charge by repairing your affected Volumetric Mixer.

The repair will involve replacing the existing mixer hopper assembly with a new one made of different steel with a modified design of the inner ring. You will be contacted again once the new mixer hopper assembly is available with instructions on how and/or where to have your unit(s) repaired.

Until the repair can be made, we ask you perform daily inspections of the gussets and mount plates of the inner ring for signs of cracking or separation. See drawings below for location.



If cracks or separation of the mixer hopper with the main mounting on the conveyor frame weldment are visible, the vehicle should be put out of service and not used until repairs can be made. Please also contact Cemen Tech immediately if you locate visible cracks or separation.

In addition to daily inspections, properly clean the mixer after pouring concrete as specified in the operator's manual and inspect that the mixer is not full of hardened material and free to rotate.

Contact Information

If you have any questions or concerns throughout this process, please contact Matt Bergman, Director of Customer Service at Cemen Tech at 515-962-6739 or mb@cementech.com. If you believe that Cemen Tech, Inc. or your dealer has failed or is unable to remedy the defect without charge and within a reasonable time, you may submit a written complaint to the Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Ave., SE., Washington, DC 20590; call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <http://www.safercar.gov>.

Safety is our highest priority. We intend to complete this recall in a manner that causes the minimum disruption to your business.

Yours sincerely,

A handwritten signature in black ink that reads "Matt Bergman".

Matt Bergman
Director of Customer Service
Cemen Tech