



Nissan North America, Inc.

One Nissan Way
Franklin, TN 37067

Mailing Address:
PO Box 685001
Franklin, TN 37068

December 23, 2025

Ms. Eileen Sullivan
Associate Administrator for Enforcement
National Highway Traffic Safety Administration
Attn: Recall Management Division (NVS-215)
Room W48-302
1200 New Jersey Avenue, SE
Washington, D.C. 20590

Dear Ms. Sullivan:

We are transmitting the enclosed Non-Compliance Information Report in accordance with 49 CFR Part 573. A voluntary recall campaign will be initiated and your office provided with the notices.

Very truly,

A handwritten signature in black ink, appearing to read "Will Swindell".

Will Swindell
Manager,
Technical Compliance

Encl.

NONCOMPLIANCE INFORMATION REPORT

1. Manufacturer:

Nissan North America, Inc., Smyrna plant

2. Vehicles Potentially Involved:

Certain Model Year 2026 Nissan Rogue vehicles manufactured from October 12, 2025 through October 27, 2025 at the Smyrna, TN plant. Based on production records, the issue (as described in Section 5 below) is specific to Nissan Rogue vehicles equipped with an incorrectly sized spare tire assembly and produced during the specified vehicle production period. No other Nissan or INFINITI vehicles are affected.

The name, description and part number of the subject component is below:

<u>Part Name</u>	<u>Part Description</u>	<u>Part Number(s)</u>
Spare Tire, AWD	Spare Tire Assembly – All Wheel Drive	40312 6RR7E
Spare Tire, FWD	Spare Tire Assembly – Front Wheel Drive	40312 6RR8E

3. Total Number of Vehicles Potentially Involved:

Approximately 4,655 Model Year 2026 Nissan Rogue vehicles manufactured from October 12, 2025, through October 27, 2025.

4. Percentage of Vehicles Estimated to Actually Contain the Noncompliance:

65.33%

5. Description of the Noncompliance:

Due to a production issue that has since been corrected, certain affected Model Year 2026 Nissan Rogue vehicles may have been equipped with a spare tire that does not match the tire size specified on the vehicle's tire placard. As a result, the subject vehicles may fail to comply with the requirements of S4.3 of Federal Motor Vehicle Safety Standard (FMVSS) No. 110, which specifies that the spare tire must conform to the size and inflation pressure information provided on the placard. If the tire placard specifies an inflation pressure that does not match the specifications of the installed spare tire, the driver may inflate the spare to an incorrect pressure, increasing the risk of a crash.

6. Basis for Determination of the Existence of a Noncompliance:

On October 27, 2025, a maintenance technician observed a spare tire assembly that was out of sequence in production. Nissan commenced immediate containment measures, initiated a yard audit and launched an internal investigation.

November 2025 through Early December 2025 – Nissan conducted a yard audit of 1,996 Model Year 2026 Rogue vehicles at the Smyrna, Tennessee plant. The audit identified 1,304 vehicles that were manufactured with an incorrect spare tire assembly. Nissan's investigation determined that a spare tire assembly shifted within the overhead conveyor system that caused an out-of-sequence delivery of spare tires and subsequent incorrect installations on affected vehicles. Nissan implemented a countermeasure to prevent future occurrences.

Nissan evaluated the potential impact of an incorrect spare tire assembly on vehicle performance and compliance. During this time, Nissan confirmed that the tire placard label reflects the correct spare tire size; however, installation of an incorrect spare tire assembly may result in noncompliance with FMVSS No. 110.

December 16, 2025 - Out of an abundance of caution, Nissan decided to conduct a voluntary recall campaign to remedy the potentially affected vehicles in the U.S. market.

Nissan is not aware of any warranty claims, accident or injuries related to the subject condition.

7. Description of Corrective Action:

Dealers will be notified on January 6, 2026. Owners of all potentially affected vehicles will be notified beginning February 13, 2026. Nissan dealers will be instructed to inspect and if necessary, replace the spare tire assembly with the correct size. All inspections and repairs will be performed free of charge for parts and labor and may take less than one half (0.5) hour to complete.

Nissan will not include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy as the subject vehicles are still under warranty.

8. Copy of Notices:

Copies of all notices will be provided to NHTSA as they become available.