



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V010

Manufacturer Name: Gulf Stream Coach, Inc.

Submission Date: Jan 15, 2026

NHTSA Recall No.: 26V010

Manufacturer Recall No.:

Manufacturer Information

Population

Manufacturer Name: Gulf Stream Coach, Inc.

Address: P. O. Box 1005
503 S. Oakland Avenue
Nappanee IN, 46550

Total number of potentially involved: 172

Estimated percentage with defect: 98%

Vehicle Information

Vehicle 1: 2024-2024 GULF STREAM TRAIL BOSS

Product Category: Trailers

Product Type:

Fuel / Propulsion:

Production Dates: Sep 18, 2025 - Jan 12, 2026

Number of potentially involved: 86

Descriptive Information:

The first unit found with light issues was off line 09/19/2025 the issue with the systems check machine was found 01/12/2026. We pulled every unit that was built on that line in that time frame. We included all of them in the recall to make sure they were corrected

Vehicle 2: 2024-2024 GULF STREAM AMERI-LITE

Product Category: Trailers

Product Type: Recreational Trailers

Fuel / Propulsion:

Production Dates: Sep 18, 2025 - Jan 12, 2026

Number of potentially involved: 86

Descriptive Information:

The first unit found with light issues was off line 09/19/2025 the issue with the systems check machine was found 01/12/2026. We pulled every unit that was built on that line in that time frame. We included all of them in the recall to make sure they were corrected

Part 573 Safety Recall Report

26V010

Defect / Noncompliance Description

Description of the defect or noncompliance:

On the vehicles subject to this recall which may contain incorrect wiring for the tail turn lights. Turn signals were wired incorrectly. When left side is turned on, the right side flashes. When right side is turned on left side flashes.

FMVSS1: 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

When in tow the proper turn signal will not flash when turning or changing lanes. Could cause crash which could cause injury, fire, or death.

Description of the cause:

Faulty Systems Check Device

Identification of any warning that can occur:

When in tow the proper turn signal will not flash when turning or changing lanes. Could cause crash which could cause injury, fire, or death.

Component Manufacturer

Tier of Supplier: Tier 2

Supplier Type: Other

Name: Gulfstream Coach

Address: 851 S Oakland Ave
Nappanee IN, 46550

Country: United States

Involved Components

Component Name 1: Tail light / turn signal

Component Description: Red light to signal direction vehicle is moving

Component Part Number: 061A1Z

Chronology

Part 573 Safety Recall Report

26V010

Plant Manager discovered the issue when repairing a unit in the yard. Plant Manager then began checking other units off line on or about the same time the repaired unit was off line. It was discovered that approximately since mid- September that the Systems Check Device has been faulty.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Repair

Consumer Advisories: ☒ Do Not Drive ☐ Park Outside

Description of remedy program:

Tail light/ turn signal will be removed, wires changed from right side to left side

How remedy component differs from recalled component:

Components to not differ

Identify how/when recall condition was corrected in production:

The correction was done on 01/12/2026. The faulty systems check machine was repaired and returned to use in production

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Letters will be sent out starting Monday January 19th

Planned Dealer Notification Date: Jan 19, 2026 - Jan 21, 2026 ☐ No Dealers

Planned Interim Owner Notification Date: Jan 19, 2026 - Jan 21, 2026 ☐ No Owners

Planned Remedy Owner Notification Date: Jan 19, 2026 - Jan 21, 2026 ☐ Phased Recall

Date when VIN will be searchable: Jan 31, 2026