



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

## 26V082

**Manufacturer Name:** General Motors, LLC

**Submission Date:** Feb 12, 2026

**NHTSA Recall No.:** 26V082

**Manufacturer Recall No.:** N252542530

### Manufacturer Information

### Population

**Manufacturer Name:** General Motors, LLC

**Address:** 29427 Louis Chevrolet  
Road  
MAIL CODE 480-210-2V  
WARREN MI, 48093

**Total number of potentially involved:** 22

**Estimated percentage with defect:** 100%

### Vehicle Information

**Vehicle 1:** 2024-2024 CADILLAC LYRIQ

**Product Category:** Light Vehicles

**Product Type:** Passenger Car

**Fuel / Propulsion:** Electric Battery Power

**Production Dates:** May 24, 2023 - Sep 17, 2024

**Number of potentially involved:** 22

**Descriptive Information:**

Manufacturing and service records were used to determine the affected population.

Models equipped with optional hitch guidance and hitch view are not affected and not included in this recall.

22 Cadillac Lyriq vehicles are affected by this recall.

### Defect / Noncompliance Description

**Description of the defect or noncompliance:**

General Motors has decided that a defect which relates to motor vehicle safety exists in certain 2024 model year Cadillac Lyriq vehicles. The rear-view camera screen in these vehicles may turn grey with no camera image.

# Part 573 Safety Recall Report

## 26V082

**FMVSS1:**

**FMVSS2:**

**Description of the safety risk, including crash, fire, death, injury:**

If the rear-view camera is not functioning properly, rear visibility is reduced, increasing the risk of a crash during a backing event.

**Description of the cause:**

Vehicles received service software with an incorrect calibration that inadvertently disabled the rear vision camera.

**Identification of any warning that can occur:**

The driver may notice the rear camera screen may become grey with no rear camera image.

### Component Manufacturer

**Tier of Supplier:**

**Supplier Type:**

**Name:**

**Address:**

**Country:**

### Involved Components

**Component Name 1:** MODULE ASM-RDO & INFOTAINMENT CONT

**Component Description:** Module

**Component Part Number:** 86295933

### Chronology

On December 17, 2025, a GM employee submitted a report to GM's Speak Up for Safety (SUFS) system after noticing an increase in Technical Assistance Center (TAC) claims following the December 9, 2025 release of a radio software update. Customers alleged their rear camera turned grey with no camera image post software update.

GM opened a product investigation on January 9, 2026. GM's investigation found that the radio software update that was released for service contained an incorrect calibration that disabled the rear vision camera in vehicles not equipped with hitch guidance or hitch view features. GM reviewed vehicle

# Part 573 Safety Recall Report

# 26V082

build content and service records to identify vehicles potentially affected. There are 8 vehicles in the US that may still contain the incorrect calibration.

GM's Safety Field Action Decision Authority (SFADA) decided to conduct a safety recall on February 5, 2026. GM is not aware of any field incidents associated with this condition.

**Related NHTSA Recall Number:**

## Description of Remedy

**Remedy Type:** Software OTA, Software

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

General Motors will update the software in the vehicles' vehicle cockpit unit (VCU). Owners who have accepted applicable terms and conditions will have the opportunity to accept these software changes using wireless over-the-air (OTA) technology without having to bring their vehicle to a dealership. Alternatively, owners may have the updates performed at a GM dealer.

**How remedy component differs from recalled component:**

The revised software corrects the error that caused the rear vision camera to turn grey.

**Identify how/when recall condition was corrected in production:**

A corrected calibration file was released on December 18, 2026.

## Reimbursement Plan

**Description of reimbursement program:**

Pursuant to 49 C.F.R. § 573.13(d)(1), all covered vehicles are under warranty, so reimbursement is not offered.

**Period of reimbursement:**

**Costs to be reimbursed:**

**Address for reimbursement claims:**

## Recall Schedule

**Part 573 Safety Recall Report****26V082****Description of recall schedule:**

Dealers will be notified on February 12, 2026. Owner notification of an available remedy is estimated to start mailing on March 30, 2026.

**Planned Dealer Notification Date:** Feb 12, 2026 - Feb 12, 2026  No Dealers

**Planned Interim Owner Notification Date:**  No Owners

**Planned Remedy Owner Notification Date:** Mar 30, 2026 - Mar 30, 2026  Phased Recall

**Date when VIN will be searchable:** Feb 12, 2026