



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V106

Manufacturer Name: Subaru of America, Inc.

Submission Date: Feb 26, 2026

NHTSA Recall No.: 26V106

Manufacturer Recall No.: WRD-26

Manufacturer Information

Population

Manufacturer Name: Subaru of America, Inc.

Address: One Subaru Drive
Camden NJ, 08103

Total number of potentially involved: 69,153

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 SUBARU CROSSTREK HYBRID

Product Category: Light Vehicles

Product Type: Multipurpose Passenger Vehicle

Fuel / Propulsion: Hybrid Electric Vehicle

Production Dates: Jun 26, 2025 - Mar 06, 2026

Number of potentially involved: 17,446

Descriptive Information:

Description of the issue:

If the affected vehicles are left parked when the fuel tank is near full capacity and the vehicle is exposed to a significant rise in ambient temperature such that the fuel temperature and tank pressure increases, the affected vehicles may leak fuel from the filler cap.

The basis for how the recall population was determined:

Affected vehicles were identified using vehicle production records.

How the recalled products differ from products that were not included in the recall: Vehicles not affected by this condition are fitted with an improved fuel filler cap gasket, incorporating an O-ring to enhance sealing performance.

Vehicle 2: 2025-2025 SUBARU FORESTER HYBRID

Product Category: Light Vehicles

Product Type: Multipurpose Passenger Vehicle

Fuel / Propulsion: Hybrid Electric Vehicle

Production Dates: Nov 28, 2024 - Dec 05, 2025

Number of potentially involved: 51,707

Part 573 Safety Recall Report

26V106

Descriptive Information:

Description of the issue:

If the affected vehicles are left parked when the fuel tank is near full capacity and the vehicle is exposed to a significant rise in ambient temperature such that the fuel temperature and tank pressure increases, the affected vehicles may leak fuel from the filler cap.

The basis for how the recall population was determined:

Affected vehicles were identified using vehicle production records.

How the recalled products differ from products that were not included in the recall: All production is included in this recall.

Defect / Noncompliance Description

Description of the defect or noncompliance:

If the affected vehicles are left parked when the fuel tank is near full capacity, a significant increase in ambient temperature may cause the fuel to expand, increasing the pressure in the fuel tank and causing the fuel level to rise up the filler neck. Under this condition, an insufficient seal on the fuel cap assembly may allow fuel to leak from the filler neck.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

A fuel leak in the presence of an ignition source increases the risk of a vehicle fire.

Description of the cause:

Gasoline may leak due to insufficient sealing between the fuel cap housing and the fuel cap gasket.

Identification of any warning that can occur:

N/A

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name:

Address:

Country:

Part 573 Safety Recall Report

26V106

Involved Components

Component Name 1: CAP ASSY FILLER

Component Description: Fuel filler cap

Component Part Number: 42031SL000

Component Name 2: CAP ASSY FILLER

Component Description: Fuel filler cap

Component Part Number: 42031SL010

Chronology

12/23/2025 - Subaru received a technical report from the U.S. market regarding fuel leaks from fuel filler caps and initiated an investigation.

12/29/2025-1/12/2026 – Subaru attempted, and successfully reproduced the condition

1/13/2026 – 2/06/2026 – Subaru opened an investigation of parts that were returned from the field. It was determined that if the affected vehicles are left parked when the fuel tank is near full capacity, a significant increase in ambient temperature may cause the fuel to expand, increasing the pressure in the fuel tank and causing the fuel level to rise up the filler neck. Under this condition, an insufficient seal on the fuel cap assembly may allow fuel to leak from the filler neck.

February 13, 2025 – Out of an abundance of caution, Subaru decided to conduct a voluntary safety recall. Subaru is aware of 33 technical reports in the U.S. market. Subaru is not aware of any fires or injuries resulting from this condition.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Replace

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

For all the potentially affected vehicles, Subaru dealers will replace the gasket of the fuel filler cap with an improved one. As a precautionary measure until remedy parts are available, Subaru is advising customers to limit the fuel level to 50%.

How remedy component differs from recalled component:

Part 573 Safety Recall Report

26V106

The fuel filler cap gasket is improved, incorporating an O-ring to enhance sealing performance.

Identify how/when recall condition was corrected in production:

2025MY Forester is out of production. 2026MY Crosstrek will be corrected in production on or around 3/06/2026. Until the condition is corrected in production, Subaru will correct all affected vehicles prior to delivery.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Owner notification will occur within 60 days. Dealers were notified February 16, 2026.

Planned Dealer Notification Date: Feb 16, 2026 - Feb 16, 2026 No Dealers

Planned Interim Owner Notification Date: No Owners

Planned Remedy Owner Notification Date: Mar 25, 2026 - Mar 25, 2026 Phased Recall

Date when VIN will be searchable: Feb 16, 2026