



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V149

Manufacturer Name: Corp. Micro Bird, Inc.

Submission Date: Apr 02, 2026

NHTSA Recall No.: 26V149

Manufacturer Recall No.: 26-120-AUS

Manufacturer Information

Population

Manufacturer Name: Corp. Micro Bird, Inc.

Address: 3000, Rue Girardin
Drumondville, Quebec FS,
J2E 0A1

Total number of potentially involved: 584

Estimated percentage with defect:

Vehicle Information

Vehicle 1: 2003-2026 Micro Bird MB II

Product Category: Buses, Medium & Heavy Vehicles

Product Type: School Bus

Fuel / Propulsion: Spark Ignition Fuel

Production Dates: Mar 16, 2004 - Mar 02, 2026

Number of potentially involved: 115

Descriptive Information:

The vehicles were identified based on the options (product type) installed and the date of manufacture. Vehicles that were built prior to these products being installed in the vehicles and those without them were excluded.

Vehicle 2: 2006-2015 MICRO BIRD G5

Product Category: Buses, Medium & Heavy Vehicles

Product Type: School Bus

Fuel / Propulsion: Spark Ignition Fuel

Production Dates: Jan 30, 2006 - Sep 11, 2015

Number of potentially involved: 123

Descriptive Information:

The vehicles were identified based on the options (product type) installed and the date of manufacture. Vehicles that were built prior to these products being installed in the vehicles and those without them were excluded.

Part 573 Safety Recall Report

26V149

Vehicle 3: 2015-2026 Micro Bird T-Series

Product Category: Buses, Medium & Heavy Vehicles

Product Type: School Bus

Fuel / Propulsion: Spark Ignition Fuel

Production Dates: Apr 13, 2015 - Dec 18, 2025

Number of potentially involved: 63

Descriptive Information:

The vehicles were identified based on the options (product type) installed and the date of manufacture. Vehicles that were built prior to these products being installed in the vehicles and those without them were excluded.

Vehicle 4: 2016-2026 MICRO BIRD G5 SCHOOL BUS

Product Category: Buses, Medium & Heavy Vehicles

Product Type: School Bus

Fuel / Propulsion:

Production Dates: Nov 30, 2015 - Jan 23, 2026

Number of potentially involved: 283

Descriptive Information:

The vehicles were identified based on the options (product type) installed and the date of manufacture. Vehicles that were built prior to these products being installed in the vehicles and those without them were excluded.

Defect / Noncompliance Description

Description of the defect or noncompliance:

In certain school buses equipped with Q-Straint's Slide N' Click wheelchair securement systems, some floor anchor screw caps may not have been properly pushed all the way to the bottom during installation, possibly allowing the tie-downs to not lock completely or slip off the anchor in the occurrence of a collision.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Should the tie-down slip off the anchor, the wheelchair occupant could be injured in the event of a

Part 573 Safety Recall Report

26V149

crash.

Description of the cause:

Identification of any warning that can occur:

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name:

Address:

Country:

Involved Components

Component Name 1: Slide 'N Click Floor Anchor

Component Description: Floor anchor for wheel chair securement system

Component Part Number: Q8-7580-A

Chronology

On March 2, 2026 during a demonstration on the use of the wheelchair tie-downs with a new employee, an engineer couldn't lock the tie-down in the anchor. A visual inspection revealed that the anchor screw cap wasn't pushed completely down, preventing the apparatus from locking. After pushing it down manually, the system worked as intended.

An internal review of the procedures and inspection of the vehicles on site revealed that in a small percentage of vehicles, the caps were not pushed down sufficiently. New tools and procedures were developed to ensure that the installation was consistent throughout, and extensive testing confirmed the successful corrections were implemented.

Related NHTSA Recall Number:

Description of Remedy

Part 573 Safety Recall Report

26V149

Remedy Type: Inspect

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

Micro Bird will send to its vehicle dealers and respective owners instructions on how to inspect and, if necessary, correctly secure the anchor screw cap using recommendations from the manufacturer and appropriate tools for the correction.

The owners will not be mandated to visit their respective dealer, as the corrective action can be performed locally by the operator.

How remedy component differs from recalled component:

Identify how/when recall condition was corrected in production:

Reimbursement Plan

Description of reimbursement program:

Owners have the option of contacting their local dealer if they want to have an inspection handled by a technician.

Period of reimbursement:

The period of reimbursement is not limited in time.

Costs to be reimbursed:

Micro Bird will reimbursed labor costs.

Address for reimbursement claims:

3000 Girardin Street
Drummondville (Quebec) Foreign States, J2E 0A1

Recall Schedule

Description of recall schedule:

Micro Bird Corporation will notify dealers via emails and written notifications will be sent to recalled vehicles owners.

Planned Dealer Notification Date: Mar 27, 2026 - Apr 03, 2026

No Dealers

Part 573 Safety Recall Report

26V149

Planned Interim Owner Notification Date:

No Owners

Planned Remedy Owner Notification Date: Apr 27, 2026 - May 01, 2026

Phased Recall

Date when VIN will be searchable: