



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V156

Manufacturer Name: Tiffin Motorhomes, Inc.

Submission Date: Mar 17, 2026

NHTSA Recall No.: 26V156

Manufacturer Recall No.: TIF-147

Manufacturer Information

Population

Manufacturer Name: Tiffin Motorhomes, Inc.

Address: 105 2nd Street NW
PO Box 596
Red Bay AL, 35582

Total number of potentially involved: 340

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 TIFFIN GT1

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Nov 12, 2025 - Jan 09, 2026

Number of potentially involved: 4

Descriptive Information:

The recall population includes all floorplans of the 2025 & 2026 GH1, GH2 and GT Motorhomes built between 03/20/2024 and 01/13/2026 that were equipped with an optional Adventure Bench or Adventure Workstation and all 2026 GH1 19 SAV floorplan units built before 03/10/2026. These motorhomes have an OCCC label which state that the seatbelt seating capacity is 4, when it should be 2 for the units with the Adventure Bench or Adventure workstation and 5 for all GT units. The motorhomes not involved in the recall all have a correctly printed OCCC label.

Vehicle 2: 2025-2025 TIFFIN GT1

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Jun 21, 2024 - Nov 10, 2025

Number of potentially involved: 52

Descriptive Information:

The recall population includes all floorplans of the 2025 & 2026 GH1, GH2 and GT Motorhomes built between 03/20/2024 and 01/13/2026 that were equipped with an optional Adventure Bench or Adventure Workstation and all 2026 GH1 19 SAV floorplan units built before 03/10/2026. These motorhomes have an OCCC label which state that the seatbelt seating capacity is 4, when it should be

Part 573 Safety Recall Report

26V156

2 for the units with the Adventure Bench or Adventure workstation and 5 for all GT units. The motorhomes not involved in the recall all have a correctly printed OCCC label.

Vehicle 3: 2026-2026 TIFFIN GH2

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Mar 06, 2025 - Jan 13, 2026

Number of potentially involved: 44

Descriptive Information:

The recall population includes all floorplans of the 2025 & 2026 GH1, GH2 and GT Motorhomes built between 03/20/2024 and 01/13/2026 that were equipped with an optional Adventure Bench or Adventure Workstation and all 2026 GH1 19 SAV floorplan units built before 03/10/2026. These motorhomes have an OCCC label which state that the seatbelt seating capacity is 4, when it should be 2 for the units with the Adventure Bench or Adventure workstation and 5 for all GT units. The motorhomes not involved in the recall all have a correctly printed OCCC label.

Vehicle 4: 2025-2026 TIFFIN GH1

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Mar 20, 2024 - Mar 10, 2026

Number of potentially involved: 240

Descriptive Information:

The recall population includes all floorplans of the 2025 & 2026 GH1, GH2 and GT Motorhomes built between 03/20/2024 and 01/13/2026 that were equipped with an optional Adventure Bench or Adventure Workstation and all 2026 GH1 19 SAV floorplan units built before 03/10/2026. These motorhomes have an OCCC label which state that the seatbelt seating capacity is 4, when it should be 2 for the units with the Adventure Bench or Adventure workstation and 5 for all GT units. The motorhomes not involved in the recall all have a correctly printed OCCC label.

Defect / Noncompliance Description

Description of the defect or noncompliance:

The OCCC label states a safety belt equipped seating capacity of 4 when the GH1 and GH2 models of motorhomes have a safety belt equipped seating capacity of 2, and the GT units involved have a safety belt equipped seating capacity of 5.

Part 573 Safety Recall Report

26V156

FMVSS1: 110 - Tire selection and rims

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

If passengers in a motorhome were not secured by a seatbelt, this could lead to an injury.

Description of the cause:

As additional options were added to the floorplans, the database for printing the OCCC safety belt equipped seating capacity was not updated.

Identification of any warning that can occur:

There is no warning.

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name:

Address:

Country:

Involved Components

Component Name 1: OCCC Label printed by Tiffin Motorhomes

Component Description: Label that states the cargo carrying capacity information

Component Part Number: VIN specific Label, no part number

Chronology

03/09/2026, the owner of a 2026 GH1 contacted the Tiffin Motorhomes service department by email stating that the OCCC label on his recently purchased GH1 stated "Safety belt equipped seating capacity: 4" when there were only 2 seatbelts in the van. Service notified compliance of the complaint. 03/10/2026 Verified the VIN was built with an "Adventure Bench" option and only had 2 seatbelts. An investigation began. Requested a copy of the owner's OCCC label. Checked the units parked at Tiffin waiting to ship. The GH2 & GT vans were correct, but the 19 SAV GH1 was incorrect, the OCCC label stated 4. A shipping hold was issued on all vans. 03/11/2026 verified with IT that the original 2023 GH1 all had a total of 4 seatbelts and that when the additional options of the Adventure Bench (ABEN) or Adventure Workstation (ABWS) began to be offered, the seating capacity database was not adjusted.

Part 573 Safety Recall Report

26V156

An update to the database by IT was previously completed January 13, 2026. Any labels printed for the GH1 equipped with the ABEN or ABWS options before that date will be incorrect. IT verified they corrected the seating options for the 19 SAV on 03/10/2026. 03/12/2026 Safety committee met and voted to recall. While verifying the scope, engineering questioned the GT and GH2 floorplans. Compliance asked a field service representative for pictures from the dealership he was at and were able to confirm both the GT labels and the GH2 labels were also incorrect if printed before 01/13/2026. Scope of the recall was increased to include all GH2 and GT models.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Mail Information/Labels

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

Tiffin Motorhomes will mail corrected labels to all owners and dealers in possession of involved motorhomes.

How remedy component differs from recalled component:

The corrected label will state the safety belt equipped seating capacity correctly.

Identify how/when recall condition was corrected in production:

03/11/2026 IT was able to verify and confirm that all the database safety belt equipped seating capacity was listed correctly and linked to the correct options for the floorplans and would print correctly.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Notification letters including the corrected labels will be mailed no later than Friday, May 15, 2026. This will be completed at no cost to the owner.

Planned Dealer Notification Date: May 15, 2026 - May 15, 2026 No Dealers

Planned Interim Owner Notification Date: No Owners

Part 573 Safety Recall Report

26V156

Planned Remedy Owner Notification Date: May 15, 2026 - May 15, 2026 Phased Recall

Date when VIN will be searchable: May 15, 2026