



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V282

Manufacturer Name: Gulf States Toyota, Inc.

Submission Date: May 04, 2026

NHTSA Recall No.: 26V282

Manufacturer Recall No.: 26R1

Manufacturer Information

Population

Manufacturer Name: Gulf States Toyota, Inc.

Address: 1375 Enclave Parkway
Houston TX, 77077

Total number of potentially involved: 94

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 TOYOTA 4RUNNER

Product Category: Light Vehicles

Product Type: Multipurpose Passenger Vehicle

Fuel / Propulsion: Spark Ignition Fuel

Production Dates: Mar 13, 2026 - Apr 14, 2026

Number of potentially involved: 94

Descriptive Information:

The recall population consists of certain model year 2026 4Runner vehicles equipped with All Terrain Tire Upgrade as part of a Blackout Off-Road Upgrade Package accessory installed by distributor Gulf States Toyota, Inc. ("GST") displaying inaccurate added weight values on the load carrying capacity modification label.

Defect / Noncompliance Description

Description of the defect or noncompliance:

The affected vehicles display a load carrying capacity modification label installed by GST that may not conform with the requirements of FMVSS 110 S10.2. The labels on the affected vehicles indicate added weight that may be higher than the actual total weight of accessories installed on the vehicle. FMVSS 110 S10.2 requires that the weight amount the load carrying capacity is reduced must be accurate within one percent of the actual added weight.

FMVSS1: 110 - Tire selection and rims

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Part 573 Safety Recall Report

26V282

On the affected vehicles, the weight listed on the load carrying capacity modification label may be higher than the actual total weight of accessories installed. As a result, the affected vehicles do not meet the requirements of FMVSS No. 110 S10.2.

Description of the cause:

Due to a system error, GST installed load carrying capacity modification labels on affected vehicles indicating added weight that did not reflect the actual total weight of accessories installed. The weight of each All Terrain Tire Upgrade accessory installed on the subject vehicles may have been erroneously counted as a set resulting in these vehicles receiving a load carrying capacity modification label that states an added weight greater than the actual weight of the accessories installed.

Identification of any warning that can occur:

N/A

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name: RR Donnelly

Address: 111 S Wacker Dr.
Chicago IL, 60606

Country: United States

Involved Components

Component Name 1: WGHT STICKER BLANK DONNELLY

Component Description: WGHT STICKER BLANK DONNELLY

Component Part Number: 00012-99019-02

Chronology

During an internal inspection at GST's vehicle processing center on April 15, 2026, it was discovered that the load carrying capacity modification label on a vehicle may have displayed an inaccurate weight value.

GST initiated an investigation and discovered an inaccurate weight value in the system for an All Terrain Tire Upgrade accessory part which caused inaccurately calculated weight values to be used for the load carrying capacity modification label for some vehicles.

As part of the investigation, GST identified specific accessory parts with incorrect weight values, corrected errors and performed a review of vehicles, additional accessory part weight values and installed labels to determine if any errors may have resulted in a noncompliance.

Part 573 Safety Recall Report

26V282

GST reviewed the findings and information from the investigation and determined that the labels on affected vehicles may constitute a noncompliance with the FMVSS 110 S10.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Mail Information/Labels, Inspect, Replace

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

GST will notify owners by mail of the noncompliance. The letter to owners will include a replacement load carrying capacity modification label for their vehicle and detailed replacement instructions. GST will also offer the replacement of this label at any Toyota dealer at no charge.

How remedy component differs from recalled component:

N/A

Identify how/when recall condition was corrected in production:

When the system error was identified during the investigation, GST corrected the system and confirmed accurate weight of the affected accessory was included on newly printed labels. GST also identified affected vehicles in production with inaccurate labels and affixed the appropriate replacement label.

Reimbursement Plan

Recall Schedule

Description of recall schedule:

Notification to dealers will be sent on or before 5/8/26. GST expects the mailing of customer notifications letters to begin on or about 6/22/26. A copy of the draft owner notification letter will be provided and dealer communications will be submitted as they are issued.

Planned Dealer Notification Date: May 08, 2026 - May 08, 2026 ☐ No Dealers

Planned Interim Owner Notification Date: ☐ No Owners

Planned Remedy Owner Notification Date: Jun 22, 2026 - Jun 26, 2026 ☐ Phased Recall

Part 573 Safety Recall Report

26V282

Date when VIN will be searchable: