



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

## 26V285

**Manufacturer Name:** Winnebago Industries, Inc.

**Submission Date:** May 05, 2026

**NHTSA Recall No.:** 26V285

**Manufacturer Recall No.:** 206

### Manufacturer Information

### Population

**Manufacturer Name:** Winnebago Industries, Inc.

**Address:** PO BOX 152  
605 W. Crystal Lake Rd.  
Forest City IA, 50436

**Total number of potentially involved:** 155

**Estimated percentage with defect:** 100%

### Vehicle Information

**Vehicle 1:** 2026-2027 WINNEBAGO SOLIS

**Product Category:** Buses, Medium & Heavy Vehicles

**Product Type:** Recreational Vehicle

**Fuel / Propulsion:**

**Production Dates:** Dec 16, 2025 - Apr 03, 2026

**Number of potentially involved:** 155

**Descriptive Information:**

The population was determined by the production dates.

### Defect / Noncompliance Description

**Description of the defect or noncompliance:**

On certain Winnebago vehicles, the LP hose was incorrectly routed over (rather than behind) the exhaust heat shield.

**FMVSS1:**

**FMVSS2:**

**Description of the safety risk, including crash, fire, death, injury:**

An LP hose routed over the heat shield is subject to continuous elevated heat exposure, which can cause the hose material to harden, become brittle, and develop micro-cracks. A compromised hose may leak propane gas, which, in the presence of a heat or ignition source, could result in a fire, increasing the risk of burn injury or property damage

# Part 573 Safety Recall Report

**26V285****Description of the cause:**

The LP hose was rerouted over the heat shield rather than behind it due to inadequate rework instructions.

**Identification of any warning that can occur:**

None.

## Component Manufacturer

**Tier of Supplier:**

**Supplier Type:** OEM

**Name:** Winnebago Industries

**Address:** 605 West Crystal Lake Road  
Forest City IA, 50436

**Country:** United States

## Involved Components

**Component Name 1:** LP Hose

**Component Description:** LP Hose

**Component Part Number:** NA

## Chronology

**April 16, 2026:** Winnebago was notified of an initial claim that the LP line failed from exposure to continuous heat due to improper routing above the heat shield. An investigation was subsequently opened.

**April 24, 2026:** The Brand Action Committee voted to escalate topic to the Product Safety Committee for review.

**April 27, 2026:** The Product Safety Committee voted to initiate a recall.

As of May 5, 2026, Winnebago is aware of 2 claims regarding this issue. No injuries, deaths, or property damage have been reported.

**Related NHTSA Recall Number:**

## Description of Remedy

# Part 573 Safety Recall Report

# 26V285

**Remedy Type:** Repair, Inspect

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

Reimbursement requests will follow the general reimbursement plan on file with NHTSA.

**How remedy component differs from recalled component:**

The LP hose is correctly routed behind the heat shield.

**Identify how/when recall condition was corrected in production:**

Production reviewed and confirmed the procedure routed the LP line behind the heat shield.

## Reimbursement Plan

Manufacturer used general reimbursement plan on file.

## Recall Schedule

**Description of recall schedule:**

Recall schedule for notifications will be within the 60-day requirement.

**Planned Dealer Notification Date:** Jun 05, 2026 - Jun 05, 2026  No Dealers

**Planned Interim Owner Notification Date:**  No Owners

**Planned Remedy Owner Notification Date:** Jul 03, 2026 - Jul 03, 2026  Phased Recall

**Date when VIN will be searchable:**