



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V322

Manufacturer Name: K.Z., Inc.

Submission Date: Jun 03, 2026

NHTSA Recall No.: 26V322

Manufacturer Recall No.: KZ-2026-01

Manufacturer Information

Population

Manufacturer Name: K.Z., Inc.

Address: 0985 N 900W
Shipshewana IN, 46565

Total number of potentially involved: 677

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 KZRV DURANGO

Product Category: Trailers

Product Type: Recreational Trailers

Fuel / Propulsion:

Production Dates: Jun 04, 2025 - Apr 22, 2026

Number of potentially involved: 677

Descriptive Information:

These vehicles had improperly torqued or a lower grade shock bolts installed by LCI.

Defect / Noncompliance Description

Description of the defect or noncompliance:

It has been decided that the vehicles in the recall population may have improperly torqued or lower grade shock bolts installed.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

The separation of a shock absorber bolt head while the camper is in motion may result in the release of road debris which could cause, property damage, or injury to other road users.

Description of the cause:

Part 573 Safety Recall Report

26V322

Improperly torqued shock bolts may be damaged and break if over torqued and vibrate loose if under torqued.

Identification of any warning that can occur:

Clunking or rattling noise while traveling over bumps, visibly damaged components

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name: LCI

Address: 2020 Blakesley Pkwy
Bristol IN, 46507

Country: United States

Involved Components

Component Name 1: Touring Coil Spring Suspension

Component Description: 3/8 x 16 x 3/4 shock bolts

Component Part Number: 506260

Chronology

04/21/26- Multiple units found with broken shock bolts in yard

04/23/26- Meeting held with LCI. They identified that certain Touring Coil Spring Suspensions may have been assembled with a bad batch of shock absorber mounting bolts that was due to hydrogen embrittlement. Lippert informed KZ that at the time the scope was small.

4/24/26- LCI had techs out to KZ to replace all bolts on any TCS Suspensions on KZ grounds as well as units being held in surrounding holding yards.

05/07/26 -LCI notified KZ that they issued a Technical Service Bulletin (TSB) 019-001-2026 identifying a potential condition involving improper torque of shock mounting bolts and providing repair instructions and corrective action.

05/08/26- Investigation opened to determine the scope of units affected.

05/11/26- KZ compiled information to identify the potentially affected vehicle population.

05/15/26- KZ determined that the condition could present a safety-related defect due to the potential of bolt heads or shock separation during transit, which could create a hazard to following vehicles. KZ elected to conduct a safety recall.

Part 573 Safety Recall Report

26V322

Related NHTSA Recall Number:

Description of Remedy

Remedy Type:

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

The remedy is to replace the existing shock bolts with a bolt replacement kit. KZ will notify owners and dealers and instruct them to have the recall repair completed at no charge. Dealers will perform the repair in accordance with Lippert Components, Inc. Recall 26E-032. The replacement will be done at no cost to the owner. Reimbursement will follow the general reimbursement plan that is on file with NHTSA.

How remedy component differs from recalled component:

The remedy replaces the existing shock bolts with a higher-grade bolt kit while outlining specific torque requirements.

Identify how/when recall condition was corrected in production:

Lippert confirmed that this condition was corrected in production beginning April 23, 2026. Units produced or shipped on or after this date were assembled using the updated hardware and controlled installation process and are not affected by this condition.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

KZ RV has the utmost urgency in notifying owners about a recall that affects their vehicle. Letters will be sent out once all pertinent information has been gathered.

Planned Dealer Notification Date: May 20, 2026 - Jul 15, 2026 No Dealers

Planned Interim Owner Notification Date: May 20, 2026 - Jul 15, 2026 No Owners

Part 573 Safety Recall Report

26V322

Planned Remedy Owner Notification Date: May 20, 2026 - Jul 15, 2026 Phased Recall

Date when VIN will be searchable: