



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

## 26V338

**Manufacturer Name:** Tiffin Motorhomes, Inc.

**Submission Date:** May 26, 2026

**NHTSA Recall No.:** 26V338

**Manufacturer Recall No.:** TIF-148

### Manufacturer Information

### Population

**Manufacturer Name:** Tiffin Motorhomes, Inc.

**Address:** 105 2nd Street NW  
PO Box 596  
Red Bay AL, 35582

**Total number of potentially involved:** 392

**Estimated percentage with defect:** 60%

### Vehicle Information

**Vehicle 1:** 2025-2025 TIFFIN GT1

**Product Category:** Light Vehicles

**Product Type:**

**Fuel / Propulsion:**

**Production Dates:** Jun 24, 2024 - Nov 10, 2025

**Number of potentially involved:** 50

**Descriptive Information:**

These floorplans involved in the recall were determined to have components that were fastened to the floor above the fuel tank. The floorplans not included have different floorplan set ups with no components being fastened to the floor above the fuel tank.

**Vehicle 2:** 2026-2026 TIFFIN GH2

**Product Category:** Light Vehicles

**Product Type:**

**Fuel / Propulsion:**

**Production Dates:** Mar 06, 2025 - Feb 27, 2026

**Number of potentially involved:** 58

**Descriptive Information:**

These floorplans involved in the recall were determined to have components that were fastened to the floor above the fuel tank. The floorplans not included have different floorplan set ups with no components being fastened to the floor above the fuel tank.

# Part 573 Safety Recall Report

# 26V338

**Vehicle 3:** 2026-2026 TIFFIN GT1

**Product Category:** Light Vehicles

**Product Type:**

**Fuel / Propulsion:**

**Production Dates:** Nov 12, 2025 - Apr 08, 2026

**Number of potentially involved:** 32

**Descriptive Information:**

These floorplans involved in the recall were determined to have components that were fastened to the floor above the fuel tank. The floorplans not included have different floorplan set ups with no components being fastened to the floor above the fuel tank.

**Vehicle 4:** 2026-2026 TIFFIN GH1

**Product Category:** Light Vehicles

**Product Type:**

**Fuel / Propulsion:**

**Production Dates:** Mar 24, 2025 - Apr 06, 2026

**Number of potentially involved:** 252

**Descriptive Information:**

These floorplans involved in the recall were determined to have components that were fastened to the floor above the fuel tank. The floorplans not included have different floorplan set ups with no components being fastened to the floor above the fuel tank.

## Defect / Noncompliance Description

**Description of the defect or noncompliance:**

The fuel tank on these models of motorhomes may have a puncture on the top of the tank.

**FMVSS1:**

**FMVSS2:**

**Description of the safety risk, including crash, fire, death, injury:**

If the fuel tank is punctured, this could lead to a over spill of fuel which can lead to a risk of fire.

**Description of the cause:**

The incorrect length of screws were used to fasten components directly to the floor that is above the

**Part 573 Safety Recall Report****26V338**

fuel tank, which could lead to the top of the fuel tank being punctured.

**Identification of any warning that can occur:**

Owners may be alerted by the presence of fuel under the motorhome after filling the fuel tank to full or may notice the odor of fuel when they are not filling the fuel tank.

**Component Manufacturer****Tier of Supplier:**

**Supplier Type:** Distributor

**Name:** Mercedes Benz Birmingham, WholesaleParts

**Address:** 705 Mercedes Way  
Hoover AL, 35244

**Country:** United States

**Involved Components**

**Component Name 1:** Fuel Tank

**Component Description:** Fuel Tank

**Component Part Number:** A9074712800

**Chronology**

04/14/2026 During the April Safety Committee Meeting, a new issue was introduced that Tiffin's warranty department had received several claims for a damaged fuel tanks on some GH and GT units. Inspection had shown that a screw had punctured the top of the fuel tank and the fuel tank had to be replaced. Engineering states some components are installed directly to the sheet metal floor. These components vary depending on the floorplan and options. There is an OEM bracket above the fuel tank from Mercedes Benz but the clearance is very small and if the incorrect length of screw is used, it would be possible to puncture the top of the fuel tank. Safety committee voted to begin an investigation into the claims. 04/15/2026 - 05/19/2026 investigation into warranty claims and authorizations issued for this issue. Compliance found a total of 8 VIN's with warranty claims or authorizations for replacing the fuel tank due to a puncture in the top of the fuel tank. 05/20/2026 During the May Safety Committee meeting, the committee voted to file a safety recall involving all year models and floorplans with warranty claims or authorizations to replace the fuel tank due to a puncture.

**Related NHTSA Recall Number:**

**Description of Remedy**

# Part 573 Safety Recall Report

# 26V338

**Remedy Type:** Inspect, Repair

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

Tiffin will have all fuel tanks inspected to determine if a screw has punctured the top of the fuel tank. If any punctured fuel tanks are found, Tiffin will have a new fuel tank installed.

**How remedy component differs from recalled component:**

The remedy components will be free of any punctures.

**Identify how/when recall condition was corrected in production:**

Engineering designed a template to clearly mark the location of the fuel tank so that production could take extra precautions when attaching any item to the floor in the area above the fuel tank, such as verifying the correct length of fasteners are being used and the component is being installed in the correct location. The template began to be used in production 04/15/2026.

## Reimbursement Plan

Manufacturer used general reimbursement plan on file.

## Recall Schedule

**Description of recall schedule:**

Tiffin Motorhomes will mail letters to customers and dealers that are in possession of the involved motorhomes explaining the issue and asking them to take the motorhome to a dealer or a service center so the fuel tank can be inspected and repaired if found to be damaged. This will be done at no cost to the owner.

**Planned Dealer Notification Date:** Jul 24, 2026

No Dealers

**Planned Interim Owner Notification Date:**

No Owners

**Planned Remedy Owner Notification Date:** Jul 24, 2026

Phased Recall

**Date when VIN will be searchable:** Jul 24, 2026