



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V339

Manufacturer Name: Ember Recreational Vehicles, INC

Submission Date: May 27, 2026

NHTSA Recall No.: 26V339

Manufacturer Recall No.:

Manufacturer Information

Population

Manufacturer Name: Ember Recreational
Vehicles, INC
Address: 710 Commerce Drive
Bristol IN, 46507

Total number of potentially involved: 143
Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 EMBER TOURING EDITION

Product Category: Trailers

Product Type: Recreational Trailers

Fuel / Propulsion:

Production Dates: Sep 01, 2025 - Sep 01, 2025

Number of potentially involved: 2

Descriptive Information:

2026 Touring Edition all models with Curt Touring Coil Suspensions

Vehicle 2: 2027-2027 EMBER TOURING EDITION

Product Category: Trailers

Product Type: Recreational Trailers

Fuel / Propulsion:

Production Dates: Dec 08, 2025 - May 04, 2026

Number of potentially involved: 141

Descriptive Information:

2027 Touring Edition All models with Curt Touring Coil Suspensions

Defect / Noncompliance Description

Part 573 Safety Recall Report

26V339

Description of the defect or noncompliance:

It has been determined that vehicles within the recall population may be equipped with shock retaining bolts that may have been over-torqued potentially causing the bolt heads to fracture.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Under certain operating conditions, if the bolt head fractures while the vehicle is in motion, the bolt head and retaining washer may loosen or detach causing road debris, potentially increasing the risk of vehicle crash.

Description of the cause:

The bolt heads may have been over-torqued.

Identification of any warning that can occur:

NA

Component Manufacturer

Tier of Supplier: Tier 1

Supplier Type: OEM

Name: Lippert

Address: 2020 Blakesley Pkwy
Bristol IN, 46507

Country: United States

Involved Components

Component Name 1: Fasten Screw

Component Description: 3/8 – 16 x 3 / 4 HWH ZN HEX 3L ST

Component Part Number: 298315

Chronology

May 5, 2026: Lippert notified Ember of a TSB to replace all bolts on affected units.

Part 573 Safety Recall Report**26V339**

May 5, 2026: Investigation opened to determine the scope and range of units affected.

May 6, 2026: Yard shipments were placed on hold, and affected units in yard and online were addressed by Lippert.

May 7, 2026: Lippert released TSB.

May 15, 2026: Ember published and emailed dealers the TSB.

May 21, 2026: Lippert notified Ember of TSB being escalated to a recall.

Related NHTSA Recall Number: Lippert Recall 26EXXX

Description of Remedy

Remedy Type: Repair

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

The remedy involves removing the existing shock retaining bolts and replacing them with grade 8 – 3/8 -16 x 3/4” bolts. Blue Loctite or an equivalent thread locking compound, must be applied, and the must be torqued to 20 – 30 ft lbs.

How remedy component differs from recalled component:

The Grade 8 – 3/8 -16 x 3/4” replacement fastener provides a wider torque range for this application and is more tolerant of improper torque application than the original Part 298315 - 3/8 – 16 x 3 / 4 HWH ZN HEX 3L ST grade 5 fastener.

Identify how/when recall condition was corrected in production:

Units not shipped were placed on hold for repair.

Reimbursement Plan**Recall Schedule**

Description of recall schedule:

Ember will notify dealers and owner's of the recreational vehicles by letter. A final copy of the owner letter will be provided to NHTSA along with dealer repair procedures.

Planned Dealer Notification Date: Jun 01, 2026 - Jun 01, 2026 No Dealers

Part 573 Safety Recall Report

26V339

Planned Interim Owner Notification Date:

No Owners

Planned Remedy Owner Notification Date: Jun 01, 2026 - Jun 01, 2026

Phased Recall

Date when VIN will be searchable: