



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V345

Manufacturer Name: General Motors, LLC

Submission Date: May 28, 2026

NHTSA Recall No.: 26V345

Manufacturer Recall No.: N262558671

Manufacturer Information

Population

Manufacturer Name: General Motors, LLC

Address: 29427 Louis Chevrolet
Road
MAIL CODE 480-210-2V
WARREN MI, 48093

Total number of potentially involved: 232

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 CHEVROLET EXPRESS

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion: Spark Ignition Fuel

Production Dates: Feb 11, 2026 - Feb 16, 2026

Number of potentially involved: 199

Descriptive Information:

Part traceability data and manufacturing records were used to identify vehicles that may have received a suspect part.

Vehicle 2: 2026-2026 GMC SAVANA

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion: Spark Ignition Fuel

Production Dates: Feb 11, 2026 - Feb 16, 2026

Number of potentially involved: 33

Descriptive Information:

Part traceability data and manufacturing records were used to identify vehicles that may have received a suspect part.

Part 573 Safety Recall Report

26V345

Defect / Noncompliance Description

Description of the defect or noncompliance:

General Motors has decided that a defect which relates to motor vehicle safety may exist in certain 2026 model year Chevrolet Express and GMC Savana vehicles. In these vehicles, a component within the shifting system may have a supplier manufacturing defect that can cause a false tactile indication of the gear selector position. The gear position indicator on the instrument cluster correctly displays the transmission gear.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

If a driver relies only on tactile indication of the vehicle's gear position, unintended vehicle motion may occur, increasing the risk of a crash. Until the vehicle is remedied, drivers should visually verify the shift position indicator each time a gear is selected and apply the parking brake whenever the vehicle is placed in Park.

Description of the cause:

A component within the steering column transmission control may be out of specification, which could allow unintended movement between the column shifter and the transmission control. This movement may create slack or excessive tension in the shift cable, potentially impairing the cable's ability to engage the intended transmission gear.

Identification of any warning that can occur:

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name: Nexteer Automotive Corporation

Address: 3900 E Holland Rd
Saginaw MI, 48601

Country: United States

Involved Components

Component Name 1: COLUMN ASM - STRG

Component Description: Steering Column Assembly

Part 573 Safety Recall Report

26V345**Component Part Number:** 85045678

Chronology

On April 21, 2026, a GM engineer submitted a report to GM's Speak Up For Safety (SUFS) program after GM's supplier advised that steering column assemblies containing out-of-specification components had been shipped to assembly plants producing Express and Savana vehicles. GM opened a product investigation on April 24, 2026. Part trace information provided by the supplier was used to identify potentially affected vehicles. GM is not aware of any field incidents or complaints associated with this condition. On May 21, 2026, GM's Safety Field Action Decision Authority (SFADA) decided to conduct a safety recall.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Replace**Consumer Advisories:** Do Not Drive Park Outside**Description of remedy program:**

Dealers will replace the transmission control on the steering column.

How remedy component differs from recalled component:

Remedy components were produced outside of the supplier's suspect lot.

Identify how/when recall condition was corrected in production:

GM's supplier initiated containment in February 2026. Vehicles built after February 16, 2026 do not contain suspect parts.

Reimbursement Plan

Description of reimbursement program:

Pursuant to 49 C.F.R. § 573.13(d)(1), all covered vehicles are under warranty, so reimbursement is not offered.

Period of reimbursement:**Costs to be reimbursed:****Address for reimbursement claims:**

Part 573 Safety Recall Report**26V345****Recall Schedule****Description of recall schedule:**

Dealers will be notified on May 28, 2026. Owner notification is estimated to start mailing on July 13, 2026.

Planned Dealer Notification Date: May 28, 2026 - May 28, 2026 No Dealers

Planned Interim Owner Notification Date: No Owners

Planned Remedy Owner Notification Date: Jul 13, 2026 - Jul 13, 2026 Phased Recall

Date when VIN will be searchable: May 28, 2026