



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V357

Manufacturer Name: Braun Corporation

Submission Date: Jun 08, 2026

NHTSA Recall No.: 26V357

Manufacturer Recall No.:

Manufacturer Information

Population

Manufacturer Name: Braun Corporation

Address: 631 West 11 Street
Winamac IN, 46996

Total number of potentially involved: 15

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 RAM PROMASTER

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Apr 01, 2026 - May 18, 2026

Number of potentially involved: 15

Descriptive Information:

The installed bill of material (BOM) for these units specified an incorrect wheelchair occupant lap/shoulder belt assembly. The manual lap belts and Q-One lap/shoulder belts use incompatible connectors, so the upper shoulder belt does not properly engage with the installed lap belt system.

Defect / Noncompliance Description

Description of the defect or noncompliance:

The bill of material (BOM) for these units specified an incorrect wheelchair occupant lap/shoulder belt assembly. The manual lap belts and Q-One lap/shoulder belts use incompatible connectors, so the upper shoulder belt does not properly engage with the installed lap belt system.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Use of the affected restraints may result in the wheelchair occupant not being properly restrained in a

Part 573 Safety Recall Report

26V357

crash or sudden stop. An improperly mated shoulder belt can create a false impression of being buckled, increasing the risk of serious injury or death.

Description of the cause:

The bill of material (BOM) for these units specified an incorrect wheelchair occupant lap/shoulder belt assembly.

Identification of any warning that can occur:

The seat belt for the wheelchair occupant will not make a secure connection.

Component Manufacturer

Tier of Supplier: Tier 1

Supplier Type:

Name: Q'Straint

Address: 4031 NE 12th Terrace
Oakland Park FL, 33334

Country: United States

Involved Components

Component Name 1: TX11258-BA

Component Description: Kit-QSTRAINT ONE-COMBO BELT

Component Part Number: TX11258-BA

Chronology

5/18/2026 - Notified by dealer that seat belt system didn't seem to properly connect.

5/18/2026 - Stopped shipment while investigating out of an abundance of caution.

5/19/2026 - Investigation began

5/27/2026 - Determined that incorrect belts were included in BOM

5/28/2026 - Determined all shipped units that are impacted.

6/2/2026 - Filed form 573 with NHTSA.

Related NHTSA Recall Number:

Part 573 Safety Recall Report

26V357

Description of Remedy

Remedy Type: Replace

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

Corrected lap/shoulder belts for the wheelchair occupant position (part #604290) will be sent to dealer to be installed on each unit.

How remedy component differs from recalled component:

The replacement lap/shoulder belt #604290, mates to manual lap belt as required. The recalled Q-One lap/shoulder belt would not physically mate to manual lap belt.

Identify how/when recall condition was corrected in production:

No further units have been built since this was discovered, but BOM has been corrected for future builds.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Notifications will be sent to dealers and product owners.

Planned Dealer Notification Date: Jun 08, 2026 - Jun 15, 2026 ☐ No Dealers

Planned Interim Owner Notification Date: ☐ No Owners

Planned Remedy Owner Notification Date: Jun 22, 2026 - Jul 10, 2026 ☐ Phased Recall

Date when VIN will be searchable: