



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V357

Manufacturer Name: Braun Corporation

Submission Date: Jun 02, 2026

NHTSA Recall No.: 26V357

Manufacturer Recall No.:

Manufacturer Information

Population

Manufacturer Name: Braun Corporation

Address: 631 West 11 Street
Winamac IN, 46996

Total number of potentially involved: 15

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 RAM PROMASTER

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Apr 01, 2026 - May 18, 2026

Number of potentially involved: 15

Descriptive Information:

The installed bill of material (BOM) for these units specified an incorrect wheelchair occupant lap/shoulder belt assembly. The manual lap belts and Q-One lap/shoulder belts use incompatible connectors, so the upper shoulder belt does not properly engage with the installed lap belt system.

Defect / Noncompliance Description

Description of the defect or noncompliance:

The bill of material (BOM) for these units specified an incorrect wheelchair occupant lap/shoulder belt assembly. The manual lap belts and Q-One lap/shoulder belts use incompatible connectors, so the upper shoulder belt does not properly engage with the installed lap belt system.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Use of the affected restraints may result in the wheelchair occupant not being properly restrained in a

Part 573 Safety Recall Report

26V357

crash or sudden stop. An improperly mated shoulder belt can create a false impression of being buckled, increasing the risk of serious injury or death.

Description of the cause:

The bill of material (BOM) for these units specified an incorrect wheelchair occupant lap/shoulder belt assembly.

Identification of any warning that can occur:

The seat belt for the wheelchair occupant will not make a secure connection.

Component Manufacturer

Tier of Supplier: Tier 1

Supplier Type:

Name: Q'Straint

Address: 4031 NE 12th Terrace
Oakland Park FL, 33334

Country: United States

Involved Components

Component Name 1: TX11258-BA

Component Description: Kit-QSTRAINT ONE-COMBO BELT

Component Part Number: TX11258-BA

Chronology

5/18/2026 - Notified by dealer that seat belt system didn't seem to properly connect.

5/18/2026 - Stopped shipment while investigating out of an abundance of caution.

5/19/2026 - Investigation began

5/27/2026 - Determined that incorrect belts were included in BOM

5/28/2026 - Determined all shipped units that are impacted.

6/2/2026 - Filed form 573 with NHTSA.

Related NHTSA Recall Number:

Part 573 Safety Recall Report

26V357

Description of Remedy

Remedy Type: Replace**Consumer Advisories:** ☐ Do Not Drive ☐ Park Outside**Description of remedy program:**

Corrected lap/shoulder belts for the wheelchair occupant position (part #604290) will be sent to dealer to be installed on each unit.

How remedy component differs from recalled component:

The replacement lap/shoulder belt #604290, mates to manual lap belt as required. The recalled Q-One lap/shoulder belt would not physically mate to manual lap belt.

Identify how/when recall condition was corrected in production:

No further units have been built since this was discovered, but BOM has been corrected for future builds.

Reimbursement Plan

Recall Schedule

Description of recall schedule:

Notifications will be sent to dealers and product owners.

Planned Dealer Notification Date: Jun 08, 2026 - Jun 15, 2026 ☐ No Dealers**Planned Interim Owner Notification Date:** ☐ No Owners**Planned Remedy Owner Notification Date:** Jun 22, 2026 - Jul 10, 2026 ☐ Phased Recall**Date when VIN will be searchable:**