



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V358

Manufacturer Name: Braun Corporation

Submission Date: Jun 02, 2026

NHTSA Recall No.: 26V358

Manufacturer Recall No.:

Manufacturer Information

Population

Manufacturer Name: Braun Corporation

Address: 631 West 11 Street
Winamac IN, 46996

Total number of potentially involved: 141

Estimated percentage with defect: 30%

Vehicle Information

Vehicle 1: 2023-2026 CHRYSLER PACIFICA

Product Category: Light Vehicles

Product Type: Multipurpose Passenger Vehicle

Fuel / Propulsion:

Production Dates: May 07, 2026 - May 22, 2026

Number of potentially involved: 129

Descriptive Information:

Affected vehicles may have been manufactured with an incorrect spring inside the wall connector for the front seat harness possibly on one of or both the driver and passenger sides.

Vehicle 2: 2023-2026 Chrysler Voyager

Product Category: Light Vehicles

Product Type: Multipurpose Passenger Vehicle

Fuel / Propulsion:

Production Dates: May 07, 2026 - May 22, 2026

Number of potentially involved: 12

Descriptive Information:

Affected vehicles may have been manufactured with an incorrect spring inside the wall connector for the front seat harness possibly on one of or both the driver and passenger sides.

Defect / Noncompliance Description

Part 573 Safety Recall Report**26V358****Description of the defect or noncompliance:**

Affected vehicles could have been manufactured with an incorrect spring inside the wall connector for the front seat harness on one or both driver and passenger side seats. The spring may contact electrical terminals resulting in possible occupant restraint system failure/airbag light illumination.

FMVSS1:**FMVSS2:****Description of the safety risk, including crash, fire, death, injury:**

Because the airbag warning light is illuminated, the airbag system may not function properly. In the event of a crash, the airbags may fail to deploy, increasing the risk of injury or death to vehicle occupants.

Description of the cause:

An incorrect spring was used inside the wall connector.

Identification of any warning that can occur:

The airbag light will appear.

Component Manufacturer**Tier of Supplier:** Tier 1**Supplier Type:****Name:** Altex Inc.**Address:** 17201 Westfield Park Road
Westfield IN, 46074**Country:** United States**Tier of Supplier:****Supplier Type:****Name:****Address:****Country:** United States**Involved Components****Component Name 1:** Altex - 511639A

Part 573 Safety Recall Report

26V358

Component Description: Voyager and Pacifica Airbag Overlay
Component Part Number: 511639A

Component Name 2: Altex - 511144A
Component Description: Voyager and Pacifica Airbag Overlay
Component Part Number: 511144A

Component Name 3: Altex - 507866A
Component Description: Voyager and Pacifica Airbag Overlay
Component Part Number: 507866A

Component Name 4: Altex - 606913A-BA
Component Description: Voyager and Pacifica Airbag Overlay
Component Part Number: 606913A-BA

Chronology

5/21/2026 - BraunAbility was repairing units onsite due to illuminated airbag lights and found connector issues

5/22/2026 - Shipment of Chrysler units was stopped while investigation was performed out of an abundance of caution.

5/27/2026 - It was determined that the spring inside the connector in certain units was causing the failure.

6/2/2026 - Field 573 report with NHTSA

Related NHTSA Recall Number:

Description of Remedy

Remedy Type:

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

Defective springs will be replaced

Part 573 Safety Recall Report

26V358

How remedy component differs from recalled component:

The springs differ in coil diameter, coil height, and compressive force.

Identify how/when recall condition was corrected in production:

We discontinued use of this supplier part and sourced a new spring from a new vendor.

Reimbursement Plan

Recall Schedule

Description of recall schedule:

Dealers will be notified to inspect/correct every unit on lot prior to retail sale to customer. To date, only one unit has been retail sold, so that customer will be notified.

Planned Dealer Notification Date: Jun 08, 2026 - Jun 12, 2026 No Dealers

Planned Interim Owner Notification Date: No Owners

Planned Remedy Owner Notification Date: Jul 06, 2026 - Jul 10, 2026 Phased Recall

Date when VIN will be searchable: