



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

# 26V394

**Manufacturer Name:** General Motors, LLC

**Submission Date:** Jun 18, 2026

**NHTSA Recall No.:** 26V394

**Manufacturer Recall No.:** N262555780

### Manufacturer Information

### Population

**Manufacturer Name:** General Motors, LLC

**Address:** 29427 Louis Chevrolet  
Road  
MAIL CODE 480-210-2V  
WARREN MI, 48093

**Total number of potentially involved:** 14,540

**Estimated percentage with defect:** 100%

### Vehicle Information

**Vehicle 1:** 2026-2026 CADILLAC VISTIQ

**Product Category:** Light Vehicles

**Product Type:**

**Fuel / Propulsion:** Electric Battery Power

**Production Dates:** Nov 12, 2024 - Apr 09, 2026

**Number of potentially involved:** 13,629

**Descriptive Information:**

Manufacturing records were used to identify the affected population.

**Vehicle 2:** 2027-2027 CADILLAC VISTIQ

**Product Category:**

**Product Type:**

**Fuel / Propulsion:** Electric Battery Power

**Production Dates:** Jan 16, 2026 - Jun 15, 2026

**Number of potentially involved:** 911

**Descriptive Information:**

Manufacturing records were used to identify the affected population.

### Defect / Noncompliance Description

# Part 573 Safety Recall Report

# 26V394

## Description of the defect or noncompliance:

General Motors has decided that a defect which relates to motor vehicle safety exists in certain 2026 – 2027 model year Cadillac VISTIQ vehicles. The third-row seatbacks in these vehicles can be commanded to power fold into the stowed position with a single press-and-release of the “down” control button located in the cargo area or on the pillar adjacent to the seat. The seatback stops and does not automatically reverse if it encounters an obstruction in the seat.

## FMVSS1:

## FMVSS2:

## Description of the safety risk, including crash, fire, death, injury:

Smaller occupants could become trapped under the seatback, increasing the risk of injury.

## Description of the cause:

## Identification of any warning that can occur:

## Component Manufacturer

### Tier of Supplier:

### Supplier Type:

**Name:** Yanfeng Seating

**Address:** Avenida Multiparque 1400  
Parque Industrial CPA Business Center  
Ciénega de Flores Foreign States, 65550

**Country:** Mexico

## Involved Components

**Component Name 1:** MODULE ASM-FLDG 3RD ROW ST

**Component Description:** Folding 3rd Row Seat Module Assembly

**Component Part Number:** 86270270

## Chronology

# Part 573 Safety Recall Report

# 26V394

On March 31, 2026, a GM engineer submitted a report through GM's Speak Up For Safety (SUFS) program after reviewing an evaluation of the third-row power seatback folding function on a 2026 Cadillac VISTIQ. GM conducted this evaluation after the March 2026 announcement of a recall by a different vehicle manufacturer; this recall related to second- and third-row power seats in certain vehicles failing to appropriately respond to contact with an occupant or object during powered-seat operation.

During the evaluation, the seatback continued its power-folding operation with a 33- to 40-pound box on the seat and stopped in a position that prevented the box from being removed without manually reversing the seat back. In addition to the SUFS subject vehicle, GM is aware of 6 other incidents or complaints potentially associated with this condition. None resulted in injury. These were received by GM on May 1, 2025, June 30, 2025, December 11, 2025, April 14, 2026, and April 17, 2026. On June 11, 2026, GM's Safety Field Action Decision Authority (SFADA) decided to conduct a safety recall.

**Related NHTSA Recall Number:**

## Description of Remedy

**Remedy Type:** Replace, Disconnect/Disable

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

Dealers will replace the folding third row seat module. Until replacement parts are available, vehicles in inventory at dealerships and owners who wish to do so may have the third-row folding feature disabled. When replacement parts are available, the folding feature will be reinstated and updated through a separate customer satisfaction campaign.

**How remedy component differs from recalled component:**

The replacement folding seat module will automatically return the seatback toward the upright seating position if the seatback encounters loads sufficient to halt the folding operation.

**Identify how/when recall condition was corrected in production:**

2026 model year production has already completed. 2027 model year shipments were halted on June 8, 2026.

## Reimbursement Plan

**Description of reimbursement program:**

Pursuant to 49 C.F.R. § 573.13(d)(1), all covered vehicles are under warranty, so reimbursement is not offered.

**Period of reimbursement:**

# Part 573 Safety Recall Report

**26V394****Costs to be reimbursed:****Address for reimbursement claims:**

## Recall Schedule

**Description of recall schedule:**

Dealers will be notified on June 18, 2026. Owner interim notification is estimated to start mailing on August 3, 2026. GM will provide an estimate for owner notification of an available remedy when one is available.

- Planned Dealer Notification Date:** Jun 18, 2026 - Jun 18, 2026  No Dealers
- Planned Interim Owner Notification Date:** Aug 03, 2026 - Aug 03, 2026  No Owners
- Planned Remedy Owner Notification Date:**  Phased Recall
- Date when VIN will be searchable:** Jun 18, 2026