



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V433

Manufacturer Name: Southeast Toyota Distributors, LLC

Submission Date: Jul 06, 2026

NHTSA Recall No.: 26V433

Manufacturer Recall No.: SET26A

Manufacturer Information

Population

Manufacturer Name: Southeast Toyota
Distributors, LLC

Address: 250 Jim Moran Blvd
Deerfield Beach FL, 33442

Total number of potentially involved: 1

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2026 TOYOTA TUNDRA

Product Category: Light Vehicles

Product Type: Light Truck

Fuel / Propulsion: Spark Ignition Fuel

Production Dates: Jan 01, 2026 - Apr 01, 2026

Number of potentially involved: 1

Descriptive Information:

The recall population was determined by searching SET's database for vehicles which received accessories that were not counted towards the net weight of accessories added to the vehicle after final vehicle certification and prior to the first retail sale which exceeded the lesser of 1.5% of the vehicle's GVWR or 100 pounds. Vehicles outside the recall population contain load carrying capacity modification labels that meet the requirements of FMVSS 110.

Defect / Noncompliance Description

Description of the defect or noncompliance:

Pursuant to FMVSS 110 S10, a load carrying capacity modification label must be added to a vehicle if weight exceeding the lesser of 1.5 percent of GVWR or 45.4 kg (100 pounds) is added to a vehicle between final vehicle certification and the first retail sale of the vehicle. The updated load carrying capacity values must be accurate to within 1 percent of the actual added weight. With regard to the vehicle that is subject to this recall, SET added a label informing the purchaser that net accessory weight had been added to the vehicle but did not apply a load carrying capacity modification label that is accurate to within 1 percent of the actual added weight.

FMVSS1: 110 - Tire selection and rims

Part 573 Safety Recall Report

26V433

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

In the affected vehicle, the current load carrying capacity modification label does not reflect a value that is accurate to within one percent (1%) of the weight of accessories installed on the vehicle between final certification and first retail sale. While in the affected vehicle the added accessory weight does not exceed the remaining vehicle payload or passenger carrying capacity, if the information that is provided on the modified label is not accurate to within 1% of the added weight, in the worst case, a vehicle owner may overload a vehicle which may increase the risk of a crash. SET is not aware of any such events.

Description of the cause:

Identification of any warning that can occur:

None

Component Manufacturer

Tier of Supplier:

Supplier Type: Distributor

Name: Southeast Toyota Distributors, LLC

Address: 250 Jim Moran Blvd
Deerfield Beach FL, 33442

Country: United States

Involved Components

Component Name 1: Vehicle Load Capacity Modification Label

Component Description: Vehicle Load Capacity Modification Label

Component Part Number:

Chronology

SET was notified by a dealer on April 10, 2026, that a vehicle in its possession had an accessory package installed that was not listed in the vehicle build sheet. SET investigated and determined that the vehicle received accessories that were not listed on the build sheet due to an inadvertent accessory package deletion after installation had been completed. Thus, while these accessories were not included in the calculation of the load carry capacity modification label under FMVSS 110, the vehicle did receive a label informing the purchaser that weight had been added to the vehicle through the addition of accessories. SET's investigation found that the reported vehicle was the only vehicle

Part 573 Safety Recall Report

26V433

affected by this issue. After the weight of the added accessory package was calculated, the vehicle should have received a modified load carrying capacity label that reflected the total weight added between final certification and first retail sale within 1% of the actual added weight as required by FMVSS 110, S10.2. On June 29, 2026, SET decided to conduct a recall to address this issue on the vehicle in the field. SET is not aware of any complaints, reports or claims potentially related to this issue.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Mail Information/Labels

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

At no cost to the vehicle owner, SET will notify the owner by mail of the noncompliance and will provide them with a new load carrying capacity modification label to be installed over the original modified label. The label will be generated specifically for the owner's vehicle, based on the net weight of the accessories installed. The Owner Notification Letter will include a contact number should the owner qualify for a pre-recall remedy reimbursement.

How remedy component differs from recalled component:

Corrected Vehicle Load Capacity Modification Label accurate to 1% of the actual added weight as required by FMVSS 110.

Identify how/when recall condition was corrected in production:

Modified load carrying capacity labels for vehicles receiving accessories were stopped until the accessory package deletion process was corrected, the calculations were confirmed, and new labels were available.

Reimbursement Plan

Description of reimbursement program:

Period of reimbursement:

Costs to be reimbursed:

Address for reimbursement claims:

250 Jim Moran Blvd
Deerfield Beach FL, 33442

Part 573 Safety Recall Report

26V433

Recall Schedule

Description of recall schedule:

SET will obtain the current owner mailing address data based on the VIN of each individual affected vehicle and will mail the owner notification letter and updated modification label to the owner of the affected vehicle. SET expects the mailing of owner notification letters to begin on or before 09/04/2026.

Planned Dealer Notification Date: Jul 06, 2026 - Jul 07, 2026☐ No Dealers**Planned Interim Owner Notification Date:**☐ No Owners**Planned Remedy Owner Notification Date:** Sep 04, 2026 - Sep 04, 2026☐ Phased Recall**Date when VIN will be searchable:**