



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V458

Manufacturer Name: Jaguar Land Rover North America, LLC

Submission Date: Jul 16, 2026

NHTSA Recall No.: 26V458

Manufacturer Recall No.: D145

Manufacturer Information

Population

Manufacturer Name: Jaguar Land Rover North America, LLC

Address: 100 Jaguar Land Rover
Way
Mahwah NJ, 07495

Total number of potentially involved: 15,535

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2021-2025 LAND ROVER DISCOVERY

Product Category: Light Vehicles

Product Type: Multipurpose Passenger Vehicle

Fuel / Propulsion:

Production Dates: Sep 14, 2020 - Jul 17, 2025

Number of potentially involved: 15,535

Descriptive Information:

Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain 2021-2025MY Land Rover Discovery vehicles built at the Nitra Vehicle Assembly Plant from September 14, 2020 to July 17, 2025. 15,535 Land Rover Discovery vehicles in the United States and Federalized Territories. The basis of the recall population of vehicles was determined by inspection of warranty claims and field report data.

Defect / Noncompliance Description

Description of the defect or noncompliance:

A concern has been identified where the water management system on the tailgate of the vehicle may not be sufficient to allow water to drain away from the rearview camera. This can allow water to pool around the camera installation and, over time, can cause damage to the camera.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Part 573 Safety Recall Report

26V458

A water-damaged camera may not display an image, or may display an unclear image, when requested to do so. Lack of display of a clear camera image could increase the risk of a crash.

Description of the cause:

Identification of any warning that can occur:

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name: Jaguar Land Rover Limited

Address: Abbey Road
Whitley, Coventry Foreign States, CV3 4LF

Country: United Kingdom

Involved Components

Component Name 1: Water management system

Component Description: Water management system

Component Part Number: N/A

Chronology

On 20 February 2026, a Product Safety and Compliance Committee (PSCC) investigation was opened following a review of warranty claim data indicating a potential increased rate of replacements of the rear camera in a small population of 2021 model year Discovery vehicles.

Through the remainder of February and March 2026, the customer verbatims associated with the identified replacements were analysed but revealed no specific pattern or trend. Parts return analysis completed by the supplier concluded the camera did not contain an identifiable defect.

From April 2026 and through to end of June 2026, the investigation was broadened to include later model years, warranty claim detail was reviewed, and predictive hazard curves plotted. In parallel, physical and virtual analysis was completed on the camera and its installation within the vehicle, which showed that under certain heavy rainfall situations, it was possible for water to pool around the camera.

On 09 July 2026 the matter was referred to the PSCC Decision Forum, which instructed a recall be launched to remedy the affected vehicles.

Part 573 Safety Recall Report

26V458

JLR has received 100 claims and field reports in the US between 31 August 2021 and 30 March 2026. There have been no reported accidents, injuries or fires in the US as a result of this concern.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Repair, Replace

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

Vehicles will have additional drain holes drilled in the underside of the tailgate trim which contains the camera. In addition, the functionality of the camera will be verified and, if required, it will be replaced. There will be no charge to the owners for this permanent repair.

How remedy component differs from recalled component:

This is a water management issue, and holes will be drilled in the underside of the tailgate trim to increase drainage around the camera.

Identify how/when recall condition was corrected in production:

Field data shows that the defect may have been cut off at the end of 2025 model year. JLR will continue to monitor warranty claim and field report data for later vehicles and re-open the investigation should a pattern or trend emerge in later vehicles.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Notifications to dealers will occur on July 30, 2026. Distribution of owner notification letters will occur on or before September 11, 2026.

Planned Dealer Notification Date: Jul 30, 2026 - Jul 30, 2026 ☐ No Dealers

Planned Interim Owner Notification Date: Sep 11, 2026 - Sep 11, 2026 ☐ No Owners

Planned Remedy Owner Notification Date: ☐ Phased Recall

Part 573 Safety Recall Report

26V458

Date when VIN will be searchable: