



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V486

Manufacturer Name: Foretravel, Inc.

Submission Date: Jul 27, 2026

NHTSA Recall No.: 26V486

Manufacturer Recall No.:

Manufacturer Information

Population

Manufacturer Name: Foretravel, Inc.

Address: 1221 N.W. Stallings Drive
Nacogdoches TX, 75964

Total number of potentially involved: 69

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2025-2025 FORETRAVEL PRESIDENTIAL REALM

Product Category: Buses, Medium & Heavy Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Sep 20, 2023 - Nov 29, 2024

Number of potentially involved: 24

Descriptive Information:

Foretravel was notified of units purchased from Spartan RV chassis for this model year.

Vehicles with correct pressure switches show no signs of brake lights staying on

Vehicle 2: 2027-2027 FORETRAVEL REALM

Product Category: Buses, Medium & Heavy Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Jun 10, 2025 - Mar 04, 2026

Number of potentially involved: 11

Descriptive Information:

Foretravel was notified of units purchased from Spartan RV chassis for this model year.

Vehicles with correct pressure switches show no signs of brake lights staying on

Part 573 Safety Recall Report

26V486**Vehicle 3:** 2026-2026 FORETRAVEL PRESIDENTIAL REALM**Product Category:** Buses, Medium & Heavy Vehicles**Product Type:****Fuel / Propulsion:****Production Dates:** Jun 24, 2024 - Nov 26, 2025**Number of potentially involved:** 34**Descriptive Information:**

Foretravel was notified of units purchased from Spartan RV chassis for this model year.

Vehicles with correct pressure switches show no signs of brake lights staying on

Defect / Noncompliance Description

Description of the defect or noncompliance:

Motorcoaches will fail to conform to the requirements of Federal Motor Vehicle Safety Standard NO. 108- Lamps, Reflective Devices and Associated Equipment. The brake pressure switch used in the air brake system may retain enough residual air pressure causing the brake lamps to be illuminated when the service brake is not applied.

FMVSS1:**FMVSS2:****Description of the safety risk, including crash, fire, death, injury:**

Brake lamps that are illuminated without the service brake being applied could be confusing to trailing drivers and could increase the risk of a crash.

Description of the cause:

Service brake pressure switches activate under to low of pressure.

Identification of any warning that can occur:

Brake lights could be illuminated without any warning or no service brake application.

Component Manufacturer

Tier of Supplier: Tier 1**Supplier Type:** OEM**Name:** Spartan RV Chassis

Part 573 Safety Recall Report

26V486

Address: 1000 Reynolds Road
Charlotte MI, 48813

Country: United States

Involved Components

Component Name 1: Pressure Switch

Component Description: Service Brake Pressure switch

Component Part Number: unknown at this time Spartan to supply

Chronology

On 7-21-2026 Foretravel was notified by Spartan that Recall 26V 292 was forth coming.

On 7-22-2026 a Recall committee was formed.

On 7-24-2026 committee voted to instigate a Recall

On 7-27 Foretravel notified NHTSA that we decided to Recall all vehicles involved with Spartan recall 26V-292.

Related NHTSA Recall Number: 23V292

Description of Remedy

Remedy Type: Replace, Inspect

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

Shyft: Spartan RV Chassis will supply new pressure switches with a pressure setting that will cause the brake lamps to not be illuminated with residual air pressure

How remedy component differs from recalled component:

The remedy component has a specified pressure setting that will cause the circuit for the brake lamps to be closed and not allow them to be illuminated unless the service brake is applied.

Identify how/when recall condition was corrected in production:

New pressure switches were implemented in September 2025

Part 573 Safety Recall Report

26V486

Reimbursement Plan

Description of reimbursement program:

Shyft will supply Foretravel with new pressure switches with a pressure setting that will cause the brake lamps to not be illuminated with residual air pressure. The repair is expected to up to 1 hour shop labor and will be performed at no charge to owners.

Period of reimbursement:

Until all units are completed with new switches

Costs to be reimbursed:

The repair is expected to take up to 1 hour at shop labor rate and will be performed at no charge to owner.

Address for reimbursement claims:

1221 NW Stallings Dr,
811 NW Stallings Dr.
Nacogdoches TX, 75964

Recall Schedule

Description of recall schedule:

Dealer notification letters will go out on Sep. 14 thru Sep 18, 2026
Owner notification letters will go out on Sep. 21 thru Sep-25, 2026

Planned Dealer Notification Date: Sep 14, 2026 - Sep 18, 2026

☐ No Dealers

Planned Interim Owner Notification Date:

☐ No Owners

Planned Remedy Owner Notification Date: Sep 21, 2026 - Sep 25, 2026

☐ Phased Recall

Date when VIN will be searchable: