



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V499

Manufacturer Name: Brinkley RV

Submission Date: Jul 30, 2026

NHTSA Recall No.: 26V499

Manufacturer Recall No.: REC-2603

Manufacturer Information

Population

Manufacturer Name: Brinkley RV

Address: 1655 Brinkley Way East
GOSHEN IN, 46528

Total number of potentially involved: 28

Estimated percentage with defect: 75%

Vehicle Information

Vehicle 1: 2027-2027 BRINKLEY RV MODEL I

Product Category: Trailers

Product Type: Recreational Trailers

Fuel / Propulsion:

Production Dates: Jun 10, 2026 - Jun 17, 2026

Number of potentially involved: 28

Descriptive Information:

The vehicles in the recall population include Brinkley Model Ix 24x travel trailers that were built between 6/10/2026 and 6/17/2026. It has been decided that vehicles in the recall population may have an exterior ladder that is installed outside of the designated support backers. The affected population began when Brinkley RV started building the Ix 24x at a new facility and ended when Brinkley discovered and corrected the discrepancy.

Defect / Noncompliance Description

Description of the defect or noncompliance:

It has been determined that vehicles within the recall population may be equipped with an exterior ladder that was installed outside of the designated support backer.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

If the ladder is not properly secured into a backer, the ladder may become detached during use and

Part 573 Safety Recall Report

26V499

could cause an individual to fall. This could lead to personal injury or death.

Description of the cause:

The screws securing the ladder to the sidewall may not be seated properly in a backer.

Identification of any warning that can occur:

The ladder may display screws pulling out and/or the ladder may be loose to wall. Do not use the exterior ladder until the recall has been completed.

Component Manufacturer

Tier of Supplier:**Supplier Type:****Name:** NA**Address:****Country:**

Involved Components

Component Name 1: Ladder Exterior 75" Black Collapsible REC Pro 6 St**Component Description:** Exterior Ladder**Component Part Number:** 119882

Chronology

7/21/26 Received a warranty case regarding Ladder securement. Manufacturing determined the cause and corrected the installation of ladder placement. 7/23/26 Safety committee voted to recall the 28 affected units. There is one warranty case received on 7/21/26 that began the investigation. Brinkley RV has had 0 injuries reported due to this issue.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Inspect, Replace

Part 573 Safety Recall Report

26V499

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

Brinkley RV will have the affected ladders inspected and if necessary, relocated to the proper position on the unit. The ladders will be secured by screws in the already installed EGS backers in the sidewall. This will be completed by a local dealer or service repair center. This will be done at no cost to the owner. All reimbursements will be covered by Brinkley RV's general reimbursement policy. Owners who have previously paid to have this remedy performed will, upon documentation of the work, be immediately reimbursed by Brinkley RV.

How remedy component differs from recalled component:

The remedy will be secured to the EGS backers already installed in the sidewall.

Identify how/when recall condition was corrected in production:

Manufacturing corrected the placement of the ladder on the production line.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Planned Dealer Notification Date: Aug 04, 2026 - Aug 04, 2026 ☐ No Dealers

Planned Interim Owner Notification Date: ☐ No Owners

Planned Remedy Owner Notification Date: Aug 07, 2026 - Aug 07, 2026 ☐ Phased Recall

Date when VIN will be searchable: Aug 07, 2026