



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V508

Manufacturer Name: Rivian Automotive, LLC

Submission Date: Aug 05, 2026

NHTSA Recall No.: 26V508

Manufacturer Recall No.: FSAM-1833

Manufacturer Information

Population

Manufacturer Name: Rivian Automotive, LLC

Address: 13250 North Haggerty Road
PLYMOUTH MI, 48170

Total number of potentially involved: 3,829

Estimated percentage with defect: 0.6%

Vehicle Information

Vehicle 1: 2025-2026 RIVIAN R1S

Product Category: Light Vehicles

Product Type: Multipurpose Passenger Vehicle

Fuel / Propulsion: Electric Battery Power

Production Dates: Jun 12, 2024 - May 26, 2026

Number of potentially involved: 3,204

Descriptive Information:

The recall is an expansion of NHTSA ID no. 25V-387 (originally filed on June 11, 2025) in which certain additional Model Year 2025 and 2026 R1T and R1S vehicles may have been built with front turn signal lamps that do not meet current production specifications due to incorrectly manufactured parts from the supplier. These additional vehicles may have been built with parts that were not properly quarantined by the supplier. The suspect period began on June 12, 2024, when Rivian started to build vehicles with front turn signal lamps that were potentially incorrectly manufactured and ended on May 26, 2026, when Rivian stopped building vehicles with the suspect front turn signal lamps. That population was determined using manufacturing records. Similar vehicles not included in this recall have properly manufactured front turn signal lamps.

Vehicle 2: 2025-2026 RIVIAN R1T

Product Category: Light Vehicles

Product Type: Light Truck

Fuel / Propulsion: Electric Battery Power

Production Dates: Oct 01, 2024 - Mar 19, 2026

Number of potentially involved: 625

Descriptive Information:

The recall is an expansion of NHTSA ID no. 25V-387 (originally filed on June 11, 2025) in which certain additional Model Year 2025 and 2026 R1T and R1S vehicles may have been built with front turn signal

Part 573 Safety Recall Report

26V508

lamps that do not meet current production specifications due to incorrectly manufactured parts from the supplier. These additional vehicles may have been built with parts that were not properly quarantined by the supplier. The suspect period began on June 12, 2024, when Rivian started to build vehicles with front turn signal lamps that were potentially incorrectly manufactured and ended on May 26, 2026, when Rivian stopped building vehicles with the suspect front turn signal lamps. That population was determined using manufacturing records. Similar vehicles not included in this recall have properly manufactured front turn signal lamps.

Defect / Noncompliance Description

Description of the defect or noncompliance:

One or both front turn signal lamps may not illuminate and flash, and, therefore, may not fulfill the requirements of FMVSS 108.

FMVSS1: 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Diminished front turn signal lamp performance may cause reduced awareness of the vehicle's intent to turn for road users in front of the vehicle. Reduced awareness of intent to turn may increase the risk of a crash. Rivian is not aware of any crashes, injuries, or fatalities related to this condition.

Description of the cause:

Issues during turn signal lamps manufacturing by the supplier may result in an internal failure of some turn signal lamps during use.

Identification of any warning that can occur:

If one or more front turn signal lamps fail to illuminate, a message that says "Turn signal lights not working. Service it soon." appears on the driver display. This, along with double speed blinking from the remaining turn signal lamps and double speed turn signal sounds, will alert the driver that one of their turn signals is not illuminated.

Component Manufacturer

Tier of Supplier: Tier 1

Supplier Type: OEM

Name: Myotek

Address: 37000 Grand River Avenue
Suite 220
Farmington Hills MI, 48335

Country: United States

Part 573 Safety Recall Report

26V508

Involved Components

Component Name 1: Lamp, Fascia, Lower, RH**Component Description:** DIRECTION INDICATOR LAMP RH**Component Part Number:** PT00882633**Component Name 2:** Lamp, Fascia, Lower, LH**Component Description:** DIRECTION INDICATOR LAMP LH**Component Part Number:** PT00882632

Chronology

In June 2025, Rivian determined that a potential noncompliance to FMVSS 108, Lamps, reflective devices, and assoc. equipment cannot be ruled out on a population of vehicles built with suspect turn signals and submitted recall NHTSA ID no. 25V-387.

From June 2025 to July 2026, Rivian continued to monitor field performance and identified 17 instances of turn signal failure that appeared identical to the condition of NHTSA ID no. 25V-387. Further investigation identified that these instances were a result of the same condition occurring in turn signal supply that was not properly contained by the supplier.

On July 31, 2026, Rivian determined that an additional population of 3,829 vehicles should be added to NHTSA ID no. 25V-387, filed on June 11, 2025. These additional vehicles may have been built with parts that were not properly quarantined by the supplier. NHTSA requested Rivian file a separate recall from NHTSA ID no. 25V-387 for the additional vehicles affected by the existing recall condition.

As of the date of this filing, Rivian is not aware of any accidents or injuries related to this issue in any market.

Related NHTSA Recall Number: This recall is an expansion of recall 25V387 due to incomplete containment by the component supplier

Description of Remedy

Remedy Type: Inspect, Replace**Consumer Advisories:** ☐ Do Not Drive ☐ Park Outside**Description of remedy program:**

Rivian will inspect and/or replace the front turn signal lamps on the potentially affected vehicles.

Part 573 Safety Recall Report

26V508**How remedy component differs from recalled component:**

The remedy component will be front turn signal lamps that meet current production specifications.

Identify how/when recall condition was corrected in production:

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

We will mail notifications on or before September 29, 2026.

Planned Dealer Notification Date:☒ No Dealers**Planned Interim Owner Notification Date:** Sep 29, 2026 - Sep 29, 2026☐ No Owners**Planned Remedy Owner Notification Date:** Sep 29, 2026 - Sep 29, 2026☐ Phased Recall

Date when VIN will be searchable: Aug 31, 2026