



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V527

Manufacturer Name: Jaguar Land Rover North America, LLC

Submission Date: Aug 13, 2026

NHTSA Recall No.: 26V527

Manufacturer Recall No.: D148

Manufacturer Information

Population

Manufacturer Name: Jaguar Land Rover North America, LLC

Address: 100 Jaguar Land Rover
Way
Mahwah NJ, 07495

Total number of potentially involved: 14

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2016-2017 LAND ROVER RANGE ROVER

Product Category: Light Vehicles

Product Type: Multipurpose Passenger Vehicle

Fuel / Propulsion:

Production Dates: Nov 24, 2015 - Jul 18, 2017

Number of potentially involved: 14

Descriptive Information:

Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain 2016-2017MY Land Rover Range Rover vehicles built at the Solihull Vehicle Assembly Plant from November 24, 2015 to July 18, 2017. 14 Land Rover Range Rover vehicles in the United States and Federalized Territories. The basis of the recall population of vehicles was determined to be those identified through warranty records as not having had the correct specification of front suspension knuckle fitted as part of a prior recall action.

Defect / Noncompliance Description

Description of the defect or noncompliance:

A concern has been identified on a small number of vehicles where prior versions of the repair procedure for safety recalls D025 (non-US recall), D027 (25V-514) & N759 (25V-514) had not accounted for a specific vehicle variant. As a result, the front suspension knuckles have been replaced with those of an incorrect specification.

FMVSS1:

Part 573 Safety Recall Report

26V527

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

The performance of the incorrectly specified front suspension knuckles has not been quantified, meaning that the behavior of the vehicle under extreme maneuver conditions cannot be assured, potentially increasing the risk of a crash.

Description of the cause:

Identification of any warning that can occur:

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name: SuperAlloy Industrial Co. Ltd

Address: 41, Yun-Ko Road Section 3
Dou-Liu City, Yun-Lin County Foreign States, 64064

Country: Taiwan, Province Of China

Involved Components

Component Name 1: Front suspension knuckle

Component Description: Front suspension knuckle

Component Part Number: CPLA-3K206-BC

Component Name 2: Front suspension knuckle

Component Description: Front suspension knuckle

Component Part Number: CPLA-3K207-BC

Chronology

During the course of repairs under prior safety recalls D025, D027 & N759, a concern was raised that the replacement front suspension knuckle had been difficult to fit onto a small number of vehicles. On

Part 573 Safety Recall Report

26V527

inspection of the engineering release data, it was revealed that the as-published repair procedure did not specify the correct replacement part for Range Rover SV vehicles.

On 04 August 2026, the issue was referred to JLR's Product Safety and Compliance Committee (PSCC) for review, where it was concluded that as there was no vehicle sign-off data assuring the quality and performance of the vehicle with the incorrect suspension knuckle specification fitted, the matter should be escalated to the PSCC Decision Forum.

On 06 August 2026, the PSCC Decision Forum reviewed the matter and requested a safety recall be launched to remedy the incorrectly repaired vehicles.

JLR has not received any claims or field reports in the USA related to this issue.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Repair, Replace

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

Vehicles will have both front suspension knuckles replaced.

There will be no charge to the owners for this repair.

How remedy component differs from recalled component:

The remedy component will be of the same specification originally designed for the vehicle, where the recalled component was not intended for use on these vehicles.

Identify how/when recall condition was corrected in production:

This defect does not affect production vehicles as it concerns the incorrect repair of vehicles during the course of recall remedy.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Notifications to dealers will occur on or before August 27, 2026. Distribution of owner notification letters

Part 573 Safety Recall Report**26V527**

will occur on or before October 9, 2026.

Planned Dealer Notification Date: Aug 27, 2026 - Aug 27, 2026

☐ No Dealers

Planned Interim Owner Notification Date: Oct 09, 2026 - Oct 09, 2026

☐ No Owners

Planned Remedy Owner Notification Date:

☐ Phased Recall

Date when VIN will be searchable: