



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

26V557

Manufacturer Name: Tiffin Motorhomes, Inc.

Submission Date: Sep 03, 2026

NHTSA Recall No.: 26V557

Manufacturer Recall No.: WAY-108

Manufacturer Information

Population

Manufacturer Name: Tiffin Motorhomes, Inc.

Address: 105 2nd Street NW
PO Box 596
Red Bay AL, 35582

Total number of potentially involved: 88

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2026-2027 TIFFIN WAYFARER

Product Category: Buses, Medium & Heavy Vehicles

Product Type: Recreational Vehicle

Fuel / Propulsion:

Production Dates: Jul 30, 2025 - Aug 24, 2026

Number of potentially involved: 88

Descriptive Information:

The recall population includes all 2026 Wayfarer 25 RW models only and 2027 Wayfarers, all models. These motorhomes have the LP tank installed under the body of the motorhome and do not have a remote LP shut off switch installed. These LP tanks are also installed with a incorrect mounting bracket. The motorhomes not involved in the recall have the LP tank installed in a nonlocking compartment so that the shut off valve is easily accessible or under the body of the motorhome with a remote LP shut off valve installed that has a switch in an easily accessible nonlocking outside compartment. The motorhomes not involved in the recall also have an LP tanks that is attached with the correct bracket.

Defect / Noncompliance Description

Description of the defect or noncompliance:

The LP tank is installed at a distance greater than 18 inches from the outside wall of the motorhome and does not have a remote shut off valve for the LP tank installed. The bracket used to secure the front side of the LP tanks to the motorhome was not built to specifications, which causes some movement in the attachment of the LP tank.

FMVSS1:

Part 573 Safety Recall Report

26V557

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

If an owner cannot access the shut off valve for the LP tank, there is an increased risk of fire. If an LP tank were to become loose, it could increase the risk of an accident.

Description of the cause:

NFPA codes were not reviewed when the tank location was moved from a compartment to underneath the coach and the bracket that is securing the LP tank was not reviewed to make sure it was built to specifications.

Identification of any warning that can occur:

There is no warning.

Component Manufacturer

Tier of Supplier: Tier 1

Supplier Type: Other

Name: ROCK CITY DESIGN

Address: 8600 STATE HWY 233
WINFIELD AL, 35594

Country: United States

Involved Components

Component Name 1: BRKT MNT FRT MID LP

Component Description: FRONT BRACKET LP TANK

Component Part Number: 5188145

Chronology

07/30/2026 A dealer sent a video showing the LP attachment on a 2027 Wayfarer to Tiffin. An investigation began into placement of the LP tank and the brackets used to secure the tank. 08/04/2026 while reviewing the bracket drawings, engineering found that instead of being produced with 2 angled gussets, the fabricator had only installed one, so it was not produced to spec. 08/05/2026 Engineering states the tank valve is located 36" from the coach sidewall in the vertical position. While reviewing the NFPA codes for installation of the LP tank, it was also found that the tank was more than 18" from the coach sidewall and there was no remote shut off installed. Investigation continued by checking units in production and in the process of PDI. 08/24/2026 Tiffin's monthly safety committee was held and due to

Part 573 Safety Recall Report

26V557

the lack of a remote shut off being installed and the incorrect forward bracket, the safety committee voted to issue a recall.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Repair

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

Tiffin will install a remote shut off for the LP tank and replace the incorrect bracket with the correct one.

How remedy component differs from recalled component:

The remedy LP tank will have a remote shut off installed and the front bracket on the LP tank will have 2 angular brackets instead of 1.

Identify how/when recall condition was corrected in production:

All motorhomes in the process of production had a remote LP shutoff installed and the switch was installed in an outside non-locking compartment and the front bracket on the tank was replaced with the correctly manufactured bracket.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Tiffin Motorhomes will mail letters to customers and dealers that are in possession of the involved motorhomes explaining the issue and asking them to take the motorhome to a dealer or service center for the valve to be installed and the bracket updated. This will be done at no cost to the owner.

Planned Dealer Notification Date: Oct 30, 2026 - Oct 30, 2026 ☐ No Dealers

Planned Interim Owner Notification Date: ☐ No Owners

Planned Remedy Owner Notification Date: Oct 30, 2026 - Oct 30, 2026 ☐ Phased Recall

Part 573 Safety Recall Report

26V557

Date when VIN will be searchable: Oct 30, 2026